



CONDITION REPORT



Report No:
2016959325
DATE
26/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	26/07/2025		M57 Pretoria Road - 1619
Inspection Date	26/07/2025		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	NISSAN	Registration Number	HJL972FS
Model	NP200 1.6 8V BASE PU [2009-2019]	Register Number	
VIN	ADNUSN1D5U0122814	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2016	Paint Finish	C - COMMON
Km Reading	195,396 KM	Fuel	PETROL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADNUSN1D5U0122814



CONDITION REPORT



Report No:
2016959325
DATE
26/07/2025

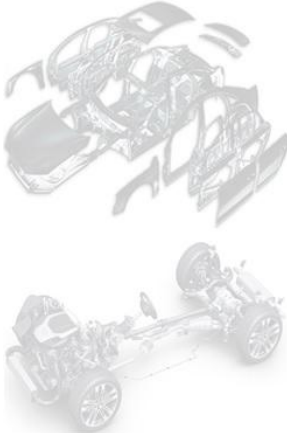	Damage	Repair Way
	Tail Light Right Cracked	Replace
	Seat Front Right Torn / Cut	Repair
	Carpet Front Torn / Cut	Repair
	Bonnet Dented	Repair
	Front Fender Left Dented	Repair
	Door Front Left Dented	Repair
	Tailgate Dented	Repair
	Tie Rod End left Damaged	Replace
	Tie Rod End right Damaged	Replace
	Hydraulics System Sweat	Repair
	Tyre Front Left Smooth	Replace
	Rim Front Left Dented	Repair
	Body exterior	Signs of spray work done on some body panels
	Engine	Bottom of engine is fully covered

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s²]
Front	2.21	2.27	-	
Rear	1.1	1.19	-	
Emergency / Parking	0.98	0.82	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88T	Hilo	Genesys	V	0223	0 mm
Front Right	185/65R15	88T	Hilo	Genesys	V	0223	2 mm
Rear Left	195/65R15	91V	General	Altimax	V	0522	5 mm
Rear Right	195/65R15	91V	General	Altimax	V	3722	4 mm
Spare	185/65R15	92T	Barum	Brillantis	V	//////	4 mm

* Tyre Legend: V=Virgin, R=Rechap



CONDITION REPORT



Report No:
2016959325
DATE
26/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	BCM	000100	PLEASE REFER TO VEHICLE SERVICE MANUAL	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, EXTERIOR, AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0122814



CONDITION REPORT



Report No:
2016959325
DATE
26/07/2025



REAR LEFT CORNER



FRONT RIGHT CORNER




90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT

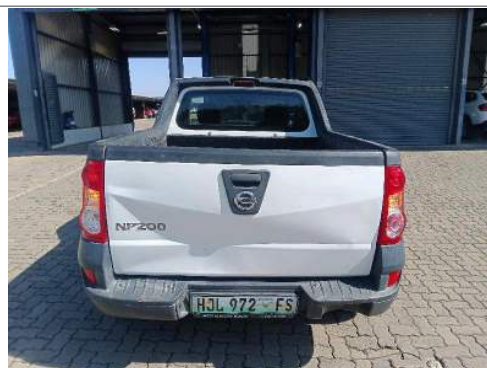

90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0122814



CONDITION REPORT



Report No:
2016959325
DATE
26/07/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



MANUAL GEAR LEVER



EXPANSION BOTTLE



OIL CAP AND DIPSTICK

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADNUSN1D5U0122814



CONDITION REPORT



Report No:
2016959325
DATE
26/07/2025

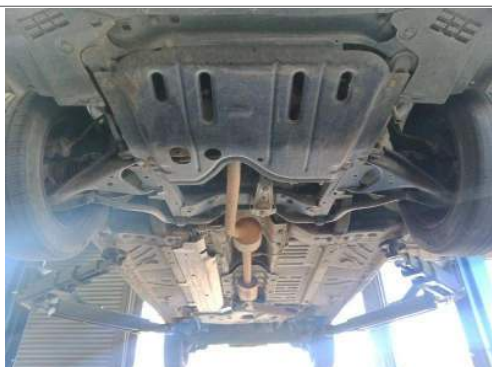

CHASSIS



CHASSIS 2



ENGINE 1



ENGINE 2



SPARE WHEEL



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0122814



CONDITION REPORT



Report No:
2016959325
DATE
26/07/2025



LR TYRE TREAD




RR TYRE TREAD




RF TYRE TREAD



LICENSE DISC

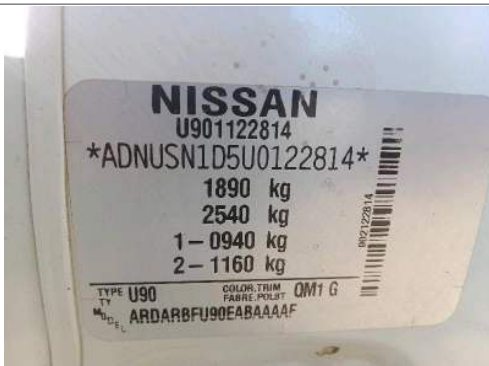

VIN PLATE OR STICKER

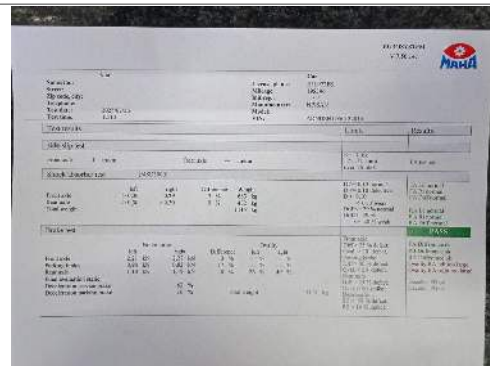

SHOCK AND BRAKE TEST REPORT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADNUSN1D5U0122814




CONDITION REPORT



Report No:
2016959325
DATE
26/07/2025

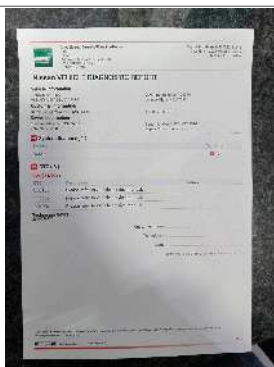

DIAGNOSTIC TEST REPORT

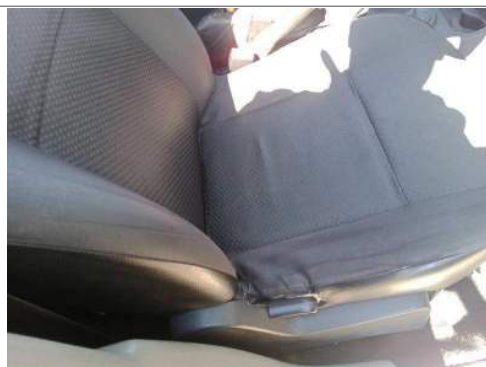

Seat Front Right



Carpet Front



Tail Light Right



Tailgate



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0122814



CONDITION REPORT



Report No:
2016959325
DATE
26/07/2025



Bonnet



Tie Rod End right



Tyre Front Left



Tie Rod End left



Rim Front Left



Hydraulics System

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0122814



CONDITION REPORT



Report No:
2016959325
DATE
26/07/2025



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0122814