



CONDITION REPORT



Report No:
2017299407
DATE
16/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/09/2026		M57 Pretoria Road - 1619
Inspection Date	16/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	N/A
Model	NP200 1.6 BASE SAFETY PU [2019-2025]	Register Number	
VIN	ADNUSN1D5U0167511	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/03/2022
Color	SILVER	Power / Displacement	
Year Model	2019	Paint Finish	M - METALLIC
Km Reading	57,520 KM	Fuel	PETROL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0167511



CONDITION REPORT



Report No:
2017299407
DATE
16/09/2026



Damage

Repair Way

Side Mirror Right Damaged	Replace
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Dented	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Tailgate Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Rear Right Damaged	Replace
Rim Rear Left Dented	Repair
Rim Rear Right Dented	Repair
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Gearbox Mountings Damaged	Replace
Gearbox Oil Leak	Repair
Gear Selections Malfunction	Repair
Vehicle struggle to start	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.3	2.0	-	
Rear	1.0	0.5	-	
Emergency / Parking	1	0.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/60R15	88H	Road king	Radial f109	V	1115	3 mm
Front Right	185/65R15	88H	Double Star	Maximum	V	4722	3 mm
Rear Left	185/65R15	92T	Barum	Brilliants	V	1419	3 mm
Rear Right	185/65R15	92T	Barum	Brilliants	V	0221	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0167511



CONDITION REPORT



Report No:
2017299407
DATE
16/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PAST	B1042	ECU SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADNUSN1D5U0167511



CONDITION REPORT



Report No:
2017299407
DATE
16/09/2026

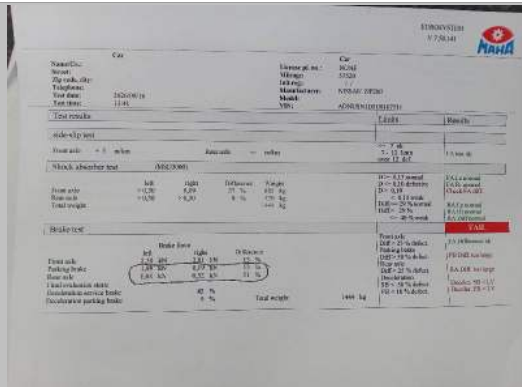

Shock and brake report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0167511



CONDITION REPORT



Report No:
2017299407
DATE
16/09/2026



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADNUSN1D5U0167511



CONDITION REPORT




Report No:
2017299407
DATE
16/09/2026

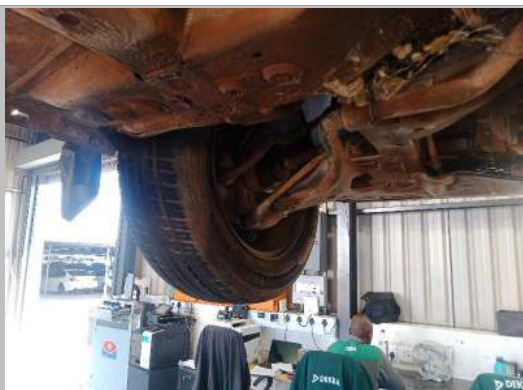

LF TYRE TREAD



LR TYRE TREAD

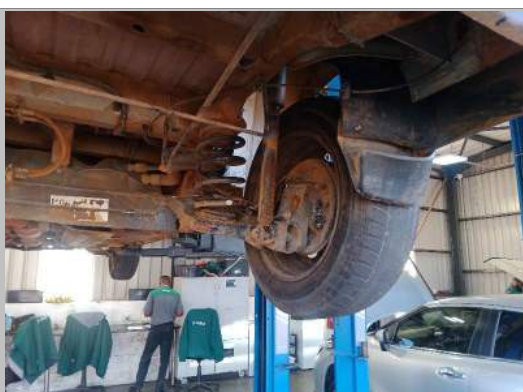

RR TYRE TREAD



RF TYRE TREAD



No spare wheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0167511



CONDITION REPORT



Report No:

2017299407

DATE

16/09/2026



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Expenditure bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0167511



CONDITION REPORT



Report No:
2017299407
DATE
16/09/2026



Gear Selections



Water level



Side Mirror Right

Test date:	2026-09-16	Manufacturer:	NISSAN NP
Test time:	12:41	Model:	ADNUSN1D5U016751
Test results:		VIN:	ADNUSN1D5U016751
side-slip test			
Front axle:	+ 5 m/km	Rear axle:	- 20 km
Shock absorber test (MSD1000)			
Front axle	left	right	Difference
Rear axle	> 0,30	> 0,30	27 %
Total weight	> 0,30	> 0,30	0 %
			1444 kg
Brake test			
	left	right	Difference
Front axle	2,30 kN	2,01 kN	12 %
Parking brake	1,09 kN	0,19 kN	83 %
Rear axle	1,09 kN	0,52 kN	51 %
Final evaluation static			
Deceleration service brake	42 %		
Deceleration parking brake	9 %		
		Total weight	1444 kg

Parking Brake Performance

Test time:	12:41	Model:	ADNUSN1D5U016751
Test results:		VIN:	ADNUSN1D5U016751
side-slip test			
Front axle:	+ 5 m/km	Rear axle:	- 20 km
Shock absorber test (MSD1000)			
Front axle	left	right	Difference
Rear axle	> 0,30	> 0,30	27 %
Total weight	> 0,30	> 0,30	0 %
			1444 kg
Brake test			
	left	right	Difference
Front axle	2,30 kN	2,01 kN	12 %
Parking brake	1,09 kN	0,19 kN	83 %
Rear axle	1,09 kN	0,52 kN	51 %
Final evaluation static			
Deceleration service brake	42 %		
Deceleration parking brake	9 %		
		Total weight	1444 kg

Service Brake Performance Rear Axle



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0167511



CONDITION REPORT



Report No:
2017299407
DATE
16/09/2026



Door Front Right



Bonnet



Front Fender Left



Door Front Left



Rear Fender Left



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0167511



CONDITION REPORT



Report No:
2017299407
DATE
16/09/2026



Tailgate



Rear bumper



Rear bumper



Rim Rear Left



Bolt(s) / Nut(s) Rear Wheel Left



Bolt(s) / Nut(s) Front Wheel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0167511



CONDITION REPORT



Report No:
2017299407
DATE
16/09/2026



Bolt(s) / Nut(s) Rear Wheel Right



Rim Rear Right



Tyre Rear Right



Gearbox Mountings



Gearbox



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0167511