



## CONDITION REPORT



Report No:  
2016963102  
DATE  
30/07/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 30/07/2025        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 30/07/2025        |                     | Kempton Park - GT        |

## Vehicle Data

|                 |                                           |                         |            |
|-----------------|-------------------------------------------|-------------------------|------------|
| Vehicle Type    | LIGHT LOAD VEHICLE                        | Registered Owner        | MFC        |
| Manufacturer    | NISSAN                                    | Registration Number     | KSP064NW   |
| Model           | NP200 1.6 8V BASE +AC SAFETY PU [2011-ON] | Register Number         |            |
| VIN             | ADNUSN1D5U0206195                         | Date Of First Licensing |            |
| Engine Number   |                                           | Last COR                |            |
| Doors           | 2                                         | License Expiry Date     | 31/05/2026 |
| Color           | WHITE                                     | Power / Displacement    |            |
| Year Model      | 2022                                      | Paint Finish            | C - COMMON |
| Km Reading      | 82,578 KM                                 | Fuel                    | PETROL     |
| Cab / Body Type | SINGLE CAB                                | Transmission            | MANUAL     |

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: ADNUSN1D5U0206195



## CONDITION REPORT



Report No:  
2016963102  
DATE  
30/07/2025

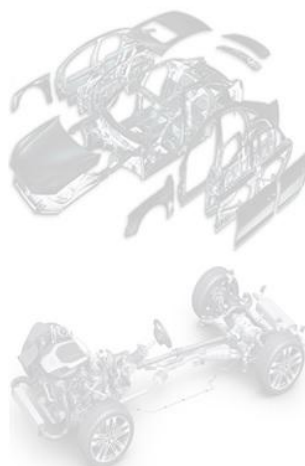

## Damage

## Repair Way

|                                              |        |
|----------------------------------------------|--------|
| Engine Oil Leak                              | Repair |
| Engine Wiring Torn / Cut                     | Repair |
| Center Console / Cubbyhole + Lid Damaged     | Repair |
| Seat Front Right Torn / Cut                  | Repair |
| Bonnet Dented                                | Repair |
| Front Fender Right Residual Traces of Repair | Repair |
| Tailgate Paintwork • Scratched               | Repair |
| Rear bumper Damaged                          | Repair |
| Fuel Flap Damaged                            | Repair |
| Sill Panel Left Dented                       | Repair |
| Roof Dented                                  | Repair |
| Rim Front Left Damaged                       | Repair |
| Rim Rear Left Damaged                        | Repair |

## Brakes

## Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 2.4                | 2.5                | -                |                                  |
| Rear                | 1.3                | 1.4                | -                |                                  |
| Emergency / Parking | 1                  | 1.3                | -                |                                  |

## Tyres and Rims

## Tyre Specification &amp; Measurement

|             | Size      | Load/Speed Index | Manufacture | Model      | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|------------|-------|-----------------|------------------|
| Front Left  | 185/65R15 | 92T              | Dunlop      | Sport      | V     | 3024            | 1 mm             |
| Front Right | 185/65R15 | 92T              | Dunlop      | Sport      | V     | 3024            | 1 mm             |
| Rear Left   | 185/65R15 | 92T              | Barum       | Brillantis | V     | 1522            | 4 mm             |
| Rear Right  | 185/65R15 | 92T              | Dunlop      | Sport      | V     | 3054            | 4 mm             |
| Spare       | 185/65R15 | 92T              | Barum       | Brillantis | V     | 0000            | 2 mm             |

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: ADNUSN1D5U0206195



## CONDITION REPORT



Report No:  
2016963102  
DATE  
30/07/2025

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System | Code   | Description                            | Status |
|----|--------|--------|----------------------------------------|--------|
| 1  | BCM    | 000100 | PLEASE REFER TO VEHICLE SERVICE MANUAL |        |

### Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Bottom of engine is covered.

Body • Exterior: Residual traces of poor repair on some body panels. Signs of spray work done on some body panels.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: ADNUSN1D5U0206195




## CONDITION REPORT



Report No:  
2016963102  
DATE  
30/07/2025

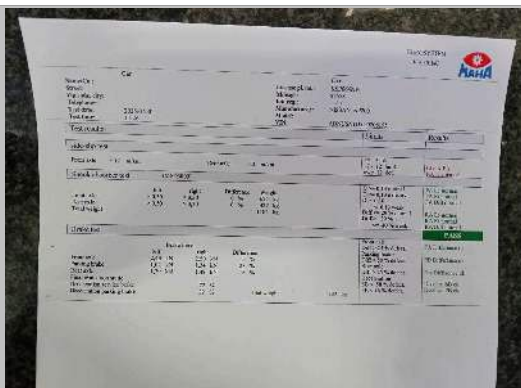

Shock and brake report

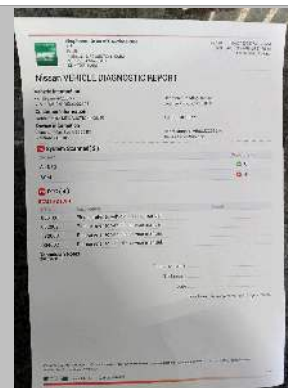

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: ADNUSN1D5U0206195



## CONDITION REPORT



Report No:  
2016963102  
DATE  
30/07/2025



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: ADNUSN1D5U0206195



## CONDITION REPORT



Report No:  
2016963102  
DATE  
30/07/2025



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: ADNUSN1D5U0206195



## CONDITION REPORT



Report No:  
2016963102  
DATE  
30/07/2025

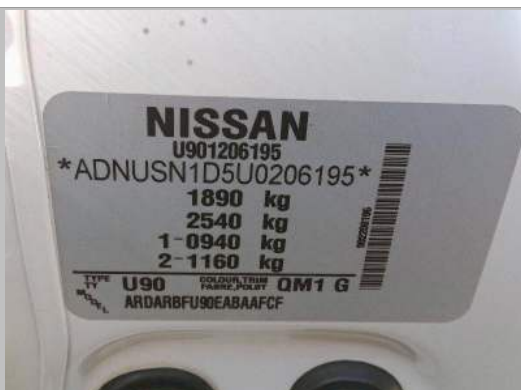

VIN PLATE OR STICKER



ENGINE 1




ENGINE 2



CHASSIS



Rear end

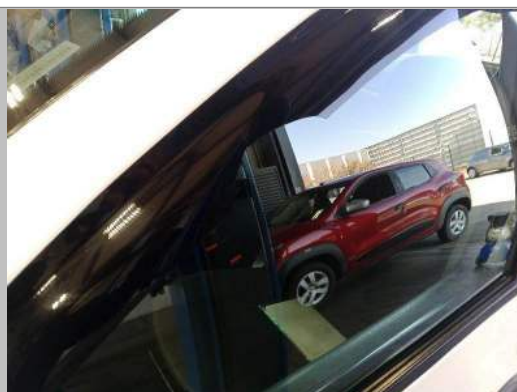

Left door wind deflector damage

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: ADNUSN1D5U0206195



## CONDITION REPORT



Report No:  
2016963102  
DATE  
30/07/2025




Expansion bottle



Oil cap and dipstick



Water level

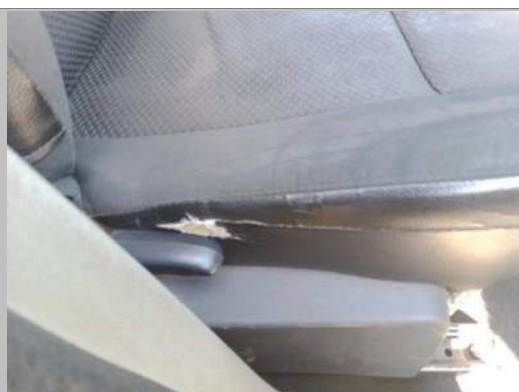

Seat Front Right



Seat Front Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: ADNUSN1D5U0206195



## CONDITION REPORT



Report No:  
2016963102  
DATE  
30/07/2025



Fuel Flap



Bonnet



Roof



Rim Front Left



Sill Panel Left



Rim Rear Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: ADNUSN1D5U0206195



## CONDITION REPORT



Report No:  
2016963102  
DATE  
30/07/2025



Rim Rear Left



Tailgate



Rear bumper



Engine



Engine



Engine Wiring

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: ADNUSN1D5U0206195



## CONDITION REPORT



Report No:  
2016963102  
DATE  
30/07/2025



Center Console / Cubbyhole + Lid

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: ADNUSN1D5U0206195