



CONDITION REPORT



Report No:
2017296797
DATE
10/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/09/2026		M57 Pretoria Road - 1619
Inspection Date	10/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	KST682MP
Model	NP200 1.6 BASE SAFETY PU [2019-2025]	Register Number	
VIN	ADNUSN1D5U0212439	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2022	Paint Finish	C - COMMON
Km Reading	41,630 KM	Fuel	PETROL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0212439



CONDITION REPORT



Report No:

2017296797

DATE

10/09/2026



Damage

Repair Way

Seat Front Right Torn / Cut	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Left Dented	Repair
Front Fender Right Dented	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Dented	Repair
Door Front Left Dented	Repair
Door Front Right Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Dented	Repair
Windscreen Cracked	Replace
Spare Tyre Smooth	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Body exterior	Vehicle got minor scratches, stone chips and dents
L/F tire deferred name brand and size	Repair
Right side quarter window scratch	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.8	3.3	-	
Rear	1.2	1.3	-	
Emergency / Parking	0.9	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91H	Goodyear	Excellence	V	1919	3 mm
Front Right	185/65R15	92T	Dunlop	Sp touring	V	0322	3 mm
Rear Left	185/65R15	92T	Dunlop	Sp touring	V	4421	1 mm
Rear Right	185/65R15	92T	Dunlop	Sp touring	V	0322	3 mm
Spare	195R14	106/104S	Goodyear	Duramax	V	4920	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0212439



CONDITION REPORT



Report No:
2017296797
DATE
10/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ACTIVE	000100	PLEASE REFER TO VEHICLE SERVICES MANUAL	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ADNUSN1D5U0212439




CONDITION REPORT



Report No:
2017296797
DATE
10/09/2026

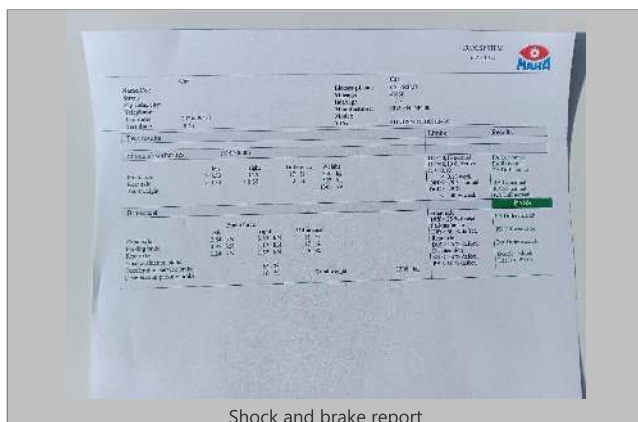

Shock and brake report

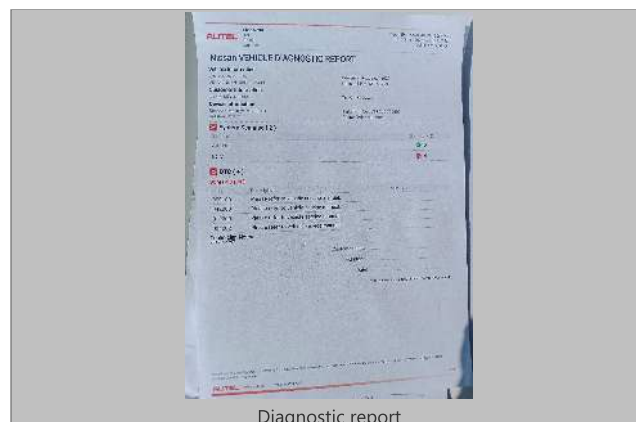


Diagnostic report




Spare tire no rim



Expenditure bottle

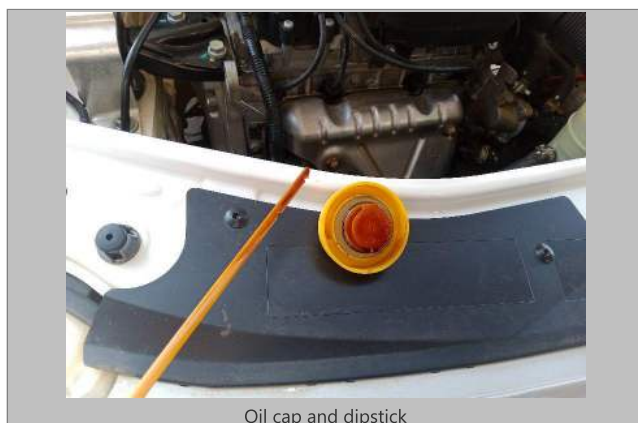

Oil cap and dipstick

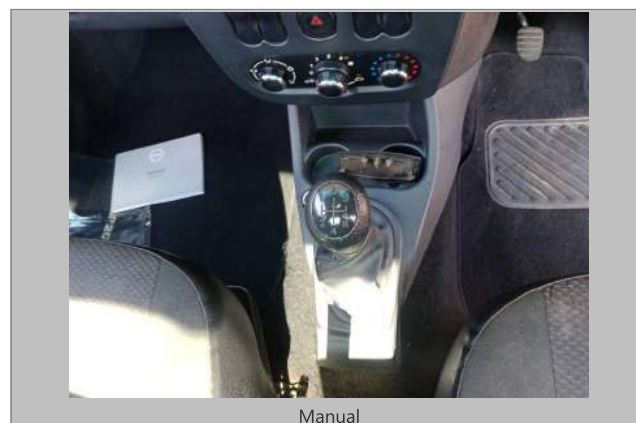

Manual

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0212439



CONDITION REPORT



Report No:
2017296797
DATE
10/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0212439



CONDITION REPORT



Report No:
2017296797
DATE
10/09/2026



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0212439



CONDITION REPORT



Report No:

2017296797

DATE

10/09/2026



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0212439



CONDITION REPORT



Report No:
2017296797
DATE
10/09/2026



Water level



Windscreen



Seat Front Right



Rear Fender Right



Door Front Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0212439



CONDITION REPORT



Report No:
2017296797
DATE
10/09/2026




Bonnet



Front Fender Left



Door Front Left

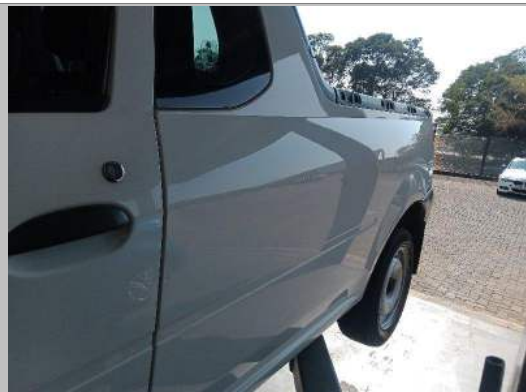

Rear Fender Left



Sill Panel Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0212439



CONDITION REPORT



Report No:
2017296797
DATE
10/09/2026



Spare Tyre



Bolt(s) / Nut(s) Rear Wheel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0212439