



CONDITION REPORT

Report No: 2016845204

DATE
16/04/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/04/2025		M57 Pretoria Road - 1619
Inspection Date	16/04/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	FORD	Registration Number	KSH681MP
Model	RANGER SUPER CAB 2.5 XL HI-RIDER PU [2011-2013]	Register Number	
VIN	AFAGXXMJ2GEU00214	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/12/2024
Color	WHITE	Power / Displacement	
Year Model	2014	Paint Finish	C - COMMON
Km Reading	222,385 KM	Fuel	PETROL
Cab / Body Type	SUPER CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Dim and Bright Indicator Light Malfunction	Repair
Hazard Lights Malfunction	Repair
Fog Light Front Left Malfunction	Repair
Fog Light Front Right Malfunction	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Chipmarks	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Tailgate Paintwork • Scratched	Repair
Rear bumper Dented	Repair
Ball Joint(s) Front Axle Left Damaged	Replace
Ball Joint(s) Front Axle Right Damaged	Replace
Body exterior	Vehicle got minor scratches, stone chips and dents

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GEU00214



CONDITION REPORT

Report No: 2016845204

 DATE
16/04/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.3	4.0	-	
Rear	2.6	2.5	-	
Emergency / Parking	2.5	2.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/70R16	111T	Gt radial	Adventuro	V	0919	4 mm
Front Right	265/70R16	111T	Gt radial	Adventuro	V	0919	4 mm
Rear Left	265/70R16	111T	Gt radial	Adventuro	V	0619	4 mm
Rear Right	265/70R16	111T	Gt radial	Adventuro	V	0919	4 mm
Spare	255/70R16	111T	Continental	Contact	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CMDTCS	U0401:00-28	INVALID DATA RECEIVED FROM ELECTRONIC CONTROL MODU	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: AFAGXXMJ2GEU00214




CONDITION REPORT


Report No: 2016845204

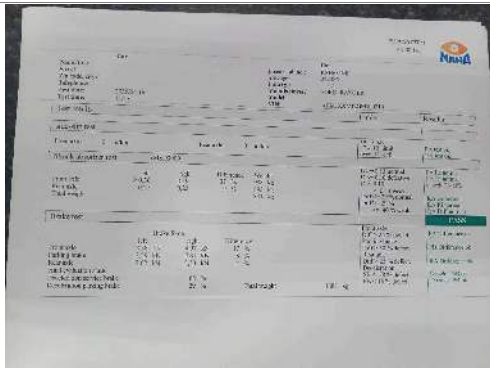DATE
16/04/2025

Shock and brake report

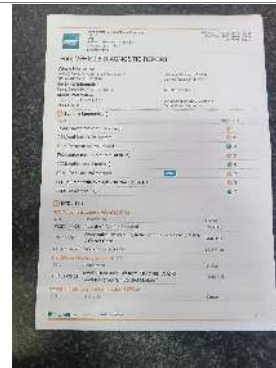

Diagnostic report

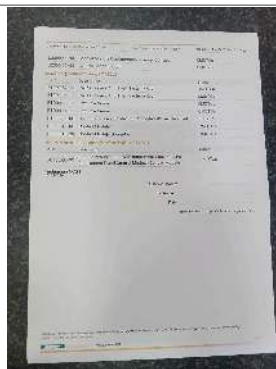

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GEU00214



CONDITION REPORT

Report No: 2016845204

DATE
16/04/2025

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GEU00214



CONDITION REPORT

Report No: 2016845204

DATE
16/04/2025

90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

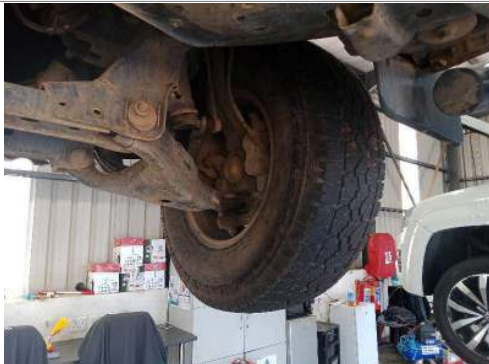

RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GEU00214




CONDITION REPORT

Report No: 2016845204

DATE
16/04/2025



LICENSE DISC

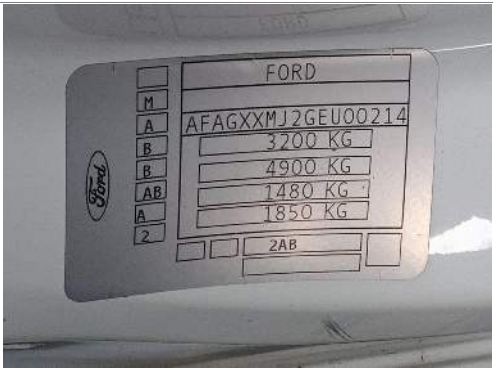

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Expection bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GEU00214



CONDITION REPORT

Report No: 2016845204

DATE
16/04/2025

Oil cap and dipstick



Water level



Door Front Right



Front Fender Right



Front Fender Left



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GEU00214



CONDITION REPORT

Report No: 2016845204

DATE
16/04/2025

Door Front Left



Door Rear Left



Rear Fender Left



Tailgate



Rear bumper



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GEU00214



CONDITION REPORT

Report No: 2016845204

DATE
16/04/2025

Door Rear Right



Ball Joint(s) Front Axle Right



Ball Joint(s) Front Axle Left



Dim and Bright Indicator Light



Fog Light Front Left



Fog Light Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GEU00214

**CONDITION REPORT**

Report No: 2016845204

DATE
16/04/2025

Hazard Lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GEU00214