



CONDITION REPORT



Report No:
2016959179
DATE
26/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	26/07/2025		M57 Pretoria Road - 1619
Inspection Date	26/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	FORD	Registration Number	HG5507L
Model	RANGER 2.0 XL HR DSL SUPER CAB PU OPT PLAN AT [2024-ON]	Register Number	
VIN	AFAGXXMJ2GRR61291	Date Of First Licensing	
Engine Number		Last COR	
Doors	3	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2024	Paint Finish	C - COMMON
Km Reading	73,528 KM	Fuel	DIESEL
Cab / Body Type	SUPER CAB	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AFAGXXMJ2GRR61291



CONDITION REPORT



Report No:
2016959179
DATE
26/07/2025

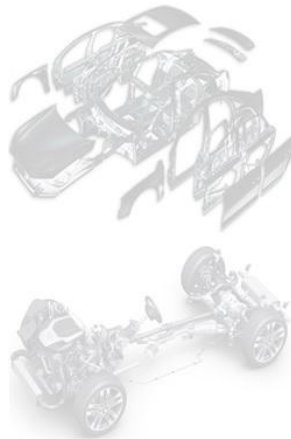

Damage

Repair Way

Tail Light Left Cracked	Replace
Headlight Left Cracked	Replace
Side Mirror Left Cracked	Replace
Side Mirror Right Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Load Body Dented	Repair
Windscreen Cracked	Replace
Rim Front Left Scratched	Repair
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Repair
Main Beam Left Damaged	Repair
Radiator Cradle Damaged	Replace
Body exterior	Signs of spray work done on some body panels
Body exterior	Minor dents scratches stone chips on some body pan
Multiple warning lights illuminated	Repair
tailgate does not open	repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	4.8	4.8	-	
Rear	2.7	3.2	-	
Emergency / Parking	2.6	1.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	112S	Rovelo	Road quest	V	1724	4 mm
Front Right	265/65R17	112H	Yokohama	Geolandar	V	0000	4 mm
Rear Left	265/65R17	112S	Rovelo	Road quest	V	1824	3 mm
Rear Right	265/65R17	112S	Bridgestone	Dueler	V	0000	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GRR61291



CONDITION REPORT



Report No:
2016959179
DATE
26/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	P050F:00-28	BRAKE ASSIST VACUUM TOO LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GRR61291




CONDITION REPORT




Report No:
2016959179
DATE
26/07/2025




Automatic

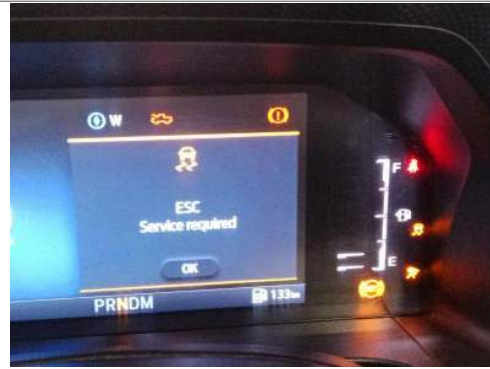


Warning lights illuminated

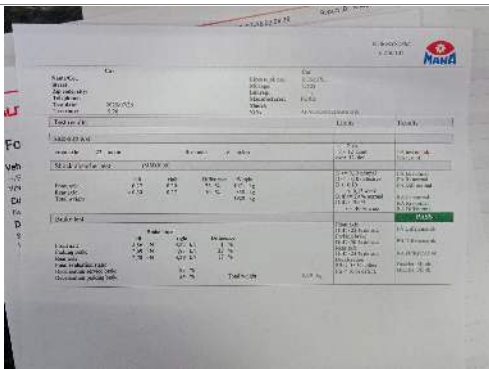


Shock and brake report

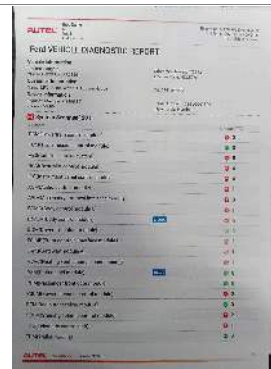

Diagnostic test

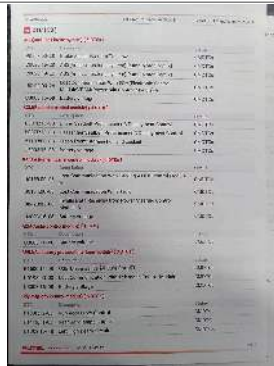

Diagnostic test

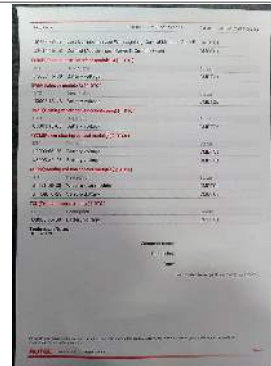

Diagnostic test

DEKRA Automotive (PTY) Ltd
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GRR61291



CONDITION REPORT



Report No:
2016959179
DATE
26/07/2025



Expansion bottle



Oil cap and dipstick



L/F fender liner missing



Rear end



Rear end



FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GRR61291



CONDITION REPORT



Report No:
2016959179
DATE
26/07/2025



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GRR61291



CONDITION REPORT



Report No:
2016959179
DATE
26/07/2025



90 DEGREE REAR




90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

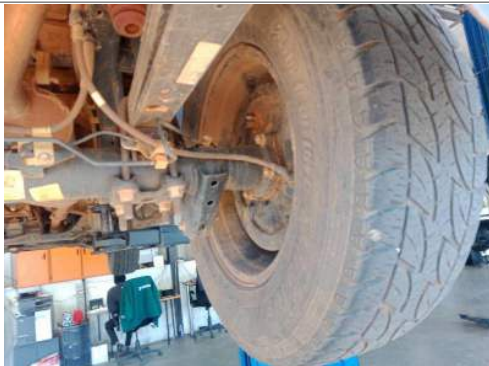

RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GRR61291



CONDITION REPORT



Report No:
2016959179
DATE
26/07/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



CHASSIS



ENGINE 2



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GRR61291



CONDITION REPORT



Report No:
2016959179
DATE
26/07/2025



Load Body



Load Body



Tail Light Left



Tail Light Left



Load Body



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GRR61291



CONDITION REPORT



Report No:
2016959179
DATE
26/07/2025



Side Mirror Left



Side Mirror Right



Windscreen



Windscreen



Water level



Bolt(s) / Nut(s) Front Wheel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GRR61291



CONDITION REPORT



Report No:
2016959179
DATE
26/07/2025



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Headlight Left



Bolt(s) / Nut(s) Front Wheel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GRR61291



CONDITION REPORT



Report No:
2016959179
DATE
26/07/2025



Radiator Cradle



Rim Front Left



Bolt(s) / Nut(s) Rear Wheel Right



Main Beam Left



Main Beam Left



Main Beam Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GRR61291



CONDITION REPORT



Report No:
2016959179
DATE
26/07/2025



Main Beam Left



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAGXXMJ2GRR61291