



## CONDITION REPORT



Report No:  
2017295698  
DATE  
08/09/2026

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 08/09/2026        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 08/09/2026        |                     | Kempton Park -           |

## Vehicle Data

|                 |                                                |                         |                   |
|-----------------|------------------------------------------------|-------------------------|-------------------|
| Vehicle Type    | LIGHT LOAD VEHICLE                             | Registered Owner        | MFC AUCTION HOUSE |
| Manufacturer    | FORD                                           | Registration Number     | LPH569MP          |
| Model           | RANGER 2.2 TDCI XL DSL PU OPT PLAN [2021-2023] | Register Number         |                   |
| VIN             | AFANXXMJ2NNJ24605                              | Date Of First Licensing |                   |
| Engine Number   |                                                | Last COR                |                   |
| Doors           | 2                                              | License Expiry Date     | 30/06/2027        |
| Color           | WHITE                                          | Power / Displacement    |                   |
| Year Model      | 2022                                           | Paint Finish            | C - COMMON        |
| Km Reading      | 105,114 KM                                     | Fuel                    | DIESEL            |
| Cab / Body Type | SINGLE CAB                                     | Transmission            | MANUAL            |

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: AFANXXMJ2NNJ24605



CONDITION REPORT



Report No:  
2017295698  
DATE  
08/09/2026

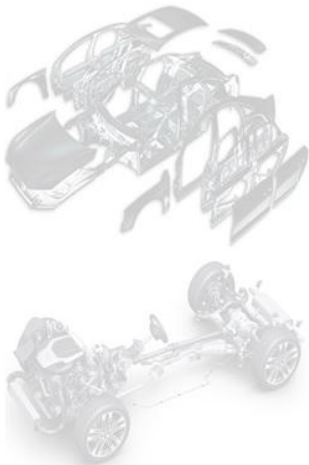

| Damage                                  | Repair Way |
|-----------------------------------------|------------|
| Engine Oil Sweat                        | Repair     |
| Tail Light Right Cracked                | Replace    |
| Front Fender Left Paintwork • Scratched | Repair     |
| Load Body Dented                        | Repair     |

Brakes

Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 4.4                | 5.0                | -                |                                  |
| Rear                | 3.0                | 2.7                | -                |                                  |
| Emergency / Parking | 2.2                | 3                  | -                |                                  |

Tyres and Rims

Tyre Specification & Measurement

|             | Size      | Load/Speed Index | Manufacture | Model   | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|---------|-------|-----------------|------------------|
| Front Left  | 255/70R16 | 111T             | Continental | Contact | V     | 2019            | 5 mm             |
| Front Right | 255/70R16 | 111T             | Continental | Contact | V     | 2016            | 5 mm             |
| Rear Left   | 255/70R16 | 111T             | Continental | Contact | V     | 2019            | 5 mm             |
| Rear Right  | 255/70R16 | 111T             | Continental | Contact | V     | 2019            | 5 mm             |
| Spare       | 255/70R16 | 111T             | Continental | Contact | V     | 0000            | 4 mm             |

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFANXXMJ2NNJ24605



## CONDITION REPORT



Report No:  
2017295698  
DATE  
08/09/2026

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System              | Code        | Description              | Status |
|----|---------------------|-------------|--------------------------|--------|
| 1  | BODY CONTROL MODULE | B1313:15-0A | INTERIOR LIGHTING OUTPUT |        |

### Inspection Conditions

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. BODY EXTERIOR - SIGNS OF SPRAY WORK DONE ON BODY PANELS

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFANXXMJ2NNJ24605



## CONDITION REPORT



Report No:  
2017295698  
DATE  
08/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AFANXXMJ2NNJ24605



## CONDITION REPORT



Report No:  
2017295698  
DATE  
08/09/2026



INTERIOR (FRONT DRIVER DOOR)



Manual transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFANXXMJ2NNJ24605



## CONDITION REPORT



Report No:  
2017295698  
DATE  
08/09/2026



ENGINE 1



ENGINE 2



CHASSIS



REAR



Oil cap and dipstick



Expansion bottle

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)


VIN: AFANXXMJ2NNJ24605



## CONDITION REPORT




**Report No:**  
**2017295698**  
**DATE**  
**08/09/2026**

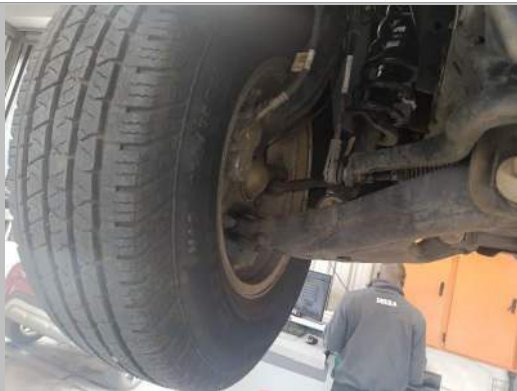

LF TYRE TREAD




RF TYRE TREAD

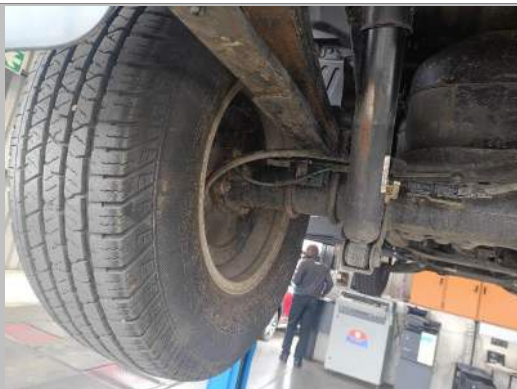


LR TYRE TREAD



RR TYRE TREAD

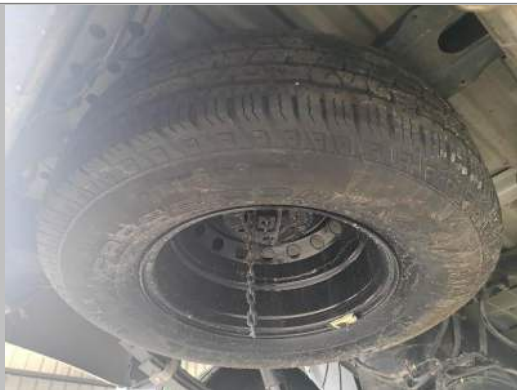

### Sparewheel

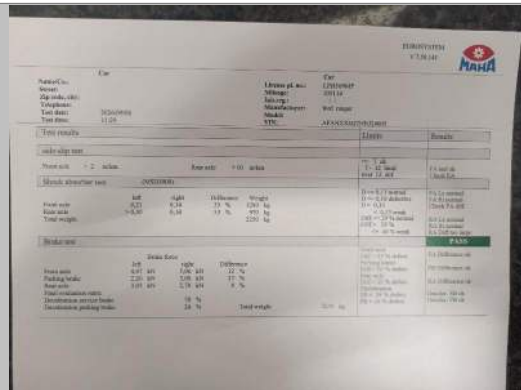

Shock and brake

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AFANXXMJ2NNJ24605



## CONDITION REPORT




Report No:

2017295698

DATE


08/09/2026

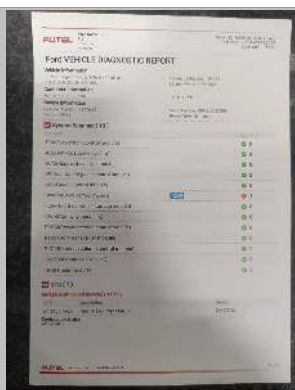

Diagnostic Report page 1



Diagnostic Report page 2

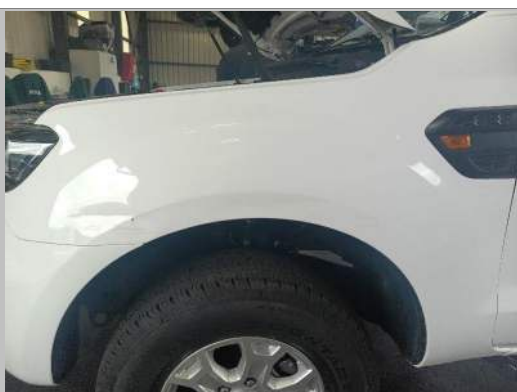

Front Fender Left



Tail Light Right



Tail Light Right



Load Body

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AFANXXMJ2NNJ24605



## CONDITION REPORT



Report No:  
2017295698  
DATE  
08/09/2026



Engine

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AFANXXMJ2NNJ24605