



CONDITION REPORT

Report No: 2016865061

DATE
05/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	05/05/2025		M57 Pretoria Road - 1619
Inspection Date	05/05/2025		Kempton Park - GT


Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	FORD	Registration Number	N/A
Model	RANGER 3.2 TDCI XLT D-CAB 4X4 DSL PU AT [2017-2020]	Register Number	
VIN	AFAPXXMJ2PJR43358	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2019	Paint Finish	C - COMMON
Km Reading	56,520 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

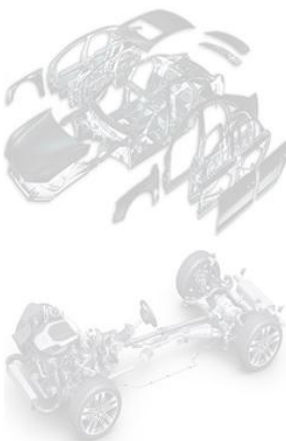

Damage	Repair Way
Front Bumper Paintwork • Chipmarks	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Chipmarks	Repair
Door Front Right Paintwork • Chipmarks	Repair
Tailgate Paintwork • Scratched	Repair
Both number plates missing	Replace
No license disc	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJR43358



CONDITION REPORT

Report No: 2016865061

DATE
05/05/2025

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	112T	Sun full	Mont-pro	V	2921	6 mm
Front Right	265/65R17	112T	Sun full	Mont-pro	V	2921	6 mm
Rear Left	265/65R17	112T	Sun full	Mont-pro	V	2921	6 mm
Rear Right	265/65R17	112T	Sun full	Mont-pro	V	2921	6 mm
Spare	255/65R17	112T	Continental	Contact	V	0000	7 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CMDTCS	U0140:00-08	LOST COMMUNICATION WITH BODY CONTROL MODULE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Vehicle got minor scratches, stone chips and dents.

Brakes: No brake test done vehicle is 4wd.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJR43358




CONDITION REPORT


Report No: 2016865061

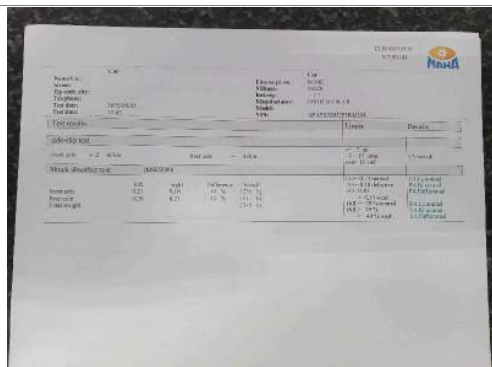DATE
05/05/2025

Shock report

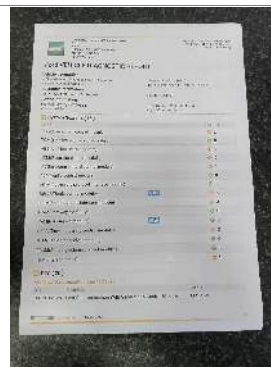

Diagnostic report

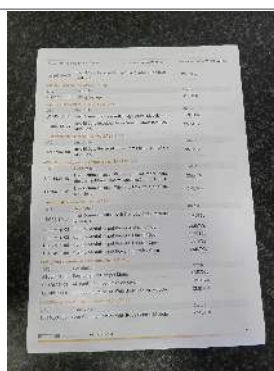

Diagnostic report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJR43358



CONDITION REPORT

Report No: 2016865061

DATE
05/05/2025

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJR43358



CONDITION REPORT

Report No: 2016865061

DATE
05/05/2025


90 DEGREE REAR



90 DEGREE LEFT




LF TYRE TREAD

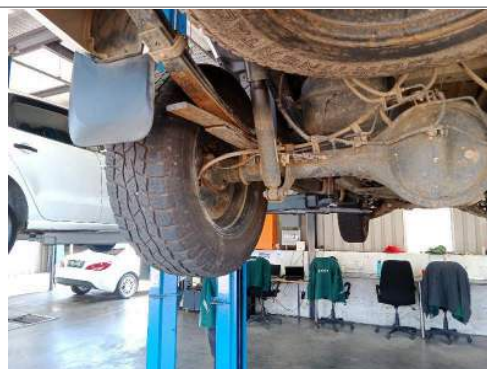

LR TYRE TREAD



RR TYRE TREAD

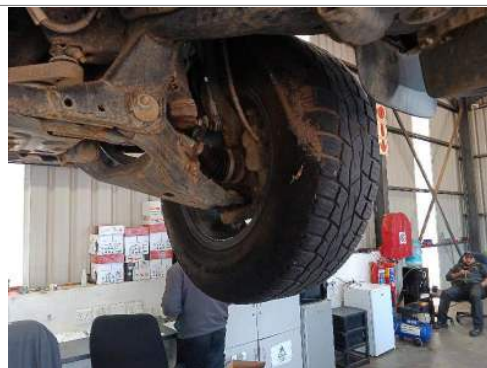

RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJR43358



CONDITION REPORT

Report No: 2016865061

DATE
05/05/2025

Spare wheel



No license disc



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJR43358



CONDITION REPORT

Report No: 2016865061

DATE
05/05/2025


Expansion bottle



Oil cap and dipstick



Water level

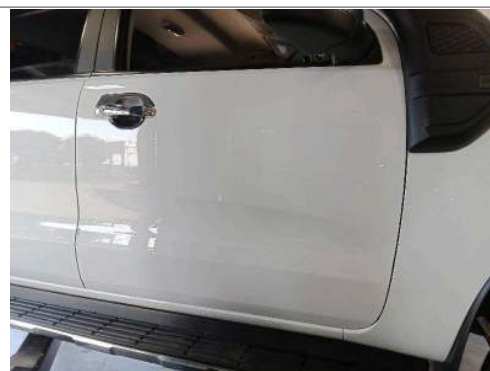

Door Front Right



Front Fender Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJR43358



CONDITION REPORT

Report No: 2016865061

DATE
05/05/2025

Front Bumper



Rear Fender Left



Tailgate



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PJR43358