



CONDITION REPORT



Report No:
2016915590
DATE
18/06/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	18/06/2025		M57 Pretoria Road - 1619
Inspection Date	18/06/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	FORD	Registration Number	JL41HZGP
Model	RANGER 2.0 BIT RAPTOR D-CAB 4X4 10-SP DSL PU AT [2019-2021]	Register Number	
		Date Of First Licensing	
VIN	AFAPXXMJ2PLB74466	Last COR	
Engine Number		License Expiry Date	31/08/2025
Doors	4	Power / Displacement	
Color	BLUE	Paint Finish	M - METALLIC
Year Model	2020	Fuel	DIESEL
Km Reading	171,433 KM	Transmission	AUTOMATIC
Cab / Body Type	DOUBLE CAB		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AFAPXXMJ2PLB74466



CONDITION REPORT



Report No:
2016915590
DATE
18/06/2025

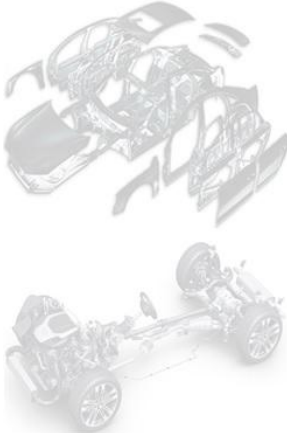	Damage	Repair Way
	Front Bumper Paintwork • Scratched	Repair
	Bonnet Dented	Repair
	Bonnet slam plate (Shock tower/ Inner tray) Cracked	Repair
	Front Fender Right Paintwork • Scratched	Repair
	Rear Fender Left Paintwork • Scratched	Repair
	Rear Fender Right Dented	Repair
	Door Front Left Paintwork • Scratched	Repair
	Door Front Right Paintwork • Scratched	Repair
	Door Rear Left Paintwork • Scratched	Repair
	Door Rear Right Paintwork • Scratched	Repair
	Rear bumper Damaged	Repair
	Windscreen Cracked	Replace
	Gearbox Oil Leak	Repair
	Brakes	No brake test done vehicle is 4wd
	Aftermarket air suspension fitted	Repair

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	285/70R17	121/118R	Bf Goodrich	All-terrain	V	2417	1 mm
Front Right	285/70R17	121/118R	Bf Goodrich	All-terrain	V	2317	2 mm
Rear Left	285/70R17	121/118R	Bf Goodrich	All-terrain	V	2417	2 mm
Rear Right	285/70R17	121/118R	Bf Goodrich	All-terrain	V	2417	2 mm
Spare	285/70R17	116/113S	Bf Goodrich	All-terrain	V	4721	4 mm

* Tyre Legend: V=Virgin, R=Recap



CONDITION REPORT



Report No:
2016915590
DATE
18/06/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CMDTCS	P261B:00-2F	COOLANT PUMP B CONTROL CIRCUIT PERFORMANCE/STUCK OFF	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AFAPXXMJ2PLB74466



CONDITION REPORT



Report No:
2016915590
DATE
18/06/2025

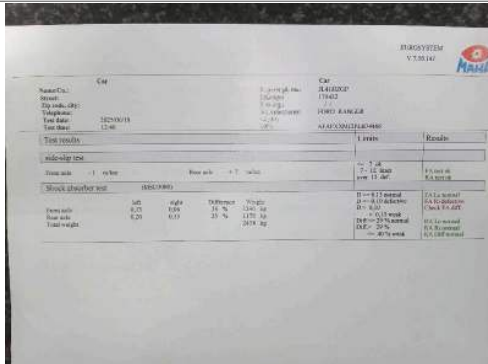

Shock report



Diagnostic report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PLB74466



CONDITION REPORT



Report No:
2016915590
DATE
18/06/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PLB74466



CONDITION REPORT




Report No:
2016915590
DATE
18/06/2025



90 DEGREE LEFT




LF TYRE TREAD

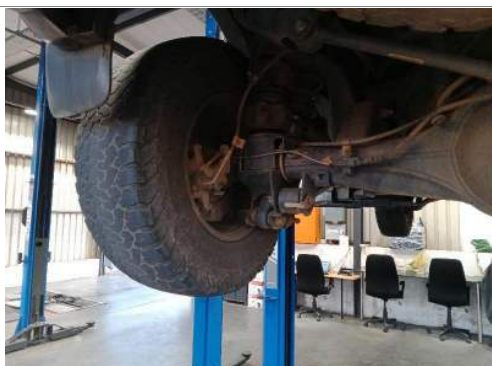

LR TYRE TREAD



RR TYRE TREAD

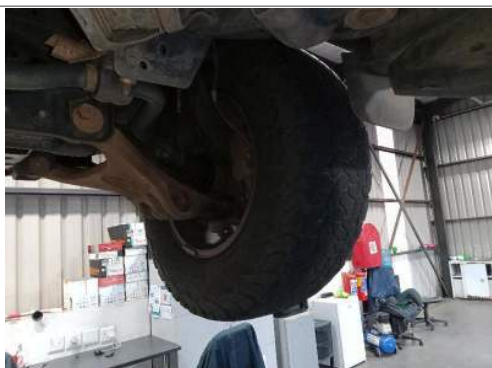

RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PLB74466



CONDITION REPORT



Report No:
2016915590
DATE
18/06/2025



LICENSE DISC




VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

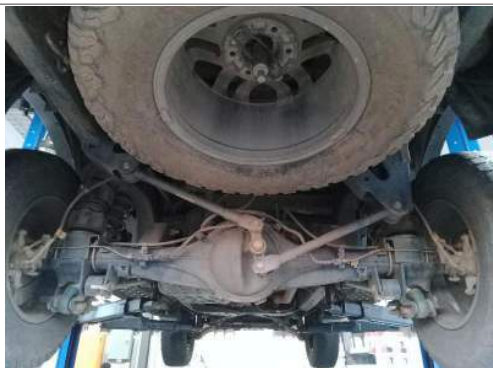

CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PLB74466



CONDITION REPORT



Report No:
2016915590
DATE
18/06/2025



Expection bottle



Windscreen



Bonnet



Water level



Bonnet slam plate (Shock tower/ Inner tray)



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PLB74466



CONDITION REPORT



Report No:
2016915590
DATE
18/06/2025



Door Rear Right



Door Front Right



Front Fender Right



Front Bumper



Front Bumper



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PLB74466



CONDITION REPORT



Report No:
2016915590
DATE
18/06/2025



Door Rear Left



Rear Fender Left



Rear bumper



Rear bumper



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFAPXXMJ2PLB74466