



CONDITION REPORT



Report No:

2017302465

DATE

23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	MAZDA	Registration Number	DK99PMGP
Model	BT-50 2.5 TDI SLE D-CAB DSL PU [2009-2012]	Register Number	
VIN	AFBTTXJM2TBL13733	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/01/2027
Color	WHITE	Power / Displacement	
Year Model	2011	Paint Finish	C - COMMON
Km Reading	397,230 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFBTTXJM2TBL13733



CONDITION REPORT



Report No:

2017302465

DATE

23/09/2026

Damage

Repair Way

Water level Insufficient	Repair
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Seat Front Right Torn / Cut	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Damaged	Replace
Front Bumper Paintwork • Flaking	Repair
Bonnet Residual Traces of Repair	Repair
A • Pillar Left Paintwork • Flaking	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Tailgate Residual Traces of Repair	Repair
Rear bumper Paintwork • Scratched	Repair
Roof Paintwork • Flaking	Repair
Windscreen Chipped	Repair
Engine Smoke Excessive	Repair
Airbag light and ABS light on	Repair
Vehicle struggle to start	Repair

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	110T	Royal black	Royal a/t	V	3319	1 mm
Front Right	265/65R17	112S	Bridgestone	Dueler	V	3619	2 mm
Rear Left	265/65R17	110T	Royal black	Royal a/t	V	3319	2 mm
Rear Right	265/65R17	112T	Hankook	Dynapro	V	4420	3 mm
Spare	245/70R16	111/109T	Continental	Contact	V	1211	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFBTXXMJ2TBL13733



CONDITION REPORT



Report No:
2017302465
DATE
23/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CMDTCS	B1318	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on some body panels. Signs of repair work done on some body panels. Signs of flaking on some body panels. Signs of over spray on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFBTXXMJ2TBL13733



CONDITION REPORT



Report No:

2017302465

DATE

23/09/2026

Car				Car			
Make/Model	Car	License plate	2009/2013	Make/Model	2009/2013	License plate	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013

Shock report

Car				Car			
Make/Model	Car	License plate	2009/2013	Make/Model	2009/2013	License plate	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013
Year	2009	Make/Model	2009/2013	Year	2009	Make/Model	2009/2013

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFBTXXMJ2TBL13733



CONDITION REPORT



Report No:

2017302465

DATE

23/09/2026



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFBTXXMJ2TBL13733



CONDITION REPORT



Report No:

2017302465

DATE

23/09/2026




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

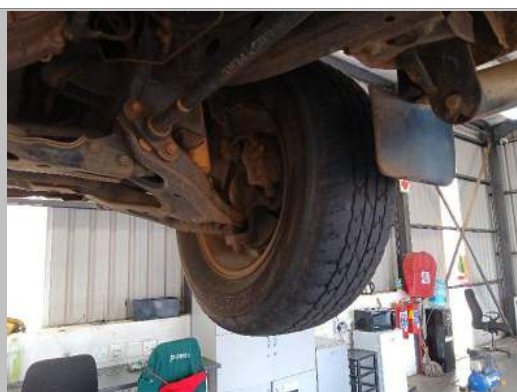

RF TYRE TREAD



Spare wheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFBTXXMJ2TBL13733



CONDITION REPORT




Report No:

2017302465

DATE

23/09/2026

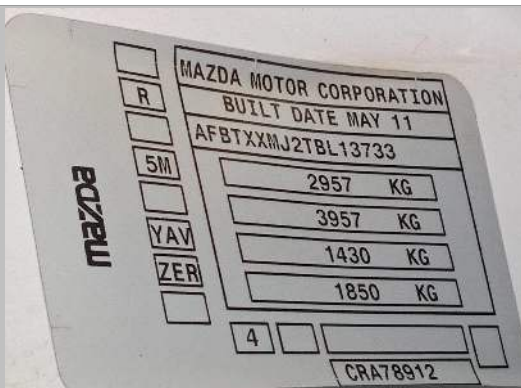

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick



Coolant bottle

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFBTXXMJ2TBL13733



CONDITION REPORT



Report No:
2017302465
DATE
23/09/2026



Windscreen



Seat Front Right



Side Mirror Right



Side Mirror Right



Water level



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFBTXXMJ2TBL13733



CONDITION REPORT



Report No:

2017302465

DATE

23/09/2026



Front Bumper



Front Bumper



Front Fender Left



A • Pillar Left



Roof



Side Mirror Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFBTXXMJ2TBL13733



CONDITION REPORT



Report No:

2017302465

DATE

23/09/2026



Door Front Left



Door Rear Left



Rear Fender Left



Tailgate



Rear bumper



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFBTXXMJ2TBL13733



CONDITION REPORT



Report No:
2017302465
DATE
23/09/2026



Door Rear Right



Door Front Right



Front Fender Right



Tail Light Left



Tail Light Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFBTXXMJ2TBL13733