



CONDITION REPORT



Report No:
2017304845
DATE
29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	TOYOTA	Registration Number	JY58VHGP
Model	COROLLA QUEST 1.8 [2020-2022]	Register Number	
VIN	AHTBF8JE201010221	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/03/2026
Color	WHITE	Power / Displacement	
Year Model	2021	Paint Finish	TWO COAT UNI
Km Reading	43,200 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE201010221



CONDITION REPORT



Report No:

2017304845

DATE

29/09/2026

Damage

Repair Way

Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Paintwork • Scratched	Repair
Rear Fender Left Residual Traces of Repair	Repair
Door Rear Left Damaged	Repair
Rear bumper Residual Traces of Repair	Repair
Inner Boot Floor Pan and Spare Wheel Well Dented	Repair
Cross Member Rear Right Damaged	Repair
Belly plates Damaged	Repair
Wheel Spanner Missing	Replace
Triangle Missing	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.44	4.01	-	
Rear	2.3	2.25	-	
Emergency / Parking	1.55	1.55	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65 R15	91H	Goodyear	Excellence	V	0421	4 mm
Front Right	195/65 R15	91H	Goodyear	Excellence	V	0421	4 mm
Rear Left	195/65 R15	91H	Goodyear	Excellence	V	0421	3 mm
Rear Right	195/65 R15	91H	Goodyear	Excellence	V	0421	3 mm
Spare	195/65 R15	91H	Goodyear	Excellence	V	0421	7 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE201010221



CONDITION REPORT



Report No:
2017304845
DATE
29/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE AND ECT	P1604	STARTABILITY FAULT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. RESIDUAL TRACES OF REPAIR ON BODY PANELS / BODY PANELS MISALIGNED / STONE CHIPS AND SPRAY WORK ON BODY PANELS / DENTS AND SCRATCHES ON BODY PANELS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE201010221



CONDITION REPORT



Report No:

2017304845

DATE

29/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE201010221



CONDITION REPORT



Report No:
2017304845
DATE
29/09/2026



INTERIOR (FRONT DRIVER DOOR)




Automatic Transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

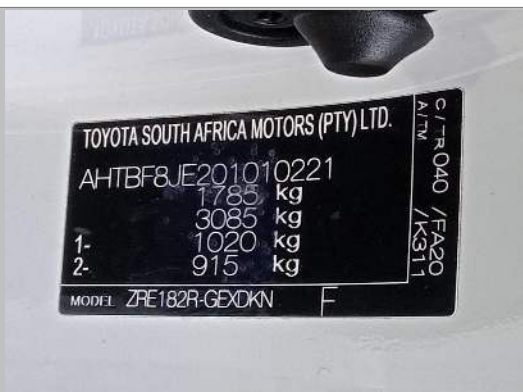

VIN PLATE OR STICKER



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE201010221



CONDITION REPORT



Report No:
2017304845
DATE
29/09/2026



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick



LF TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE201010221



CONDITION REPORT



Report No:


2017304845

DATE _____

29/09/2026



LR TYRE TREAD

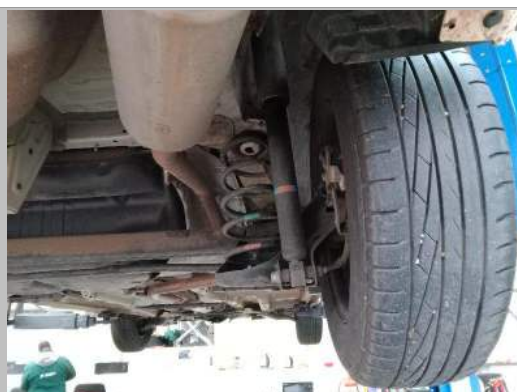

RR TYRE TREAD




Spare Wheel and Accessories

[illegible]

Brake and shock absorber repor



Diagnostic report page 1

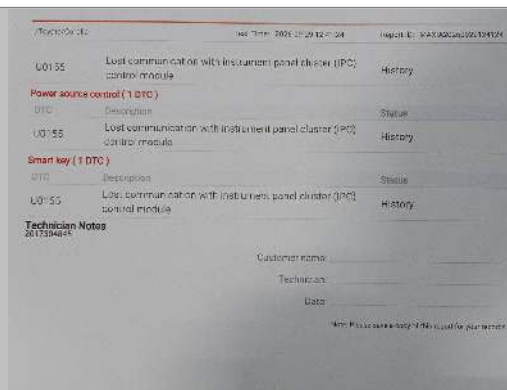

Diagnostic report page 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE201010221



CONDITION REPORT



Report No:

2017304845

DATE

29/09/2026



Rear Fender Left



Door Rear Left



Front Fender Left



Front Fender Left



Rear bumper



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE201010221



CONDITION REPORT



Report No:
2017304845
DATE
29/09/2026



Bonnet



Water level



Front Bumper



Front Bumper



Front Bumper



Belly plates

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE201010221



CONDITION REPORT



Report No:
2017304845
DATE
29/09/2026



Inner Boot Floor Pan and Spare Wheel Well



Cross Member Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE201010221