



CONDITION REPORT



Report No:
2017302496
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	KL39LHGP
Model	COROLLA QUEST 1.8 [2020-2022]	Register Number	
VIN	AHTBF8JE901006814	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/10/2026
Color	WHITE	Power / Displacement	
Year Model	2020	Paint Finish	C - COMMON
Km Reading	170,898 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814



CONDITION REPORT



Report No:
2017302496
DATE
23/09/2026



Damage

Repair Way

Engine Oil Leak	Repair
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Seat Rear Damaged	Repair
Gear Lever Dust Boot Missing	Replace
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Flaking	Repair
Rear bumper Paintwork • Scratched	Repair
Roof Dented	Repair
Windscreen Chipped	Replace
Tyre Front Left Smooth	Replace
Tyre Front Right Smooth	Replace
Rim Front Left Deformed	Repair
Rim Front Right Deformed	Repair
Rim Rear Left Deformed	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Gear Selections Malfunction	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.4	3.2	-	
Rear	1.8	2.0	-	
Emergency / Parking	1.2	2.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91V	Windforce	Catchfors	V	4625	0 mm
Front Right	195/65R15	91V	Windforce	Catchfors	V	4624	0 mm
Rear Left	195/65R15	91H	Goodyear	Excellence	V	3520	2 mm
Rear Right	195/65R15	91H	Goodyear	Excellence	V	3420	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814



CONDITION REPORT



Report No:
2017302496
DATE
23/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE AND ECT	P1604	STARTABILITY FAULT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814



CONDITION REPORT



Report No:
2017302496
DATE
23/09/2026

[illegible]

Shock and brake report

[illegible]

Diagnostics report

[illegible]

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814



CONDITION REPORT



Report No:

2017302496

DATE

23/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814



CONDITION REPORT



Report No:

2017302496

DATE

23/09/2026



90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

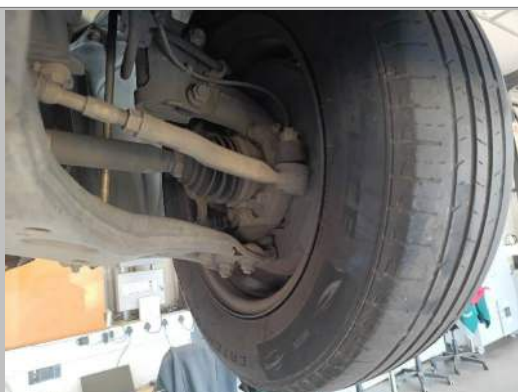

RF TYRE TREAD



No sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814



CONDITION REPORT



Report No:

2017302496

DATE

23/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



REAR



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814



CONDITION REPORT



Report No:


2017302496

DATE

23/09/2026



Expansion bottle

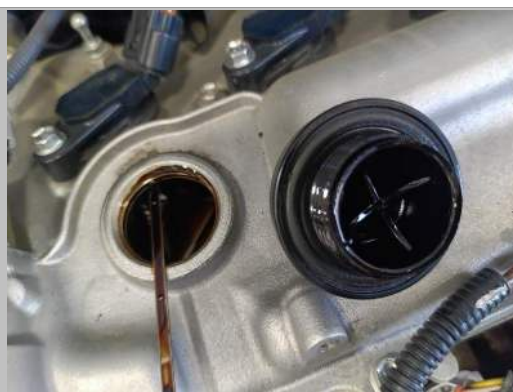

Oil cap and dipstick



Gear Lever Dust Boot



Front Fender Right



Seat Front Right



Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814



CONDITION REPORT



Report No:

2017302496

DATE

23/09/2026



Door Front Right



Door Rear Right



Rear Fender Right



Boot Lid / Hatch door



Boot Lid / Hatch door



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814



CONDITION REPORT



Report No:
2017302496
DATE
23/09/2026



Door Rear Left



Door Front Left



Front Fender Left



Seat Front Left



Bonnet



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814



CONDITION REPORT



Report No:

2017302496

DATE

23/09/2026



Tyre Front Right



Rim Front Right



Rim Front Right



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814



CONDITION REPORT



Report No:

2017302496

DATE

23/09/2026



Front Bumper



Tyre Front Left



CV Joint(s) Boot(s) Front Left (inner/outer)



Rear bumper



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814



CONDITION REPORT



Report No:

2017302496

DATE

23/09/2026



Rear bumper



Rear bumper




Engine



Rim Rear Left



Rim Front Left

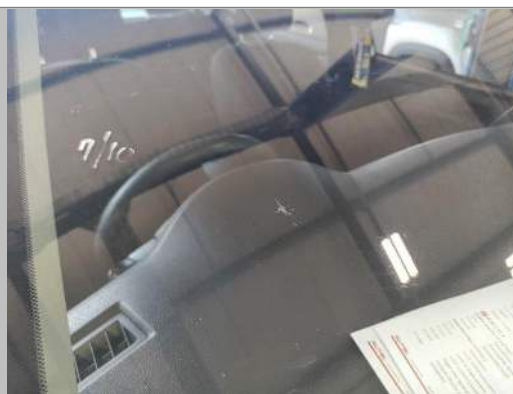

Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814



CONDITION REPORT



Report No:
2017302496
DATE
23/09/2026



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTBF8JE901006814