



CONDITION REPORT



Report No:

2017301666

DATE

21/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	21/09/2026		M57 Pretoria Road - 1619
Inspection Date	21/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	LCD541NW
Model	HILUX 2.0 VVT-I PU [2017-2019]	Register Number	
VIN	AHTEW6CB900998284	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	30/06/2027
Color	WHITE	Power / Displacement	
Year Model	2018	Paint Finish	C - COMMON
Km Reading	211,750 KM	Fuel	PETROL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTEW6CB900998284



CONDITION REPORT



Report No:
2017301666
DATE
21/09/2026

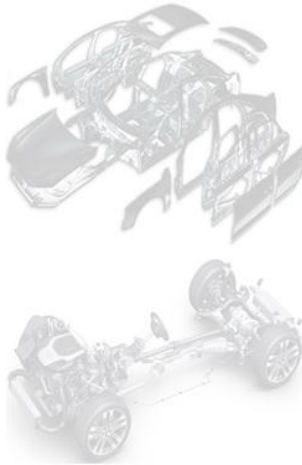

Damage	Repair Way
Seat Front Right Torn / Cut	Repair
Side Mirror Left Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
Roof Corrosion	Repair
Load Body Damaged	Repair
Windscreen Cracked	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Gearbox Dirty	Repair
Undercarriage not clear for inspection	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.0	3.9	-	
Rear	1.8	1.7	-	
Emergency / Parking	1.7	1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/70R15	106/104R	Powertrac	Vantage	V	2026	5 mm
Front Right	205/70R15	100T	Goodyear	Wrangler	V	3423	2 mm
Rear Left	205/70R15	100T	Goodyear	Wrangler	V	4623	2 mm
Rear Right	205/70R15	100T	Goodyear	Wrangler	V	4623	3 mm
Spare	205/70R15	106/104T	Bridgestone	Steel	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW6CB900998284



CONDITION REPORT



Report No:
2017301666
DATE
21/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE AND ECT	P1604	STARTABILITY FAULT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW6CB900998284



CONDITION REPORT



Report No:

2017301666

DATE


21/09/2026

Car				Car			
Model: Car				Model: L200000			
Year: 2017				Year: 2017			
Engine: 2000cc				Engine: 2000cc			
Fuel: Petrol				Fuel: Petrol			
VIN: AHTW6CB900998284				VIN: AHTW6CB900998284			
Shock and brake				Shock and brake			
Front left				Front left			
Front right				Front right			
Rear left				Rear left			
Rear right				Rear right			
Brake pads				Brake pads			
Brake discs				Brake discs			
Brake lines				Brake lines			
Brake master cylinder				Brake master cylinder			
Brake booster				Brake booster			
Brake pedal				Brake pedal			
Brake fluid				Brake fluid			
Brake system				Brake system			

Shock and brake report

Car				Car			
Model: Car				Model: L200000			
Year: 2017				Year: 2017			
Engine: 2000cc				Engine: 2000cc			
Fuel: Petrol				Fuel: Petrol			
VIN: AHTW6CB900998284				VIN: AHTW6CB900998284			
Diagnostics				Diagnostics			
Engine				Engine			
Transmission				Transmission			
Steering				Steering			
Suspension				Suspension			
Brakes				Brakes			
Electrical				Electrical			
Air conditioning				Air conditioning			
Washers/waxes				Washers/waxes			
Lights				Lights			
Tires				Tires			
Body				Body			
Paint				Paint			
Interior				Interior			
Exterior				Exterior			

Diagnostics report

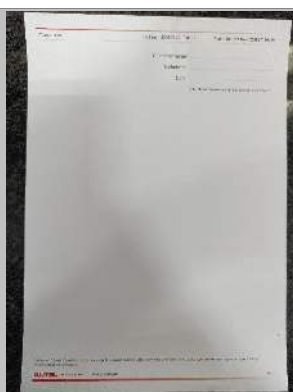

Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTW6CB900998284



CONDITION REPORT



Report No:

2017301666

DATE

21/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW6CB900998284



CONDITION REPORT



Report No:
2017301666
DATE
21/09/2026




90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD

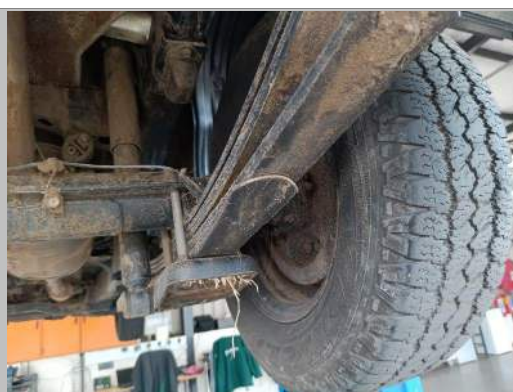

RR TYRE TREAD

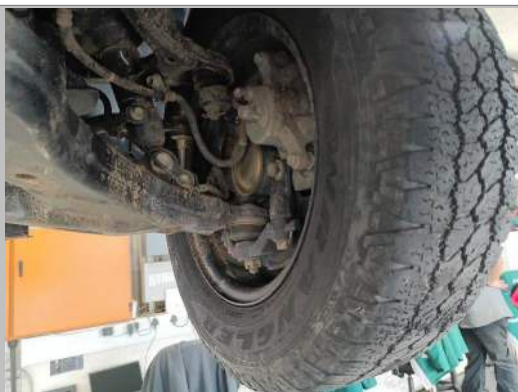

RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW6CB900998284



CONDITION REPORT



Report No:

2017301666

DATE

21/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW6CB900998284



CONDITION REPORT



Report No:

Report No.
2017301666

DATE _____

21/09/2026



Oil cap and dipstick



Coolant reservoir

[illegible]

Parking Brake Performance



Seat Front Right



Bonnet



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW6CB900998284



CONDITION REPORT



Report No:
2017301666
DATE
21/09/2026



Roof



Front Bumper



Front Bumper



Front Bumper



Load Body



Load Body

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW6CB900998284



CONDITION REPORT



Report No:
2017301666
DATE
21/09/2026



Gearbox



Gearbox



Gearbox



Side Mirror Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTEW6CB900998284