



## CONDITION REPORT



Report No:  
2016996176  
DATE  
29/08/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 29/08/2025        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 29/08/2025        |                     | Kempton Park - GT        |

## Vehicle Data

|                 |                                          |                         |                   |
|-----------------|------------------------------------------|-------------------------|-------------------|
| Vehicle Type    | LIGHT LOAD VEHICLE                       | Registered Owner        | MFC AUCTION HOUSE |
| Manufacturer    | TOYOTA                                   | Registration Number     | KSM979MP          |
| Model           | HILUX 2.4 GD-6 RB SRX DSL PU [2016-2018] | Register Number         |                   |
| VIN             | AHTJB8DBX04573847                        | Date Of First Licensing |                   |
| Engine Number   |                                          | Last COR                |                   |
| Doors           | 2                                        | License Expiry Date     |                   |
| Color           | WHITE                                    | Power / Displacement    |                   |
| Year Model      | 2017                                     | Paint Finish            | TWO COAT UNI      |
| Km Reading      | 172,130 KM                               | Fuel                    | DIESEL            |
| Cab / Body Type | SINGLE CAB                               | Transmission            | MANUAL            |

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AHTJB8DBX04573847



CONDITION REPORT



Report No:  
2016996176  
DATE  
29/08/2025

|  | Damage                     | Repair Way |
|--|----------------------------|------------|
|  | Tail Light Left Damaged    | Replace    |
|  | Tail Light Right Damaged   | Replace    |
|  | Seat Front Right Damaged   | Repair     |
|  | Side Mirror Right Damaged  | Replace    |
|  | Front Bumper Damaged       | Repair     |
|  | Bonnet Damaged             | Repair     |
|  | Front Fender Left Damaged  | Repair     |
|  | Front Fender Right Damaged | Repair     |
|  | Rear Fender Left Damaged   | Repair     |
|  | Rear Fender Right Damaged  | Repair     |
|  | Door Front Right Damaged   | Repair     |
|  | Tailgate Damaged           | Repair     |
|  | Tyre Rear Right Worn       | Replace    |
|  | Gearbox Oil Sweat          | Repair     |

Brakes  
Brake Test Results

|                     | Left               | Right              | Axle Weight [KG] | Deceleration [m/s²] |
|---------------------|--------------------|--------------------|------------------|---------------------|
|                     | Braking Force [KN] | Braking Force [KN] |                  |                     |
| Front               | 4.06               | 4.38               | -                |                     |
| Rear                | 2.73               | 2.73               | -                |                     |
| Emergency / Parking | 2.52               | 2.51               | -                |                     |

Tyres and Rims  
Tyre Specification & Measurement

|             | Size      | Load/Speed Index | Manufacture | Model  | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|--------|-------|-----------------|------------------|
| Front Left  | 265/65R17 | 112T             | Michelin    | Radial | V     | 1721            | 2 mm             |
| Front Right | 265/65R17 | 112T             | Michelin    | Radial | V     | 1921            | 2 mm             |
| Rear Left   | 265/65R17 | 112S             | Bridgestone | Radial | V     | 2127            | 2 mm             |
| Rear Right  | 265/65R17 | 112H             | General     | Radial | V     | 0422            | 0 mm             |

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AHTJB8DBX04573847



## CONDITION REPORT



Report No:  
2016996176  
DATE  
29/08/2025

**Diagnostic**

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System      | Code  | Description                      | Status |
|----|-------------|-------|----------------------------------|--------|
| 1  | ABS/VSC/TRC | C1241 | LOW OR HIGH POWER SUPPLY VOLTAGE |        |

**Inspection Conditions**

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: 4 DTC'S AT TIME OF TESTING SEE DTC REPORT.ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels. Repair work done to vehicle below standard.

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AHTJB8DBX04573847



## CONDITION REPORT



Report No:  
2016996176  
DATE  
29/08/2025



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTJB8DBX04573847



## CONDITION REPORT



Report No:  
2016996176  
DATE  
29/08/2025



ODOMETER




DASHBOARD (W/ ENGINE RUNNING)




INTERIOR (FRONT DRIVER DOOR)



Manual.

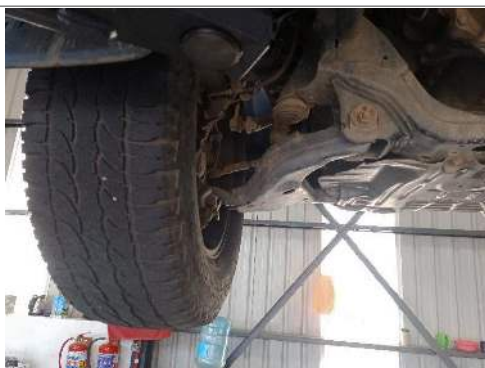

LF TYRE TREAD

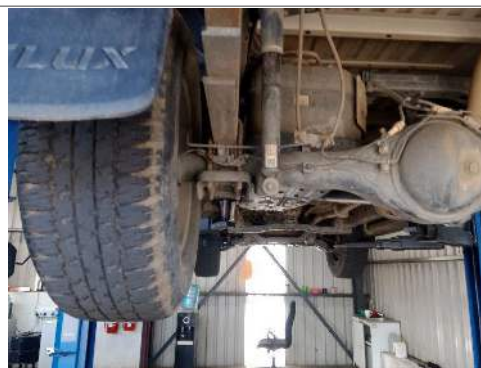

LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AHTJB8DBX04573847



## CONDITION REPORT



Report No:  
2016996176  
DATE  
29/08/2025



RR TYRE TREAD



RF TYRE TREAD



Oil cap and dipstick.



Undercarriage front.



Undercarriage rear.



ENGINE 1

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTJB8DBX04573847



## CONDITION REPORT




Report No:  
2016996176  
DATE  
29/08/2025




VIN PLATE OR STICKER



LICENSE DISC

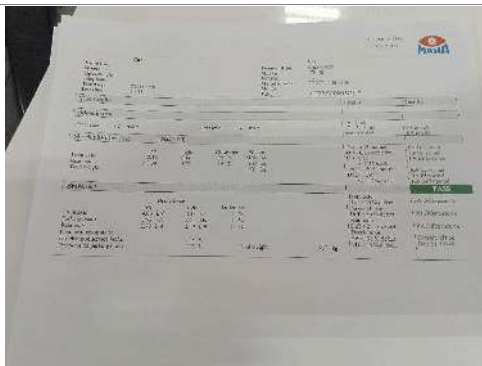

BRAKE TEST REPORT

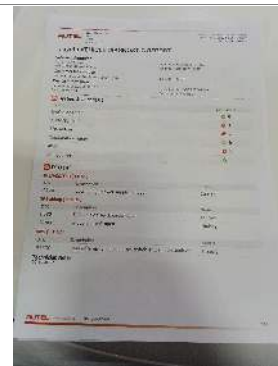

DIAGNOSTIC REPORT



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AHTJB8DBX04573847



## CONDITION REPORT



Report No:  
2016996176  
DATE  
29/08/2025



Front Bumper



Bonnet



Front Fender Left



Rear Fender Left



Tailgate



Rear Fender Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTJB8DBX04573847



## CONDITION REPORT



Report No:  
2016996176  
DATE  
29/08/2025




Door Front Right




Front Fender Right



Side Mirror Right

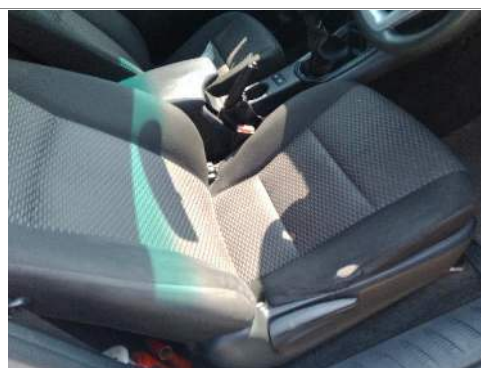

Seat Front Right

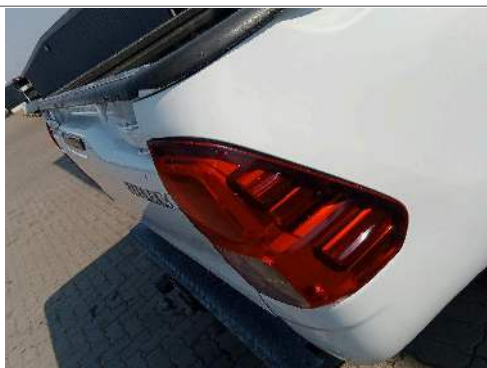

Tail Light Right



Tail Light Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTJB8DBX04573847



## CONDITION REPORT



Report No:  
2016996176  
DATE  
29/08/2025



Tyre Rear Right



Gearbox

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AHTJB8DBX04573847