



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/02/2025		M57 Pretoria Road - 1619
Inspection Date	25/02/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	JSK456MP
Model	HILUX 2.4 GD-6 RB SRX X-CAB DSL PU AT [2018-2020]	Register Number	
VIN	AHTJB8DC904726727	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/10/2023
Color	GREY	Power / Displacement	
Year Model	2018	Paint Finish	M - METALLIC
Km Reading	245,062 KM	Fuel	DIESEL
Cab / Body Type	SUPER CAB	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Windscreen Wiper Worn	Replace
Bonnet Paintwork • Chipmarks	Repair
Front Fender Right Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Load Body Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Front Right Excessive Wear & Tear	Replace
Tyre Rear Left Excessive Wear & Tear	Replace
Tyre Rear Right Excessive Wear & Tear	Replace
Spare Tyre Smooth	Replace
Engine	Bottom of engine is covered
Body exterior	Signs of spray work done on some body panels

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTJB8DC904726727

1 / 10



CONDITION REPORT

Report No: 2016776356

 DATE
25/02/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.8	4.9	-	
Rear	3.1	3.1	-	
Emergency / Parking	1.6	0.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	112S	Dunlop	Grandtrek	V	3621	1 mm
Front Right	265/65R17	112S	Dunlop	Grandtrek	V	3621	0 mm
Rear Left	265/65R17	112S	Dunlop	Grandtrek	V	3621	0 mm
Rear Right	265/65R17	112S	Dunlop	Grandtrek	V	3621	0 mm
Spare	265/65R17	112s	Bridgestone	Dueler	V	///////	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1241	LOW OR HIGH POWER SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016776356

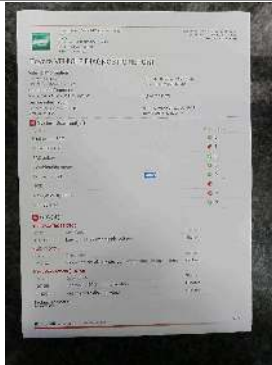DATE
25/02/2025

Diagnostic test

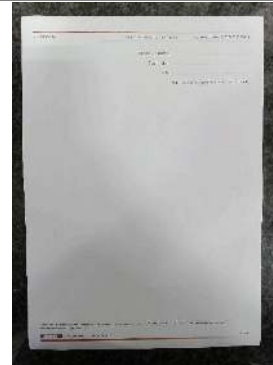

Diagnostic test

VIN: AHTJB8DC904726727
2 / 10

FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025

VIN: AHTJB8DC904726727
3 / 10

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025

VIN: AHTJB8DC904726727
5 / 10

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025

VIN: AHTJB8DC904726727
7 / 10

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



Expansion bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTJB8DC904726727

8 / 10



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016776356

DATE

25/02/2025

VIN: AHTJB8DC904726727

9 / 10




Oil cap and dipstick



Door Rear Right



Door Front Right

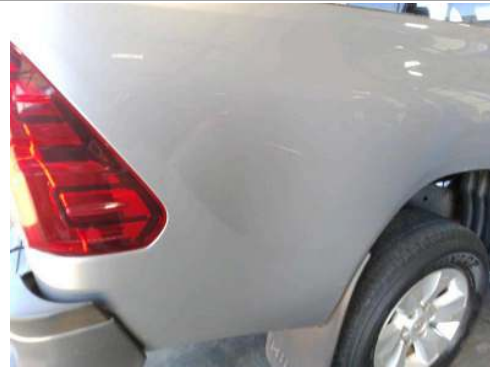

Load Body



Rear bumper



Load Body

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025

VIN: AHTJB8DC904726727
10 / 10

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025

Load Body



Load Body



Door Rear Left



Windscreen Wiper



Windscreen



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025

Vehicle Reference	Test	Unit	Result	Pass/Fail
2016776356	Brake Test	km/h	4.81	Pass
2016776356	Brake Test	km/h	4.81	Pass
2016776356	Brake Test	km/h	4.81	Pass
2016776356	Brake Test	km/h	4.81	Pass
2016776356	Brake Test	km/h	4.81	Pass
2016776356	Brake Test	km/h	4.81	Pass
2016776356	Brake Test	km/h	4.81	Pass
2016776356	Brake Test	km/h	4.81	Pass
2016776356	Brake Test	km/h	4.81	Pass
2016776356	Brake Test	km/h	4.81	Pass

Parking Brake Performance



Water level



Front Fender Right



Tyre Front Right



Tyre Rear Left



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT**

Report No: 2016776356

DATE
25/02/2025

Spare Tyre

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016776356

DATE
25/02/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za