



CONDITION REPORT



Report No:
2016959360
DATE
26/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	26/07/2025		M57 Pretoria Road - 1619
Inspection Date	26/07/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	HP66GXGP
Model	COROLLA QUEST 1.6 [2016-2021]	Register Number	
VIN	AHTLB52E403134881	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/05/2026
Color	SILVER	Power / Displacement	
Year Model	2018	Paint Finish	M - METALLIC
Km Reading	451,833 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTLB52E403134881



CONDITION REPORT



Report No:
2016959360
DATE
26/07/2025

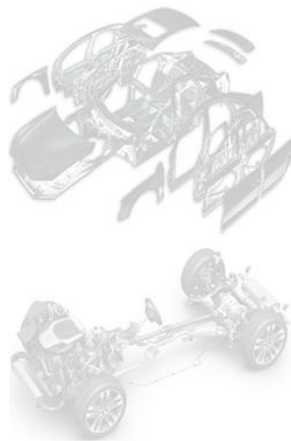

Damage

Repair Way

Seat Front Right Torn / Cut	Repair
Front Bumper Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Residual Traces of Repair	Repair
Rear bumper Residual Traces of Repair	Repair
Sill Panel Left Residual Traces of Repair	Repair
Roof Dented	Repair
Tie Rod End right Damaged	Replace
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Tyre Rear Left Damaged	Replace
Rim Rear Left Dented	Repair
Rim Rear Right Damaged	Replace
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Clutch Operation Slippy Hesitation	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.2	2.7	-	
Rear	1.6	1.9	-	
Emergency / Parking	1.1	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91V	Firemax	FM601	V	4224	2 mm
Front Right	195/65R15	91V	Dunlop	Sport	V	2724	2 mm
Rear Left	195/65R15	91V	Dunlop	Sport	V	4823	1 mm
Rear Right	195/65R15	91H	Annaite	AN600	V		1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E403134881



CONDITION REPORT



Report No:
2016959360
DATE
26/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C0278	ABS SOLENOID REPLAY CIRCUIT OPEN	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on some body panels, Residual traces of poor repair on most body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTLB52E403134881



CONDITION REPORT



Report No:
2016959360
DATE
26/07/2025

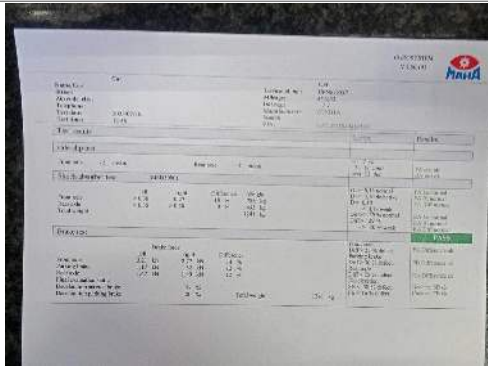

Shock and brake report



Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E403134881



CONDITION REPORT



Report No:
2016959360
DATE
26/07/2025



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E403134881




CONDITION REPORT



Report No:
2016959360
DATE
26/07/2025



LF TYRE TREAD

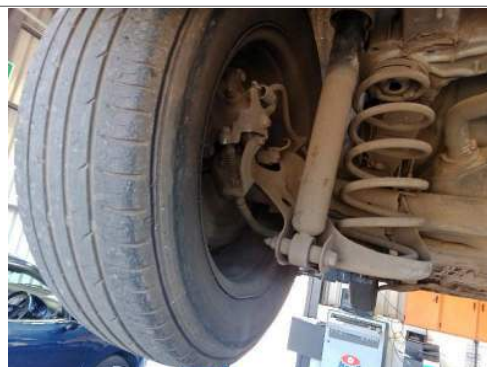

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



No sparewheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E403134881



CONDITION REPORT



Report No:
2016959360
DATE
26/07/2025



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E403134881



CONDITION REPORT



Report No:
2016959360
DATE
26/07/2025



Expansion bottle



Right interior A pillar cover



Seat Front Right



Front Fender Right



Door Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E403134881



CONDITION REPORT



Report No:
2016959360
DATE
26/07/2025



Roof



Rear Fender Right



Rear Fender Left



Door Rear Left



Door Front Left



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E403134881



CONDITION REPORT



Report No:
2016959360
DATE
26/07/2025



Tie Rod End right



Front Bumper




Front Bumper



Front Bumper



Stabilizer Mounting Front Left

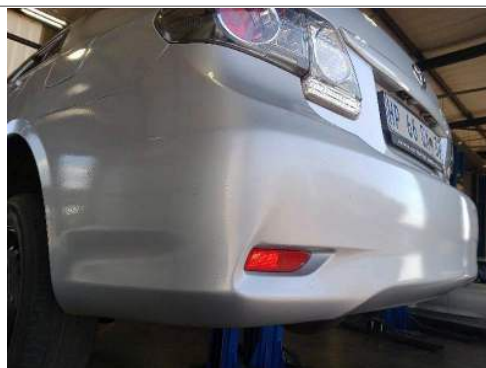

Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E403134881



CONDITION REPORT



Report No:
2016959360
DATE
26/07/2025



Rear bumper



Rear bumper



Stabilizer Mounting Front Left



CV Joint(s) Boot(s) Front Left (inner/outer)



Stabilizer Mounting Front Right



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E403134881



CONDITION REPORT



Report No:
2016959360
DATE
26/07/2025



Sill Panel Left



Sill Panel Left



Tyre Rear Left



Rim Rear Left



Rim Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTLB52E403134881