



CONDITION REPORT

Report No: 2016850657

DATE
22/04/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/04/2025		M57 Pretoria Road - 1619
Inspection Date	22/04/2025		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	JZ97KBGP
Model	HI-ACE 2.5 SESFIKILE 16-S DSL MINIBUS [2020-2022]	Register Number	
VIN	AHTSS22P207123382	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/04/2025
Color	WHITE	Power / Displacement	
Year Model	2021	Paint Finish	C - COMMON
Km Reading	276,887 KM	Fuel	DIESEL
Cab / Body Type	OTHERS	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

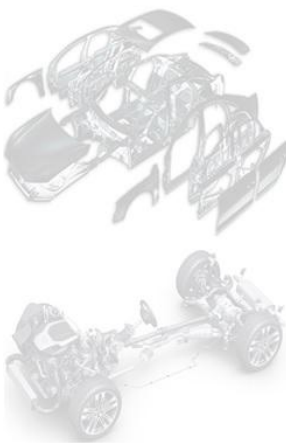

Damage	Repair Way
Expansion Bottle Damaged	Replace
Windscreen Wiper Missing	Replace
Tail Light Left Damaged	Replace
Bright Light Left Malfunction	Repair
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Grill Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
B • Pillar Left Paintwork • Scratched	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Chipmarks	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Damaged	Repair
Sliding Door Paintwork • Scratched	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207123382



CONDITION REPORT

Report No: 2016850657

DATE
22/04/2025

Damage

Windscreen Cracked
Tyre Front Right Smooth
Tyre Rear Left Smooth
Sliding door not opening
ABS light on

Repair Way

Replace
Replace
Replace
Repair
Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.7	5.0	-	
Rear	3.0	2.1	-	
Emergency / Parking	1.4	1.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15	106/104S	Dunlop	Sp sport	V	4622	2 mm
Front Right	195R15	106/104R	Tracmax	Transporter	V	4723	0 mm
Rear Left	195R15	106/104R	Tracmax	Transporter	V	4723	0 mm
Rear Right	195R15	106/104R	Tracmax	Transporter	V	4023	3 mm
Spare	195R15	106/104Q	Radar	Rlt-71	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	HISTORY	B1801	DRIVING SIDE SQUIB CIRCUIT OPEN	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Vehicle got some scratches, stone chips and dents. Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge,

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207123382

**CONDITION REPORT****Report No: 2016850657****DATE**
22/04/2025

operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207123382



CONDITION REPORT


Report No: 2016850657

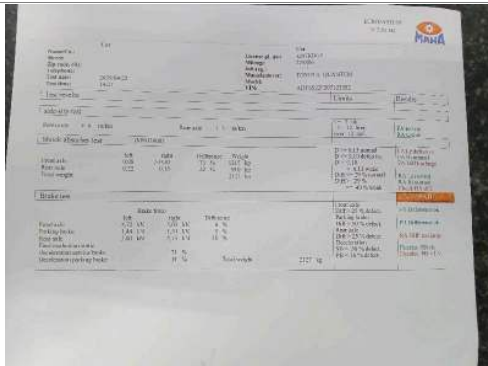DATE
22/04/2025

Shock and brake report



Diagnostic report

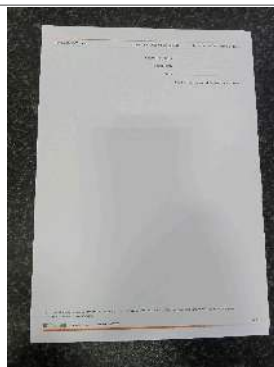

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207123382



CONDITION REPORT

Report No: 2016850657

DATE
22/04/2025

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207123382



CONDITION REPORT

Report No: 2016850657

DATE
22/04/2025

90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

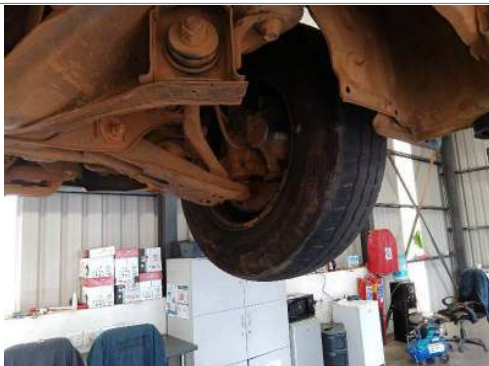

RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207123382



CONDITION REPORT

Report No: 2016850657

DATE
22/04/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207123382



CONDITION REPORT

Report No: 2016850657

DATE
22/04/2025

Coolant bottle



Expansion Bottle



Water level



Bonnet



Grill



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207123382



CONDITION REPORT

Report No: 2016850657

DATE
22/04/2025

Seat Front Left



Seat Front Right



Seat Rear



Tail Light Left



Boot Lid / Hatch door



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207123382



CONDITION REPORT

Report No: 2016850657

DATE
22/04/2025

Sliding Door



Rear bumper



Rear Fender Right



Door Front Right



Front Fender Right



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207123382



CONDITION REPORT

Report No: 2016850657

DATE
22/04/2025

Door Front Left



B • Pillar Left



Tyre Rear Left



Tyre Front Right



Windscreen Wiper



Bright Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P207123382