



CONDITION REPORT



Report No:
2016988658
DATE
22/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/08/2025		M57 Pretoria Road - 1619
Inspection Date	22/08/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	MINI BUS	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	JR47GBGP
Model	HI-ACE 2.5 SESFIKILE 16-S DSL MINIBUS [2019-2021]	Register Number	
VIN	AHTSS22P807113908	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2020	Paint Finish	C - COMMON
Km Reading	170,778 KM	Fuel	DIESEL
Cab / Body Type	OTHERS	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807113908



CONDITION REPORT



Report No:
2016988658
DATE
22/08/2025

	Damage	Repair Way
	Engine Wiring Defective	Repair
	Tail Light Right Cracked	Replace
	Wiring connections Defective	Repair
	Seat Rear Torn / Cut	Repair
	Seat Rear (2. Row) Torn / Cut	Repair
	Door Lock Front Right Damaged	Repair
	Door Lock Boot Lid Damaged	Replace
	Rear Lower Valance Welded	Repair
	Rear Fender Left Residual Traces of Repair	Repair
	Rear Fender Right Residual Traces of Repair	Repair
	Boot Lid / Hatch door Damaged	Repair
	Tyre Front Left Torn / Cut	Replace
	Tyre Front Right Smooth	Replace
	Tyre Rear Left Smooth	Replace

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	4.0	4.5	-	
Rear	3.1	3.0	-	
Emergency / Parking	1.7	1.5	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15	106/104S	Toyo	H07	V	3221	1 mm
Front Right	195R15	106/104N	Durun	C212		2122	0 mm
Rear Left	195R15	106/104Q	Mazzini	Effivan	V	2122	5 mm
Rear Right	195R15	106/104S	Toyo	H07	V	1021	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807113908



CONDITION REPORT



Report No:
2016988658
DATE
22/08/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1241	LOW OR HIGH POWER SUPPLY VOLTAGE	

Inspection Conditions

No undercarriage inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Body • Exterior: Residual traces of repair work on most body panels. Signs of spray work done on most body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P807113908




CONDITION REPORT




Report No:
2016988658
DATE
22/08/2025

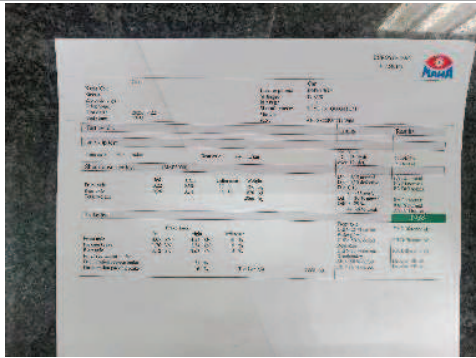

Shock and brake report

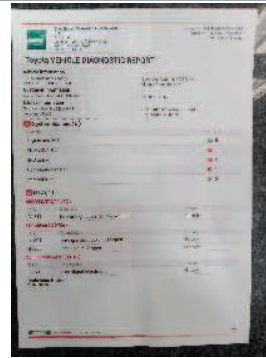

Diagnostic test

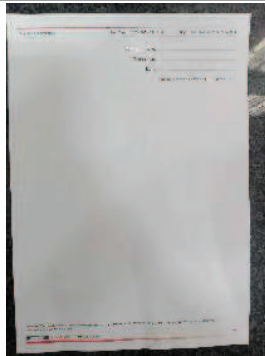

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807113908



CONDITION REPORT



Report No:
2016988658
DATE
22/08/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807113908



CONDITION REPORT



Report No:
2016988658
DATE
22/08/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



No license disc

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807113908



CONDITION REPORT



Report No:
2016988658
DATE
22/08/2025



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



No sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807113908



CONDITION REPORT



Report No:
2016988658
DATE
22/08/2025



Expansion bottle



Oil cap and dipstick



Seat Rear (2. Row)



Seat Rear (2. Row)



Seat Rear (2. Row)



Seat Rear

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807113908




CONDITION REPORT



Report No:
2016988658
DATE
22/08/2025



Seat Rear

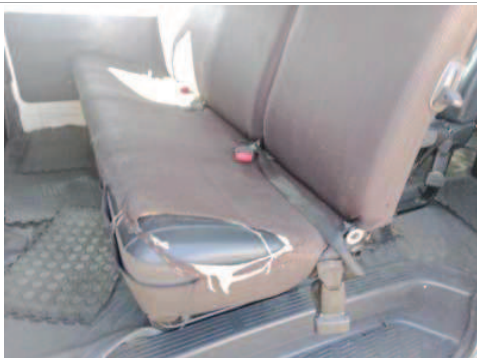

Seat Rear



Rear Fender Right



Rear Fender Right



Tail Light Right



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807113908



CONDITION REPORT



Report No:
2016988658
DATE
22/08/2025



Boot Lid / Hatch door



Rear Fender Left



Wiring connections



Tyre Front Left



Engine Wiring



Engine Wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P807113908



CONDITION REPORT



Report No:
2016988658
DATE
22/08/2025

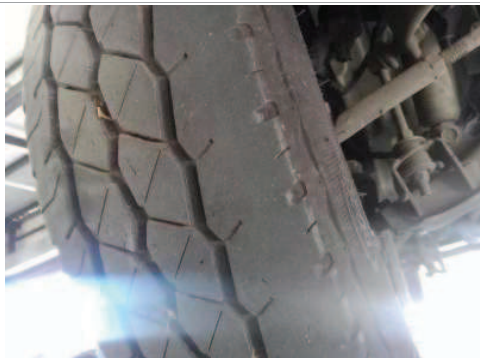

Tyre Front Right



Tyre Rear Left



Rear Lower Valance



Rear Lower Valance



Rear Lower Valance



Rear Lower Valance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807113908



CONDITION REPORT



Report No:
2016988658
DATE
22/08/2025



Rear Lower Valance



Rear Lower Valance



Rear Lower Valance



Rear Lower Valance



Rear Lower Valance



Rear Lower Valance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807113908



CONDITION REPORT



Report No:
2016988658
DATE
22/08/2025



Rear Lower Valance



Door Lock Front Right



Door Lock Boot Lid

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807113908