



CONDITION REPORT



Report No:
2016963016
DATE
30/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/07/2025		M57 Pretoria Road - 1619
Inspection Date	30/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	90MMMJL
Model	HI-ACE 2.5 SESFIKILE 16-S DSL MINIBUS [2021-2024]	Register Number	
		Date Of First Licensing	
VIN	AHTSS22P807143328	Last COR	
Engine Number		License Expiry Date	31/01/2026
Doors	4	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2023	Fuel	DIESEL
Km Reading	277,714 KM	Transmission	MANUAL
Cab / Body Type	STATION WAGON		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807143328



CONDITION REPORT



Report No:
2016963016
DATE
30/07/2025



Damage	Repair Way
Fan Belt Damaged	Replace
Radio/CD/USB Missing	Replace
Heater control Damaged	Repair
Engine Management Lights Set	Repair
Windscreen Wiper Damaged	Replace
Tail Light Right Damaged	Replace
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Seat Rear (2. Row) Damaged	Repair
Hood Lining Damaged	Repair
Side Mirror Left Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Caliper 1. Axle left Damaged	Replace
Caliper 1. Axle right Damaged	Replace
Brake disc 1. Axle left Worn	Replace
Rebound Rubber Front Axle Left Damaged	Replace
Control Arm(s) Front Axle Right Damaged	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Sub Frame Damaged	Replace
Sump damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	5.41	4.47	-	
Rear	3.2	4.37	-	
Emergency / Parking	2.3	3.12	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807143328



CONDITION REPORT



Report No:
2016963016
DATE
30/07/2025

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R14LT	104R	Tackies	Radial	V	4123	0 mm
Front Right	195R14LT	104R	Tackies	Radial	V	3623	0 mm
Rear Left	195R15C	104S	Toyo	Radial	V	1322	0 mm
Rear Right	195R14LT	104R	Tackies	Radial	V	0223	0 mm
Spare	195R14LT	104R	Teckies	Radial	V	3623	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE AND ECT	P0607	CONTROL MODULE PERFORMANCE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 11 DTC'S AT TIME OF TESTING SEE DTC REPORT. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels. Vehicle body in poor condition.

Brakes: front brake calipers granted down to fit non-standard smaller wheels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807143328



CONDITION REPORT




Report No:


2016963016

DATE _____


30/07/2025

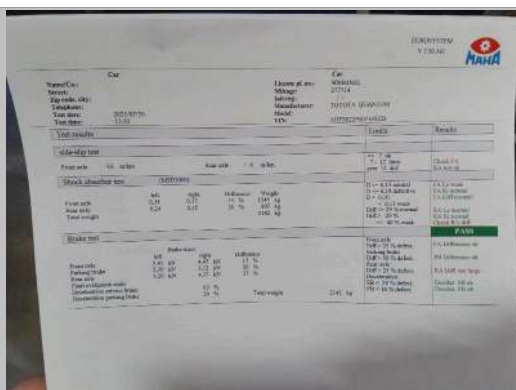

Brake test.

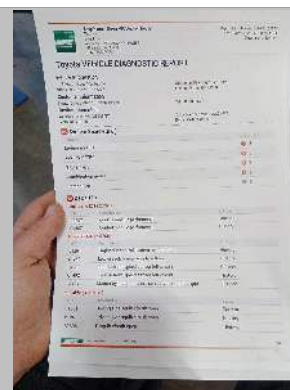

Diagnostic.

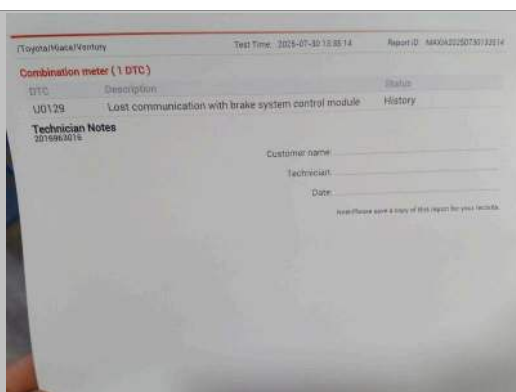

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807143328



CONDITION REPORT



Report No:
2016963016
DATE
30/07/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807143328



CONDITION REPORT



Report No:
2016963016
DATE
30/07/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



spare wheel.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807143328



CONDITION REPORT



Report No:


2016963016

DATE

30/07/2025



LICENSE DISC

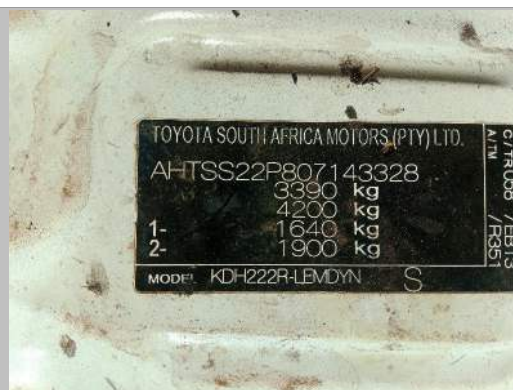

VIN PLATE OR STICKER



ENGINE 1



Undercarriage rear.



Undercarriage front.



Oil cap and dipstick.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807143328



CONDITION REPORT



Report No:

2016963016

DATE

30/07/2025



sump damaged.



Water level



Front Bumper



Front Bumper



Bonnet



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807143328



CONDITION REPORT



Report No:
2016963016
DATE
30/07/2025



Door Rear Left



Rear Fender Left



Boot Lid / Hatch door



Rear bumper



Rear Fender Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807143328



CONDITION REPORT



Report No:
2016963016
DATE
30/07/2025



Windscreen




Seat Front Right



Hood Lining



Seat Rear

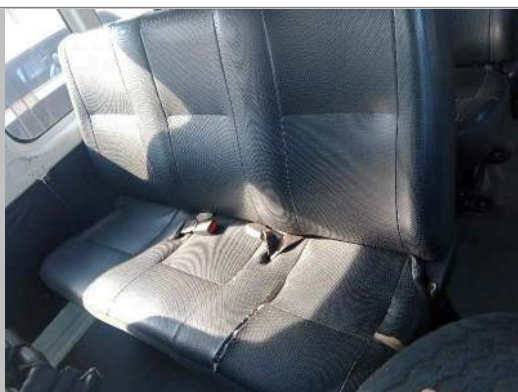

Seat Rear (2. Row)



Side Mirror Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807143328



CONDITION REPORT



Report No:

2016963016

DATE

30/07/2025



Radio/CD/USB



Heater control




Engine Management Lights



Tail Light Right



Windscreen Wiper

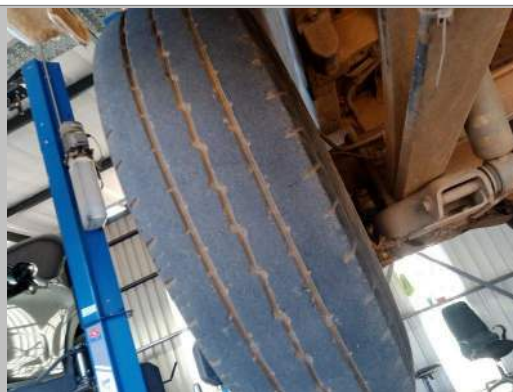

Tyre Rear Left

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807143328



CONDITION REPORT



Report No:
2016963016
DATE
30/07/2025



Tyre Rear Right



Tyre Front Right



Tyre Front Left



Caliper 1. Axle left



Caliper 1. Axle right



Rebound Rubber Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807143328



CONDITION REPORT



Report No:

2016963016

DATE

30/07/2025



Control Arm(s) Front Axle Right



Sub Frame



Fan Belt



Brake disc 1. Axle left

DEKRA Automotive (PTY) Ltd.

97 Willem Cruywagen Ave

Klerksoord, Pretoria, 0200

Phone: 012 542 4867

www.dekraauto.co.za

VIN: AHTSS22P807143328