



CONDITION REPORT



Report No:
2017304172
DATE
28/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/09/2026		M57 Pretoria Road - 1619
Inspection Date	28/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	N/A
Model	HI-ACE 2.5 SESFIKILE 16-S DSL MINIBUS [2021-2024]	Register Number	
		Date Of First Licensing	
VIN	AHTSS22P907146304	Last COR	
Engine Number		License Expiry Date	31/10/2026
Doors	4	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2024	Fuel	DIESEL
Km Reading	178,801 KM	Transmission	MANUAL
Cab / Body Type	OTHERS		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P907146304



CONDITION REPORT



Report No:
2017304172
DATE
28/09/2026

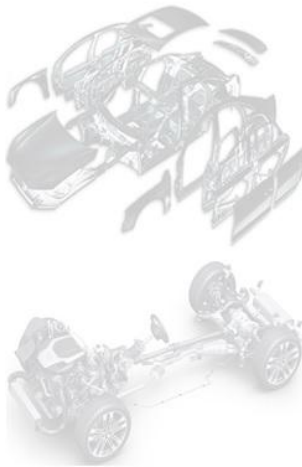

Damage	Repair Way
Headlight Left Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Grill Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Chipmarks	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Vin not matching license disc	Repair
Both number plates missing	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	5.3	5.3	-	
Rear	2.9	3.0	-	
Emergency / Parking	2.4	2.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R14	106/104R	Powertrac	Vanmarch	V	4025	3 mm
Front Right	195R14	106/104R	Powertrac	Vanmarch	V	4125	3 mm
Rear Left	195R14	106/104R	Powertrac	Vanmarch	V	4125	3 mm
Rear Right	195R14	106/104R	Powertrac	Vanmarch	V	4025	3 mm
Spare	195R14	106/104P	Ling long	LMC 8	V	4425	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P907146304

**CONDITION REPORT**

Report No:
2017304172
DATE
28/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P907146304



CONDITION REPORT



Report No:

2017304172

DATE

28/09/2026

Vehicle Information			
Make/Model:	CV	Year:	2016
Registration:	2016/000	Engine:	1.8L
Engine:	1.8L	Transmission:	Manual
Color:	White	Owner:	MAHA
Shock and Brake Report			
Wheel	Shock	Brake	Notes
Front Left	Good	Good	
Front Right	Good	Good	
Rear Left	Good	Good	
Rear Right	Good	Good	

Shock and brake report

Vehicle Information	
Make/Model:	CV
Registration:	2016/000
Engine:	1.8L
Transmission:	Manual
Color:	White
Owner:	MAHA
Diagnostic Report	
Engine:	Good
Transmission:	Good
Brake:	Good
Shock:	Good
Steering:	Good
Electrical:	Good
Exhaust:	Good
Overall:	Good

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P907146304



CONDITION REPORT



Report No:

2017304172

DATE

28/09/2026



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P907146304



CONDITION REPORT




Report No:

2017304172

DATE

28/09/2026

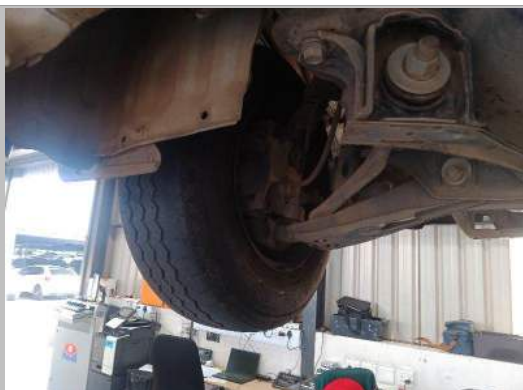

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P907146304



CONDITION REPORT



Report No:
2017304172
DATE
28/09/2026



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Coolant bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P907146304



CONDITION REPORT



Report No:
2017304172
DATE
28/09/2026



Water level



Headlight Left



Windscreen



Bonnet



Grill



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P907146304



CONDITION REPORT



Report No:

2017304172

DATE

28/09/2026



Front Bumper



Door Front Right



Rear Fender Right



Boot Lid / Hatch door



Rear Fender Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P907146304



CONDITION REPORT



Report No:
2017304172
DATE
28/09/2026



Front Fender Left



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P907146304