



## CONDITION REPORT

Report No: 201629225

DATE  
04/03/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	04/03/2024		M57 Pretoria Road - 1619
Inspection Date	04/03/2024		Kempton Park - GT

**Vehicle Data**

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	INFINTI	Registration Number	DP04PCGP
Model	Q50	Register Number	
VIN	JN1BDAV37U0203583	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/09/2024
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	191,152 KM	Fuel	DIESEL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

**Vehicle Options & Accessories****Items**

## VEHICLE INSPECTION



Damage	Repair Way
Engine Oil Leak	Repair
Bonnet stay and shocks Defective	Replace
Front Bumper Paintwork • Scratched	Repair
Rear Fender Left Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Stabilizer Mounting Rear Right Damaged	Replace
Differential Oil Sweat	Repair
CV Joint(s) Rear Left (inner/outer) Damaged	Repair
CV Joint(s) Boot(s) Rear Left (inner/outer) Damaged	Replace
Engine Performance Insufficient	Repair
Engine	Bottom of engine is covered
Warning light illuminated	Repair
Body exterior	Signs of spray work done on some body panels



## CONDITION REPORT

Report No: 2016292285

DATE  
04/03/2024

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [kN]	Braking Force [kN]		
Front	4.0	4.0	-	-
Rear	2.6	2.5	-	-
Emergency / Parking	1.6	1.5	-	-

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/55R17	97Y	Pirelli	P7	V	0122	5 mm
Front Right	225/55R17	97Y	Pirelli	P7	V	4921	6 mm
Rear Left	225/55R17	97Y	Pirelli	P7	V	3319	4 mm
Rear Right	225/55R17	97Y	Pirelli	P7	V	3319	6 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

### Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




## CONDITION REPORT

VIN: IN1PAV371029285  
Report No: 201029285


2 / 9

DATE


04/03/2024

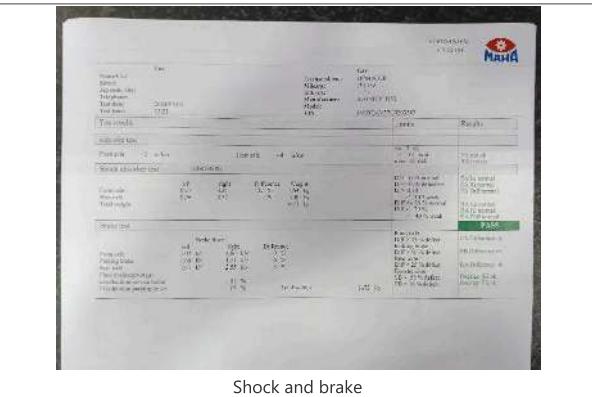


Shock and brake

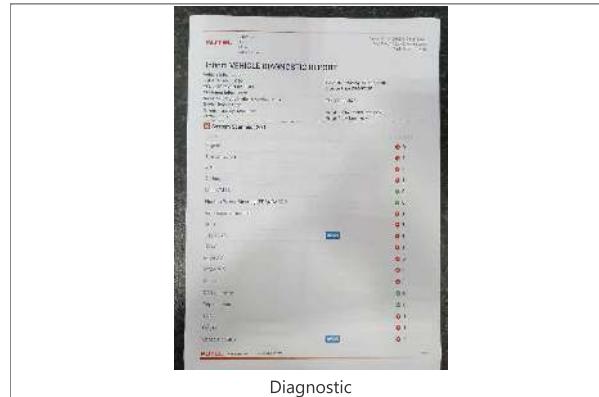


Diagnostic

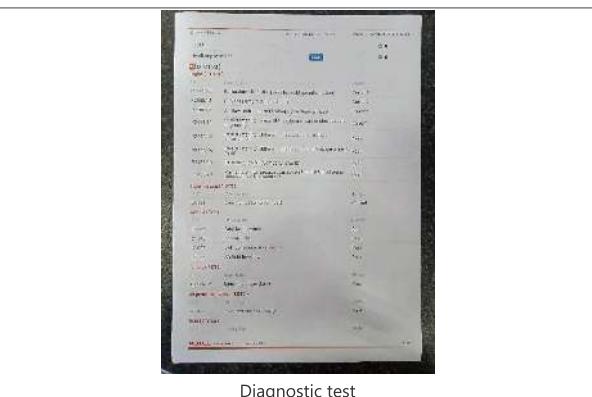

Diagnostic test

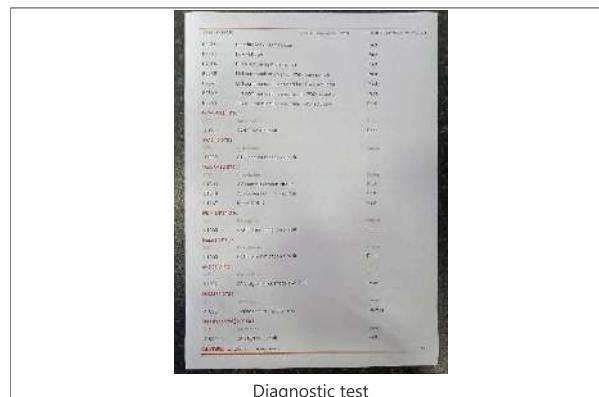

Diagnostic test

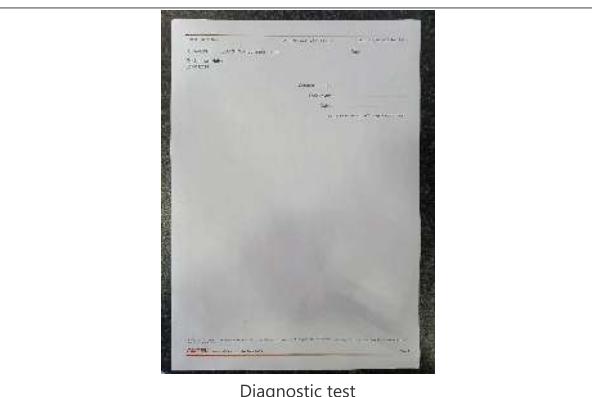

Diagnostic test



FRONT RIGHT CORNER



## CONDITION REPORT

Report No: 2016292285

VIN: JN1BDAV37U0203583

DATE

04/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016292285

DATE

VIN: JN1BDAV374032024

4 / 9



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



## CONDITION REPORT

Report No: 2016292285

DATE  
04/03/2024

VIN: JN1BDAV37U0203583

5 / 9

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016292285

DATE  
04/03/2024

VIN: JN1BDAV37U0203583

6 / 9



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



## CONDITION REPORT

Report No: 2016292285

DATE  
04/03/2024

VIN: JN1BDAV37U0203583

7 / 9

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 201629225

DATE  
04/03/2024

RF TYRE TREAD



No sparewheel

VIN: JN1BDAV37U0203583

8 / 9



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



## CONDITION REPORT

Report No: 2016292285

DATE  
04/03/2024

VIN: JN1BDAV37U0203583

9 / 9



## CONDITION REPORT

Report No: 2016292285

DATE  
04/03/2024

Rear end



CHASSIS



Oil cap and



Expansion bottle



Warning light illuminated



Water level



## CONDITION REPORT

Report No: 2016292285

DATE  
04/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016292285

DATE  
04/03/2024

Bonnet stay and shocks



Bonnet stay and shocks



Front Bumper



Front Bumper



Front Bumper



Rear Fender Left



## CONDITION REPORT

Report No: 2016292285

DATE  
04/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016292285

DATE  
04/03/2024

Rear bumper



Engine



Stabilizer Mounting Rear Right



Differential



CV Joint(s) Rear Left (inner/outer)



CV Joint(s) Boot(s) Rear Left (inner/outer)

**CONDITION REPORT**

Report No: 2016292285

DATE  
04/03/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)