



CONDITION REPORT



Report No:
2017299282
DATE
16/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/09/2026		M57 Pretoria Road - 1619
Inspection Date	16/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	HDZ312L
Model	COROLLA 1.8 XS CVT [2020-2022]	Register Number	
VIN	JTDBP3AE90J181867	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/03/2027
Color	SILVER	Power / Displacement	
Year Model	2021	Paint Finish	M - METALLIC
Km Reading	126,647 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDBP3AE90J181867



CONDITION REPORT



Report No:

2017299282

DATE

16/09/2026



Damage

Repair Way

Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Bolt(s) / Nut(s) Rear Wheel Left Damaged	Replace
Belly plates Damaged	Replace
R/R tire deferred name brand	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.4	4.0	-	
Rear	2.0	1.8	-	
Emergency / Parking	1.9	1.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91V	Dunlop	Sp sport	V	0425	3 mm
Front Right	205/55R16	91V	Dunlop	Sp sport	V	4124	1 mm
Rear Left	205/55R16	91V	Dunlop	Sp sport	V	0425	3 mm
Rear Right	205/55R16	94W	Royal black	Royal perfor	V	0422	3 mm
Spare	205/55R16	91V	Dunlop	Enasave	V	0000	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTD BP3AE90J181867



CONDITION REPORT



Report No:
2017299282
DATE
16/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	HISTORY	P1605	ROUGH IDLING	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTD BP3AE90J181867



CONDITION REPORT



Report No:

2017299282

DATE _____

16/09/2026

[illegible]

Shock and brake report

1. 姓名: 王德胜
 2. 性别: 男
 3. 年龄: 45
 4. 职业: 教师
 5. 籍贯: 湖南长沙
 6. 民族: 汉族
 7. 婚姻状况: 已婚
 8. 子女情况: 一子一女
 9. 健康状况: 良好
 10. 兴趣爱好: 读书、运动
 11. 自我评价: 为人正直, 责任心强
 12. 其他说明: 无

Diagnostic report

[illegible]

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDBP3AE90J181867



CONDITION REPORT



Report No:

2017299282

DATE

16/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDBP3AE90J181867




CONDITION REPORT



Report No:
2017299282
DATE
16/09/2026



90 DEGREE LEFT

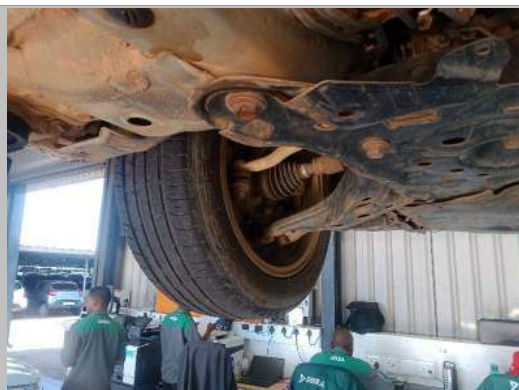

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTD BP3AE90J181867



CONDITION REPORT



Report No:

2017299282

DATE

16/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Expenditure bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTD8P3AE90J181867



CONDITION REPORT



Report No:
2017299282
DATE
16/09/2026



Oil cap and dipstick



Water level



Windscreen



Bonnet



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTD BP3AE90J181867



CONDITION REPORT




Report No:

2017299282

DATE

16/09/2026

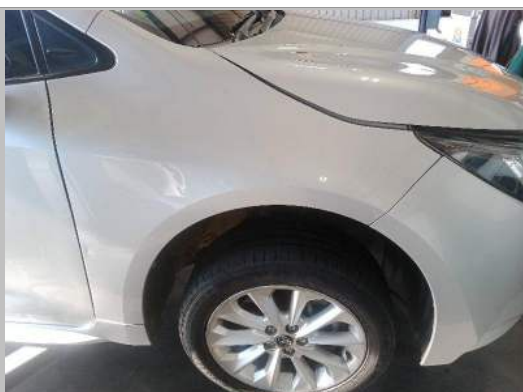

Front Fender Right



Door Front Right



Door Rear Right



Rear bumper



Rear bumper



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTD BP3AE90J181867



CONDITION REPORT



Report No:
2017299282
DATE
16/09/2026



Front Fender Left



Door Front Left



Side Mirror Left



Door Rear Left



Rear Fender Left



Belly plates

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDBP3AE90J181867



CONDITION REPORT



Report No:
2017299282
DATE
16/09/2026



Bolt(s) / Nut(s) Rear Wheel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDBP3AE90J181867