



CONDITION REPORT



Report No:
2016959141
DATE
26/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	26/07/2025		M57 Pretoria Road - 1619
Inspection Date	26/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	HFF624L
Model	RUMION 1.5 SX MPV [2021-2023]	Register Number	
VIN	JTDDND22S00454269	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2022	Paint Finish	M - METALLIC
Km Reading	129,041 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: JTDDND22S00454269



CONDITION REPORT



Report No:
2016959141
DATE
26/07/2025

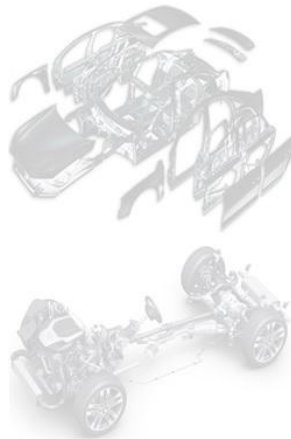

Damage

Repair Way

Windscreen Washer Worn	Replace
Seat Front Left Torn / Cut	Repair
Door Sealing Rubber Rear Left Torn / Cut	Repair
Front Bumper Residual Traces of Repair	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Windscreen Chipped	Replace
Tyre Front Left Excessive Wear & Tear	Replace
Tyre Front Right Excessive Wear & Tear	Replace
Spare Tyre Excessive Wear & Tear	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Body exterior	Residual traces of repair work done on some body p
Body exterior	Signs of spray work done on some body panels
Body exterior	Minor dents scratches stone chips on some body pan

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.2	2.7	-	
Rear	2.0	2.2	-	
Emergency / Parking	1.7	1.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Bridgestone	Ecopia	V	0000	0 mm
Front Right	185/65R15	88H	Bridgestone	Ecopia	V	0000	0 mm
Rear Left	185/65R15	88H	Bridgestone	Ecopia	V	0522	1 mm
Rear Right	185/65R15	88H	Bridgestone	Ecopia	V	0522	1 mm
Spare	185/65R15	88H	Bridgestone	Ecopia	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00454269



CONDITION REPORT



Report No:
2016959141
DATE
26/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1057	POWER SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00454269



CONDITION REPORT




Report No:
2016959141
DATE
26/07/2025



Sparewheel




Manual

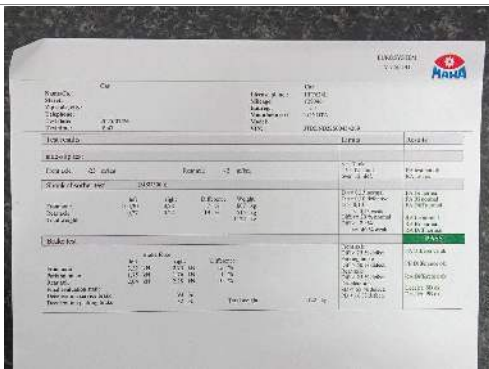

Shock and brake report



Diagnostic test

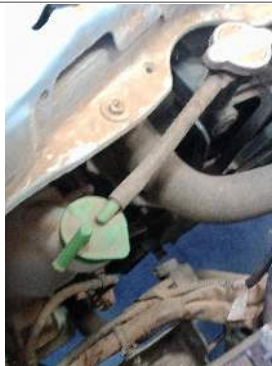

Coolant reservoir



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00454269



CONDITION REPORT



Report No:
2016959141
DATE
26/07/2025



R/F headlight clips of



Rear end



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00454269



CONDITION REPORT



Report No:
2016959141
DATE
26/07/2025



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00454269



CONDITION REPORT



Report No:
2016959141
DATE
26/07/2025



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00454269



CONDITION REPORT



Report No:
2016959141
DATE
26/07/2025



ENGINE 2



ENGINE 1



Spare Tyre



Door Sealing Rubber Rear Left



Door Sealing Rubber Rear Left



Seat Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00454269



CONDITION REPORT



Report No:
2016959141
DATE
26/07/2025



Front Fender Right



Rear bumper



Rear bumper



Windscreen



Windscreen Washer



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00454269



CONDITION REPORT



Report No:
2016959141
DATE
26/07/2025



Door Rear Right



Tyre Front Right



Front Bumper



Front Bumper



Bolt(s) / Nut(s) Front Wheel Right



Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00454269



CONDITION REPORT



Report No:
2016959141
DATE
26/07/2025



Front Bumper



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00454269