



CONDITION REPORT



Report No:
2017304211
DATE
28/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/09/2026		M57 Pretoria Road - 1619
Inspection Date	28/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	CV37FZGP
Model	RUMION 1.5 S MPV [2023-2025]	Register Number	
VIN	JTDDND22S00A24130	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/06/2026
Color	WHITE	Power / Displacement	
Year Model	2025	Paint Finish	TWO COAT UNI
Km Reading	153,228 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00A24130



CONDITION REPORT



Report No:

2017304211

DATE

28/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Repair
Tyre Rear Right Worn	Replace
Spare Tyre Damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.81	2.63	-	
Rear	2.26	2.54	-	
Emergency / Parking	0.83	0.99	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	88H	Goodyear	Efficient	V	3619	0 mm
Front Right	185/65R15	92T	General	Radial	V	4521	0 mm
Rear Left	185/65R15	88H	Tracmax	Radial	V	4825	0 mm
Rear Right	185/60R15	84H	Annaite	Radial	V	1625	0 mm
Spare	185/60R15	84H	Annaite	Radial	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00A24130



CONDITION REPORT



Report No:
2017304211
DATE
28/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.
Tyres and Rims: spare wheel deflated.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00A24130




CONDITION REPORT



Report No:
2017304211
DATE
28/09/2026

Vehicle Data			
Vehicle No.	2017304211	Vehicle P. No.	2017304211
City/Make/Model	Toyota Aygo	Year	2017
Engine No.	14000000000000000000	Engine P. No.	14000000000000000000
Test Date	28/09/2026	Test Time	14:00
Test Results			
Test Name	Result	Pass/Fail	Notes
Visual Inspection	Pass	Pass	
Brake Test	Pass	Pass	
Steering Test	Pass	Pass	
Light Test	Pass	Pass	
Sound Test	Pass	Pass	
Final Result	Pass	Pass	

Brake test.

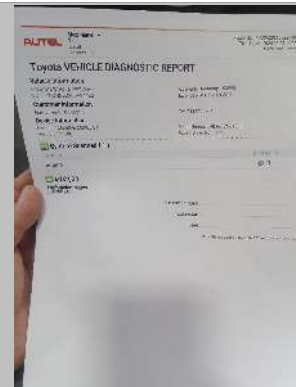

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00A24130



CONDITION REPORT



Report No:

2017304211

DATE

28/09/2026



ODOMETER



ADDITIONAL 11



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00A24130



CONDITION REPORT



Report No:

2017304211

DATE

28/09/2026



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00A24130



CONDITION REPORT



Report No:
2017304211
DATE
28/09/2026



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00A24130



CONDITION REPORT



Report No:

2017304211

DATE

28/09/2026



Front Bumper



Bonnet



Front Fender Left



Door Rear Left



Door Front Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00A24130



CONDITION REPORT



Report No:

2017304211

DATE

28/09/2026



Rear bumper



Boot Lid / Hatch door



Door Front Right



Door Rear Right



Rear Fender Right



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00A24130



CONDITION REPORT




Report No:


2017304211

DATE

28/09/2026

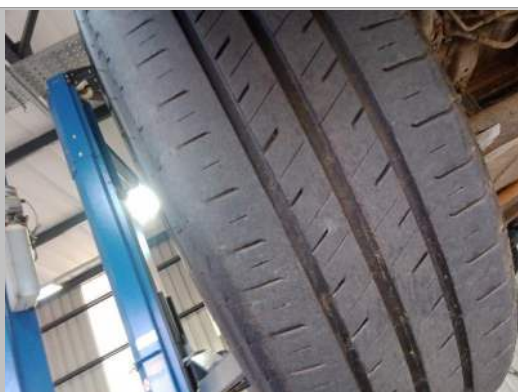


Tyre Rear Left

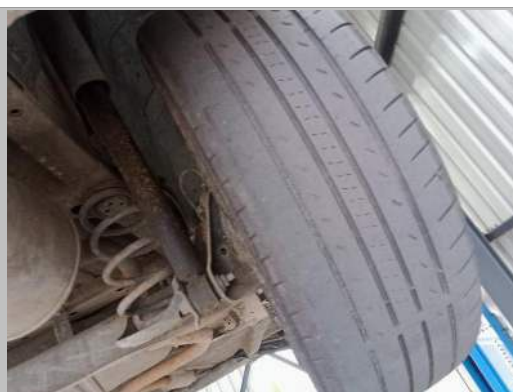


Tyre Rear Right



Spare Tyre

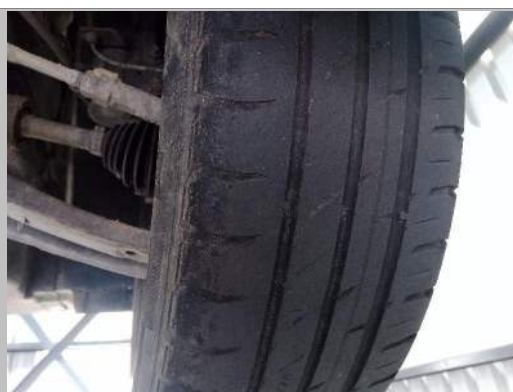

Tyre Front Right

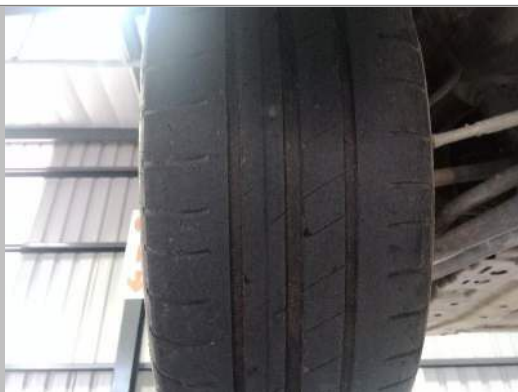

Tyre Front Left



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00A24130



CONDITION REPORT



Report No:
2017304211
DATE
28/09/2026



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTDDND22S00A24130