



CONDITION REPORT



Report No:  
2017297770  
DATE  
11/09/2026

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 11/09/2026        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 11/09/2026        |                     | Kempton Park -           |

Vehicle Data

|                 |                                     |                         |              |
|-----------------|-------------------------------------|-------------------------|--------------|
| Vehicle Type    | PASSENGER VEHICLE                   | Registered Owner        | MFC          |
| Manufacturer    | TOYOTA                              | Registration Number     | CAA145909    |
| Model           | URBAN CRUISER 1.5 XR AT [2023-2024] | Register Number         |              |
| VIN             | JTDUYMJ1S00105669                   | Date Of First Licensing |              |
| Engine Number   |                                     | Last COR                |              |
| Doors           | 5                                   | License Expiry Date     | 31/12/2025   |
| Color           | SILVER                              | Power / Displacement    |              |
| Year Model      | 2023                                | Paint Finish            | TWO COAT UNI |
| Km Reading      | 37,910 KM                           | Fuel                    | PETROL       |
| Cab / Body Type | STATION WAGON                       | Transmission            | AUTOMATIC    |

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JTDUYMJ1S00105669



## CONDITION REPORT



Report No:

2017297770

DATE


11/09/2026

## Damage

## Repair Way

Front Bumper Paintwork • Scratched  
 Bonnet Dented  
 Front Fender Right Dented  
 Door Front Right Paintwork • Scratched  
 Rear bumper Paintwork • Scratched

Repair  
 Repair  
 Repair  
 Repair  
 Repair

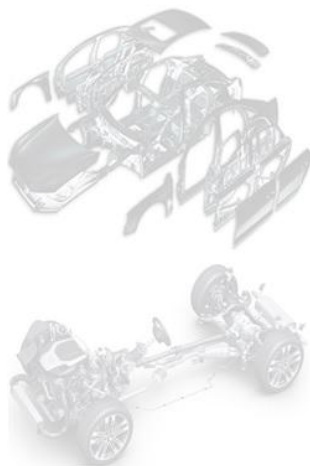

## Brakes

## Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 2.49               | 3.09               | -                |                                  |
| Rear                | 2.09               | 2.22               | -                |                                  |
| Emergency / Parking | 1.28               | 1.43               | -                |                                  |

## Tyres and Rims

## Tyre Specification &amp; Measurement

|             | Size       | Load/Speed Index | Manufacture | Model   | Type* | Production Date | Tread Depth (mm) |
|-------------|------------|------------------|-------------|---------|-------|-----------------|------------------|
| Front Left  | 215/60 R17 | 96H              | Apollo      | Apterra | V     | 3223            | 4 mm             |
| Front Right | 215/60 R17 | 96H              | Apollo      | Apterra | V     | 3323            | 4 mm             |
| Rear Left   | 215/60 R17 | 96H              | Apollo      | Apterra | V     | 3323            | 5 mm             |
| Rear Right  | 215/60 R17 | 96H              | Apollo      | Apterra | V     | 3323            | 5 mm             |
| Spare       | 215/60 R17 | 96H              | Apollo      | Apterra | V     | 3223            | 6 mm             |

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksoord, Pretoria, 0200  
 Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: JTDUYMJ1S00105669



## CONDITION REPORT



Report No:  
2017297770  
DATE  
11/09/2026

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System                              | Code     | Description                                        | Status |
|----|-------------------------------------|----------|----------------------------------------------------|--------|
| 1  | CGW(CENTRAL GATEWAY CONTROL MODULE) | U0121-87 | LOST COMMUNICATION WITH ABS OR ELECTRONIC STABILIT |        |

### Inspection Conditions

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches on body panels.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JTDUYMJ1S00105669



## CONDITION REPORT



Report No:  
2017297770  
DATE  
11/09/2026

| Vehicle Information                   |                      |                     |            |
|---------------------------------------|----------------------|---------------------|------------|
| Make/Model                            | Year                 | Engine/Trans        | Color      |
| Toyota Hilux                          | 2017                 | 2.5L 4-cyl / 6-spd  | White      |
| Registration                          | Chassis No.          | VIN                 | Engine No. |
| 12345678                              | 987654321            | JTDUYMJ1S00105669   | 123456789  |
| Brake and Shock Absorber Test Results |                      |                     |            |
| Wheel                                 | Brake Pressure (bar) | Shock Absorber (mm) | Result     |
| Front Left                            | 1.2                  | 10                  | Pass       |
| Front Right                           | 1.1                  | 12                  | Pass       |
| Rear Left                             | 1.0                  | 15                  | Pass       |
| Rear Right                            | 0.9                  | 18                  | Pass       |

Brake and shock absorber report

| Diagnostic Report |        |
|-------------------|--------|
| System            | Status |
| Engine            | OK     |
| Transmission      | OK     |
| Brakes            | OK     |
| Steering          | OK     |
| Electrical        | OK     |
| Suspension        | OK     |
| Exhaust           | OK     |
| Washers           | OK     |
| Lighting          | OK     |
| Wheels/Tyres      | OK     |
| Body/Chassis      | OK     |
| Interior          | OK     |
| Exterior          | OK     |
| Overall           | Pass   |

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JTDUYMJ1S00105669



## CONDITION REPORT



Report No:  
2017297770  
DATE  
11/09/2026



ODOMETER



Automatic Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: JTDUYMJ1S00105669



## CONDITION REPORT



Report No:  
2017297770  
DATE  
11/09/2026



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel



Spare Wheel Accessories

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: JTDUYMJ1S00105669



## CONDITION REPORT



Report No:

2017297770

DATE

11/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: JTDUYMJ1S00105669



## CONDITION REPORT



Report No:  
2017297770  
DATE  
11/09/2026



Front Fender Right



Door Front Right



Door Front Right



Bonnet



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)


VIN: JTDUYMJ1S00105669



## CONDITION REPORT



Report No:  
2017297770  
DATE  
11/09/2026

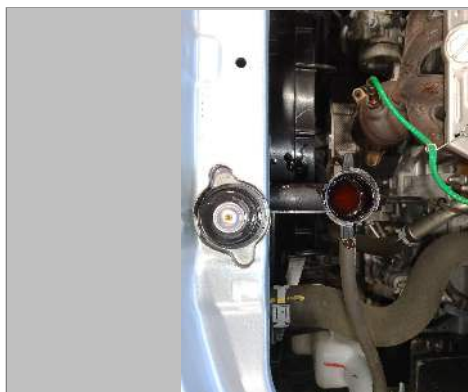

Water level



Water level



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: JTDUYMJ1S00105669