



CONDITION REPORT



Report No:
2017302481
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	TOYOTA	Registration Number	LGK836MP
Model	QUANTUM 2.8 GL DSL LWB BUS 11-S [2021-2024]	Register Number	
		Date Of First Licensing	
VIN	JTFPA9AP008026523	Last COR	
Engine Number		License Expiry Date	
Doors	4	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2022	Fuel	DIESEL
Km Reading	121,041 KM	Transmission	MANUAL
Cab / Body Type	STATION WAGON		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTFPA9AP008026523



CONDITION REPORT



Report No:

2017302481



DATE

25/09/2026

Damage

Repair Way

Tail Light Left Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Door Front Right Damaged	Repair
Rear bumper Damaged	Repair
Sill Panel Left Damaged	Repair
Tyre Front Left Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace

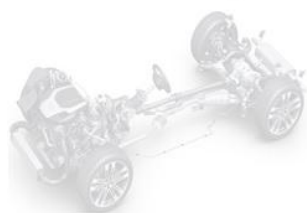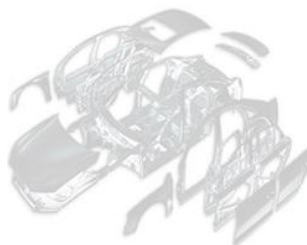

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	5.16	5.97	-	
Rear	4.94	5.76	-	
Emergency / Parking	3.43	2.62	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/65R16	113R	Continental	Contivan	V	2124	0 mm
Front Right	235/65R16	113R	Continental	Contivan	V	2124	2 mm
Rear Left	235/65R16	113R	Goodride	Radial	V	0923	0 mm
Rear Right	235/65R16	113T	Bridgestone	Radial	V	2222	0 mm
Spare	235/65R16	113R	Goodride	Radial	V	1023	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTFPA9AP008026523



CONDITION REPORT



Report No:
2017302481
DATE
25/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DRIVER DOOR MONITOR	B2311	MOTOR FAULT	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTFPA9AP008026523



CONDITION REPORT



Report No:

2017302481

DATE

25/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE FRONT



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTFPA9AP008026523



CONDITION REPORT




Report No:
2017302481
DATE
25/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)

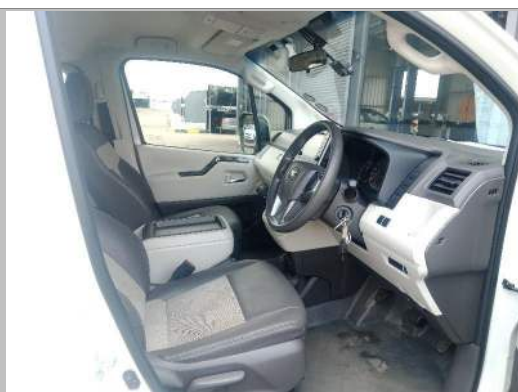

INTERIOR (FRONT DRIVER DOOR)



Manual.



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTFPA9AP008026523



CONDITION REPORT



Report No:
2017302481
DATE
25/09/2026



RR TYRE TREAD



RF TYRE TREAD



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTFPA9AP008026523



CONDITION REPORT



Report No:

2017302481

DATE


25/09/2026




VIN PLATE OR STICKER




LICENSE DISC

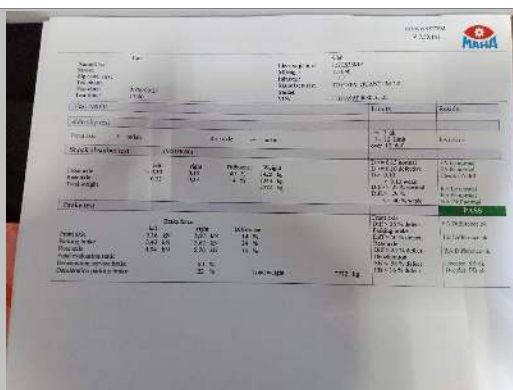

BRAKE TEST REPORT

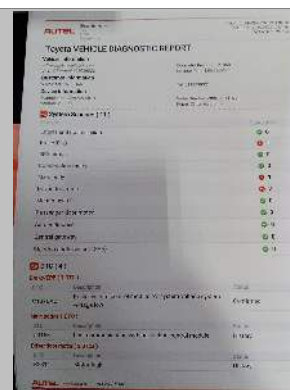

DIAGNOSTIC REPORT PAGE 1

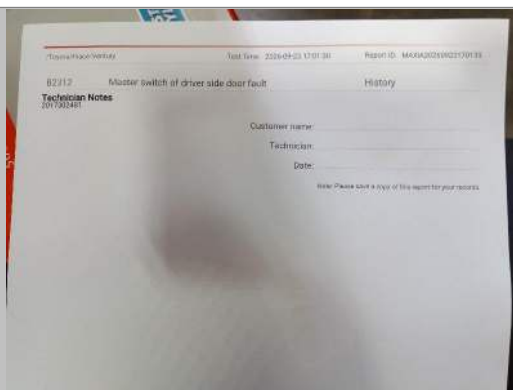

DIAGNOSTIC REPORT PAGE 2



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTFPA9AP008026523



CONDITION REPORT



Report No:

2017302481

DATE

25/09/2026



Front Bumper



Front Bumper



Bonnet



Sill Panel Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTFPA9AP008026523



CONDITION REPORT



Report No:

2017302481

DATE

25/09/2026



Door Front Right



Tyre Rear Left



Tyre Rear Right



Tyre Front Left



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTFPA9AP008026523