



CONDITION REPORT



Report No:
2016999444
DATE
02/09/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	02/09/2025		M57 Pretoria Road - 1619
Inspection Date	02/09/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	TOYOTA	Registration Number	HW17YFGP
Model	RAV4 2.0 GX CVT [2017-2019]	Register Number	
VIN	JTMZD3EV10J177202	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	SILVER	Power / Displacement	
Year Model	2019	Paint Finish	M - METALLIC
Km Reading	88,368 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTMZD3EV10J177202




CONDITION REPORT



Report No:
2016999444
DATE
02/09/2025

	Damage	Repair Way
	Front Bumper Paintwork • Scratched Door Rear Left Paintwork • Scratched Door Rear Right Paintwork • Scratched Rear bumper Damaged Spare Tyre Smooth Body exterior	Repair Repair Repair Repair Replace Signs of spray work done on some body panels

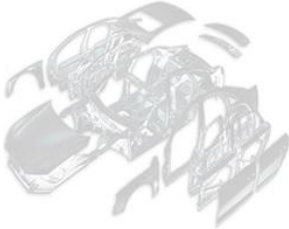

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.1	2.9	-	
Rear	2.1	2.5	-	
Emergency / Parking	1.8	1.3	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/65R17	102H	Michelin	Latitude	V	3318	0 mm
Front Right	225/65R17	102H	Michelin	Latitude	V	3318	2 mm
Rear Left	225/65R17	102H	Michelin	Latitude	V	3318	5 mm
Rear Right	225/65R17	102H	Michelin	Latitude	V	3318	5 mm
Spare	215/65R16	98H	Yokohama	Geolandar	V	////////	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTMZD3EV10J177202



CONDITION REPORT



Report No:
2016999444
DATE
02/09/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE AND ECT	P1604	STARTABILITY FAULT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTMZD3EV10J177202



CONDITION REPORT



Report No:
2016999444
DATE
02/09/2025



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTMZD3EV10J177202



CONDITION REPORT



Report No:
2016999444
DATE
02/09/2025



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Automatic



LF TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTMZD3EV10J177202




CONDITION REPORT



Report No:
2016999444
DATE
02/09/2025



RR TYRE TREAD

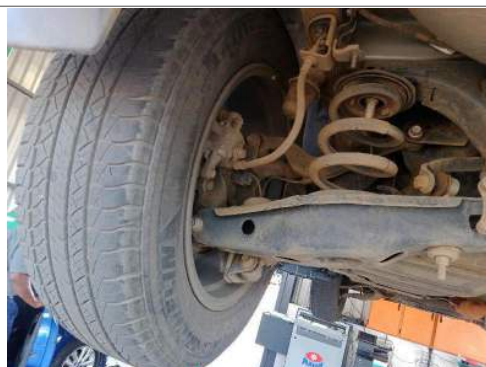


LR TYRE TREAD



Sparewheel



Expansion bottle

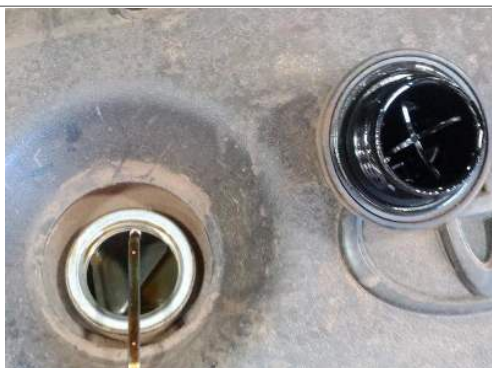

Oil cap and dipstick



Rear end

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTMZD3EV10J177202




CONDITION REPORT



Report No:
2016999444
DATE
02/09/2025




ENGINE 1

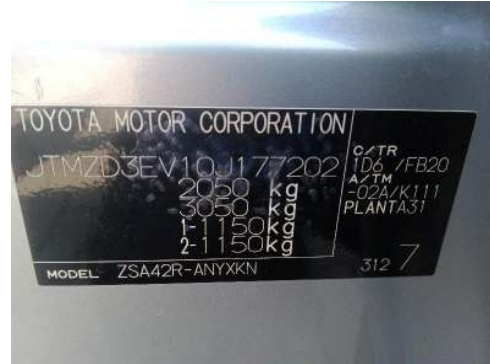


VIN PLATE OR STICKER




LICENSE DISC

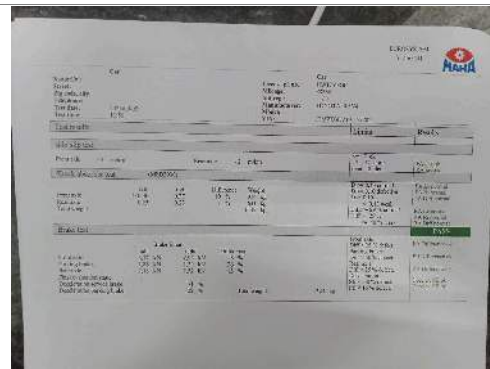

SHOCK AND BRAKE REPORT

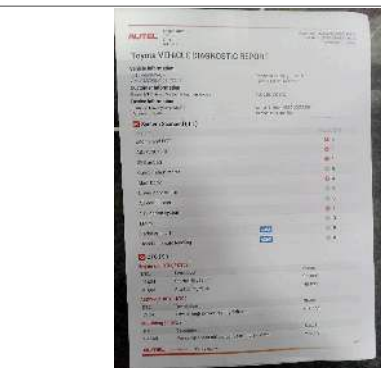

DIAGNOSTIC REPORT PAGE 1

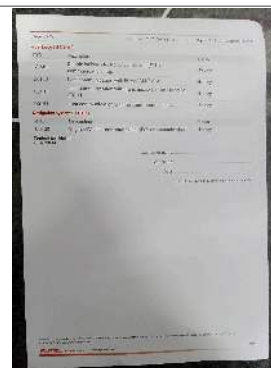

DIAGNOSTIC REPORT PAGE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTMZD3EV10J177202



CONDITION REPORT



Report No:
2016999444
DATE
02/09/2025



CHASSIS



ENGINE 2



Spare Tyre



Water level



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTMZD3EV10J177202



CONDITION REPORT



Report No:
2016999444
DATE
02/09/2025



Door Rear Left



Rear bumper



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTMZD3EV10J177202