



CONDITION REPORT



Report No:
2017026797
DATE
30/09/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/09/2025		M57 Pretoria Road - 1619
Inspection Date	30/09/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	HH96JKGP
Model	H-1	Register Number	
VIN	KMFWBX7KMJU974099	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	28/02/2025
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	228,583 KM	Fuel	DIESEL
Cab / Body Type	PANEL VAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMFWBX7KMJU974099



CONDITION REPORT



Report No:
2017026797
DATE
30/09/2025

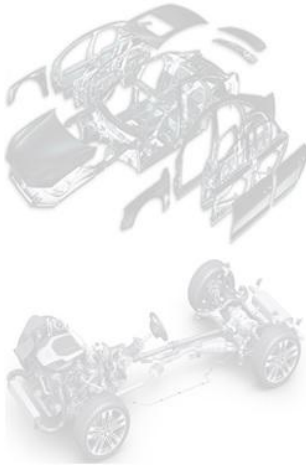

Damage	Repair Way
Front Bumper Damaged	Repair
Front Fender Left Damaged	Repair
Rear Fender Left Damaged	Repair
Door Rear Left Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Windscreen Scratched	Replace

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	5.16	4.62	-	
Rear	2.55	3.47	-	
Emergency / Parking	2.84	1.79	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/70R16	106R	Royal black	Radial	V	3923	1 mm
Front Right	215/70R16	106R	Royal black	Radial	V	3923	1 mm
Rear Left	215/70R16	106R	Royal black	Radial	V	4323	2 mm
Rear Right	215/70R16	106R	Royal black	Radial	V	3923	3 mm
Spare	215/70R16	106R	Hilo	Radial	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFWBX7KMJU974099

**CONDITION REPORT**

Report No:
2017026797
DATE
30/09/2025

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMFWBX7KMJU974099




CONDITION REPORT



Report No:
2017026797
DATE
30/09/2025

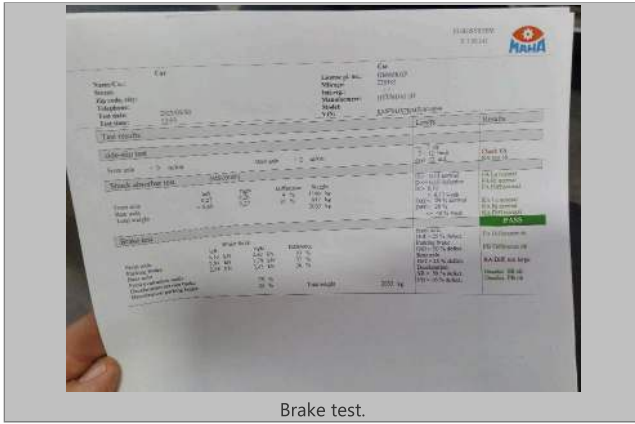

Brake test.

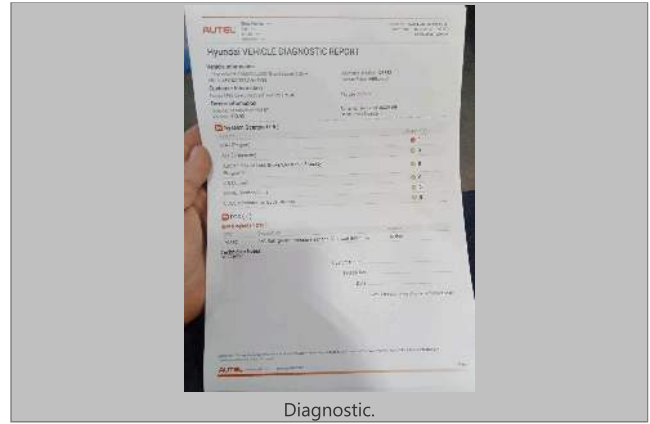

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFWBX7KMJU974099



CONDITION REPORT



Report No: 2017026797
DATE 30/09/2025



ODOMETER



Automatic.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFWBX7KMJU974099



CONDITION REPORT



Report No: 2017026797
DATE 30/09/2025



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFWBX7KMJU974099




CONDITION REPORT




Report No:
2017026797
DATE
30/09/2025




ENGINE 1

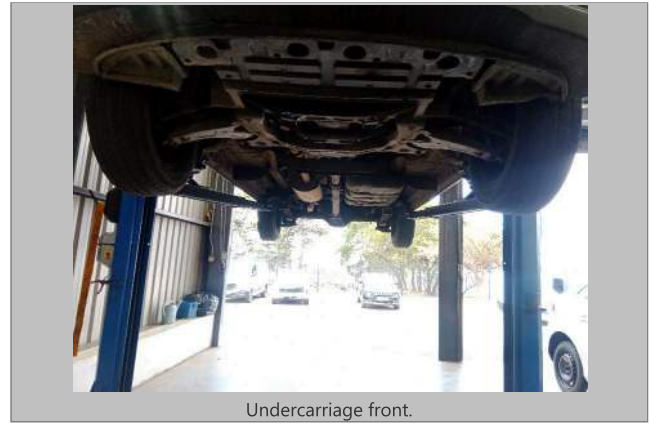


Undercarriage front.

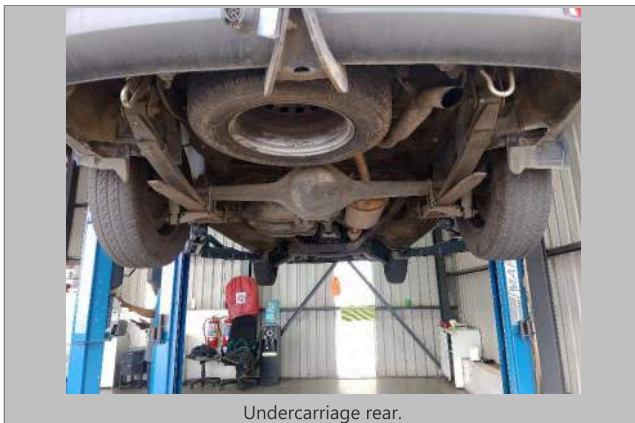

Undercarriage rear.

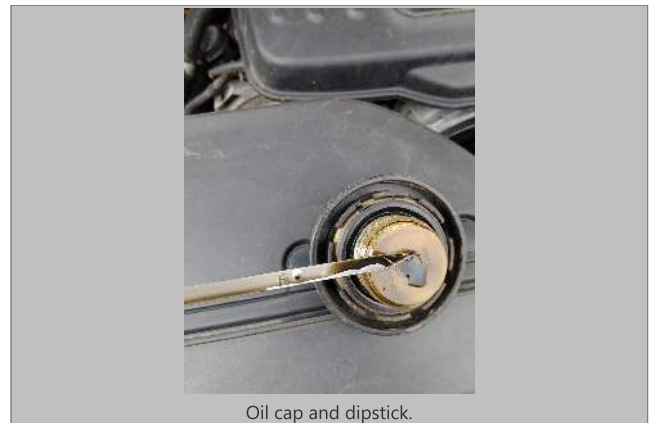

Oil cap and dipstick.

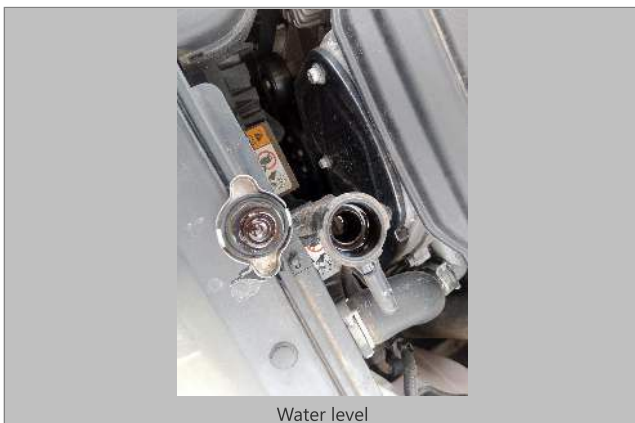

Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFWBX7KMJU974099



CONDITION REPORT



Report No:
2017026797
DATE
30/09/2025



Front Bumper



Front Fender Left



Rear Fender Left



Door Rear Left



Boot Lid / Hatch door



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFWBX7KMJU974099