



CONDITION REPORT



Report No:
2017298425
DATE
14/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/09/2026		M57 Pretoria Road - 1619
Inspection Date	14/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	MC45BBGP
Model	H-100	Register Number	
VIN	KMFZBX7BLRU132595	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/12/2026
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	93,976 KM	Fuel	DIESEL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLRU132595



CONDITION REPORT



Report No:

2017298425

DATE


14/09/2026

Damage

Repair Way

Bonnet Paintwork • Chipmarks
 Door Front Right Paintwork • Scratched
 Load Body Paintwork • Scratched
 Windscreen Cracked
 Tyre Front Right Excessive Wear & Tear

Repair
 Repair
 Repair
 Replace
 Replace

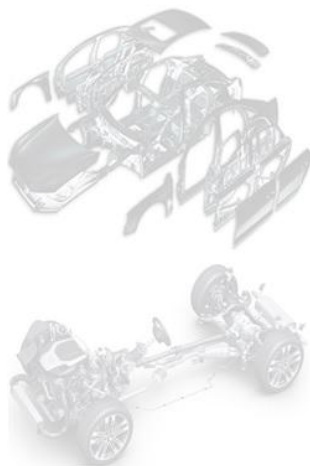

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.9	3.1	-	
Rear	1.6	1.3	-	
Emergency / Parking	1.8	2.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/70R15	104/102S	Nexen	CP321	V	0000	0 mm
Front Right	195/70R15	104/102S	Nexen	CP321	V	0524	0 mm
Rear Left	195/70R15	104/102S	Nexen	CP321	V	0524	6 mm
Rear Right	195/70R15	104/102S	Nexen	321	V	0524	3 mm
Spare	195/70R15	104/102R	Royal black	Commerical	V	0000	9 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLRU132595

**CONDITION REPORT**

Report No:

2017298425

DATE

14/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Bottom of engine is fully covered.

Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMFZBX7BLRU132595



CONDITION REPORT



Report No:
2017298425
DATE
14/09/2026

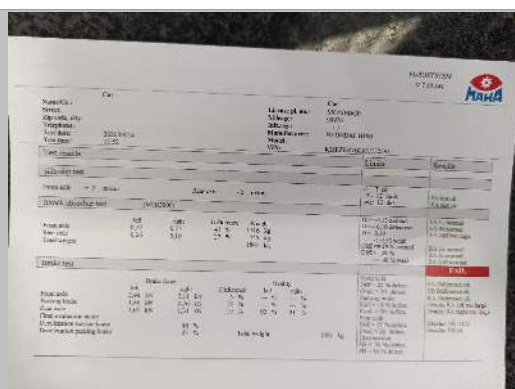

Shock and brake report



Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLRU132595



CONDITION REPORT



Report No:
2017298425
DATE
14/09/2026



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLRU132595



CONDITION REPORT



Report No:
2017298425
DATE
14/09/2026



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLRU132595



CONDITION REPORT



Report No:

2017298425

DATE

14/09/2026



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR



Coolant reservoir

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLRU132595



CONDITION REPORT



Report No:
2017298425
DATE
14/09/2026



Oil cap and dipstick



Load Body



Load Body



Windscreen



Windscreen



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLRU132595



CONDITION REPORT



Report No:
2017298425
DATE
14/09/2026



Tyre Front Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLRU132595