



CONDITION REPORT



Report No:

2017304825

DATE

29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	
Requested Date	29/09/2026		
Inspection Date	29/09/2026		

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	HYUNDAI	Registration Number	JX10KKGP
Model	TUCSON R2.0 ELITE DSL AT [2016-2018]	Register Number	
VIN	KMHJ381AMHU369887	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	SILVER	Power / Displacement	
Year Model	2017	Paint Finish	M - METALLIC
Km Reading	151,224 KM	Fuel	DIESEL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJ381AMHU369887



CONDITION REPORT



Report No:

2017304825

DATE

29/09/2026

Damage

Repair Way

Seat Front Right Damaged	Repair
Hood Lining Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Door Front Right Damaged	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Right Dented	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Airbag light on	Repair
Body exterior	Impact damage at right front door of vehicle



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.1	4.2	-	
Rear	1.9	1.7	-	
Emergency / Parking	1.7	0.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/55R18	98H	Kumho	Crugen	V	0323	3 mm
Front Right	225/55R18	98H	Kumho	Crugen	V	4716	3 mm
Rear Left	225/55R18	98H	Kumho	Crugen	V	1322	3 mm
Rear Right	225/55R18	98H	Kumho	Crugen	V	1322	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJ381AMHU369887



CONDITION REPORT



Report No:
2017304825
DATE
29/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ACTIVE	B1651:00	CRASH RECORDED IN DRIVER SIDE AIRBAG REPLACE SRSCM	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJ381AMHU369887



CONDITION REPORT



Report No:
2017304825
DATE
29/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE FRONT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJ381AMHU369887



CONDITION REPORT



Report No:
2017304825
DATE
29/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



Automatic



INTERIOR (FRONT DRIVER DOOR)



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJ381AMHU369887




CONDITION REPORT



Report No:
2017304825
DATE
29/09/2026



RF TYRE TREAD

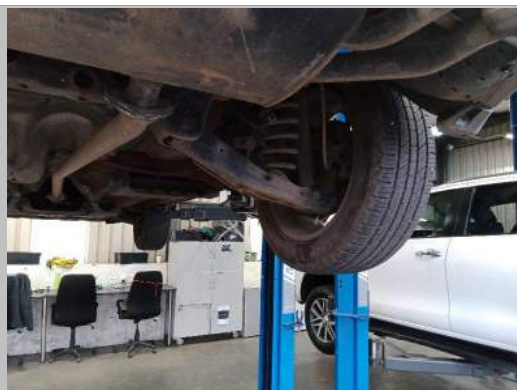

RR TYRE TREAD



Expansion bottle



Oil cap and dipstick



No spare wheel



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJ381AMHU369887



CONDITION REPORT



Report No:
2017304825
DATE
29/09/2026



ENGINE 1




ENGINE 2



VIN PLATE OR STICKER



LICENSE DISC

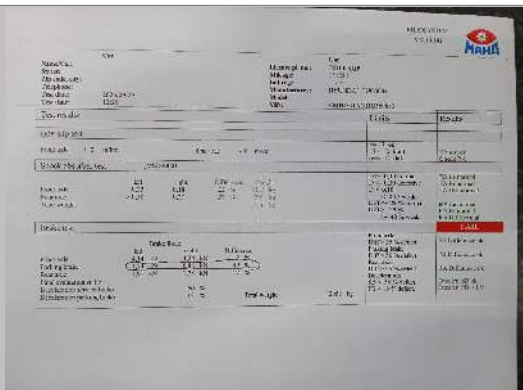

SHOCK AND BRAKE REPORT



DIAGNOSTIC REPORT PAGE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMHJ381AMHU369887



CONDITION REPORT



Report No:
2017304825
DATE
29/09/2026

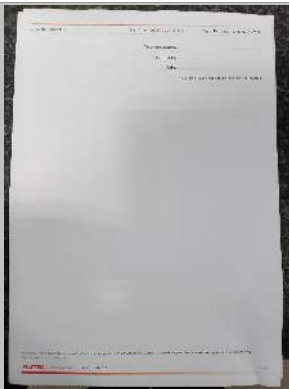


DIAGNOSTIC REPORT PAGE 2



Seat Front Right



Hood Lining

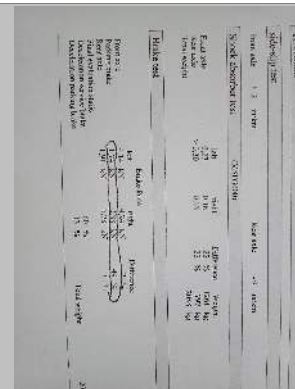

Parking Brake Performance



Water level



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJ381AMHU369887



CONDITION REPORT



Report No:
2017304825
DATE
29/09/2026



Sill Panel Right



Front Fender Right



Front Bumper



Bonnet



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJ381AMHU369887