



CONDITION REPORT



Report No:
2017302457
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	NONE
Model	TUCSON 2.0 115KW PREMIUM AT [2022-2025]	Register Number	
VIN	KMHJB81DMPU184703	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2026
Color	BLUE	Power / Displacement	
Year Model	2022	Paint Finish	TWO COAT UNI
Km Reading	98,934 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMHJB81DMPU184703



CONDITION REPORT



Report No:
2017302457
DATE
23/09/2026

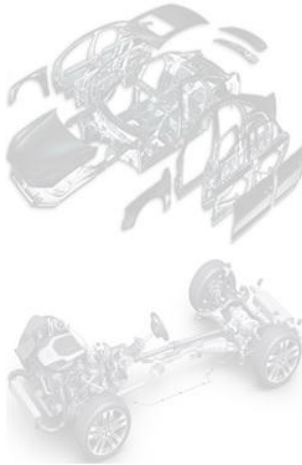

Damage	Repair Way
Engine Oil Sweat	Repair
Center Console / Cubbyhole + Lid Defective	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Defective	Repair
Windscreen Chipped	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.6	3.44	-	
Rear	1.85	1.78	-	
Emergency / Parking	1.98	1.76	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/65 R17	108V	Nexen	Nfera	V	0925	5 mm
Front Right	235/65 R17	108V	Nexen	Nfera	V	1525	5 mm
Rear Left	235/65 R17	108V	Nexen	Nfera	V	0925	5 mm
Rear Right	235/65 R17	108V	Nexen	Nfera	V	0925	6 mm
Spare	235/65 R17	104H	Nexen	Roadian	V	2922	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJB81DMPU184703



CONDITION REPORT



Report No:
2017302457
DATE
23/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AB(AIRBAG)	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Interior: Vehicle interior dirty and panels scratched.

Body • Exterior: Minor dents and scratches on body panels.

Undercarriage: Bottom of engine and gearbox fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJB81DMPU184703



CONDITION REPORT



Report No:
2017302457
DATE
23/09/2026

Vehicle Information				Inspection Details			
Make/Model	Year	Color	Engine	Inspected by	Inspection Date	Inspection Time	Inspection Location
Taxi	2017	Black	1.8L	DEKRA	2026-09-23	14:15	DEKRA
Brake and Shock Absorber Report				Inspection Results			
Front Left	Front Right	Rear Left	Rear Right	Brake Pads	Brake Discs	Shock Absorbers	Struts
Good	Good	Good	Good	Good	Good	Good	Good

Brake and shock absorber report

Vehicle Information				Inspection Details			
Make/Model	Year	Color	Engine	Inspected by	Inspection Date	Inspection Time	Inspection Location
Taxi	2017	Black	1.8L	DEKRA	2026-09-23	14:15	DEKRA
Diagnostic Report Page 1				Inspection Results			
Front Left	Front Right	Rear Left	Rear Right	Brake Pads	Brake Discs	Shock Absorbers	Struts
Good	Good	Good	Good	Good	Good	Good	Good


Diagnostic report page 1

Vehicle Information				Inspection Details			
Make/Model	Year	Color	Engine	Inspected by	Inspection Date	Inspection Time	Inspection Location
Taxi	2017	Black	1.8L	DEKRA	2026-09-23	14:15	DEKRA
Diagnostic Report Page 2				Inspection Results			
Front Left	Front Right	Rear Left	Rear Right	Brake Pads	Brake Discs	Shock Absorbers	Struts
Good	Good	Good	Good	Good	Good	Good	Good


Diagnostic report page 2



FRONT RIGHT CORNER

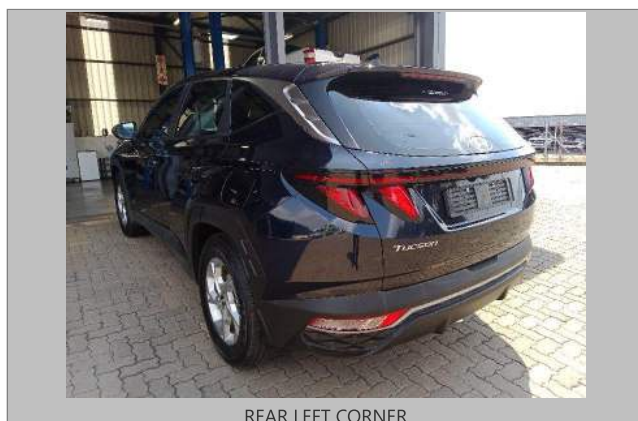

REAR LEFT CORNER

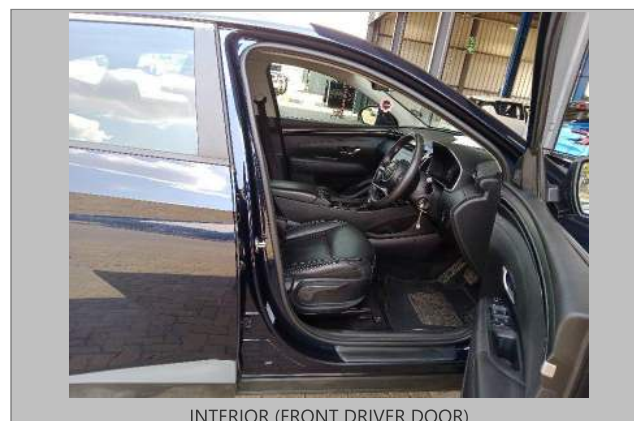

INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJB81DMPU184703



CONDITION REPORT



Report No:

2017302457

DATE

23/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJB81DMPU184703



CONDITION REPORT




Report No:
2017302457
DATE
23/09/2026




90 DEGREE LEFT




LF TYRE TREAD

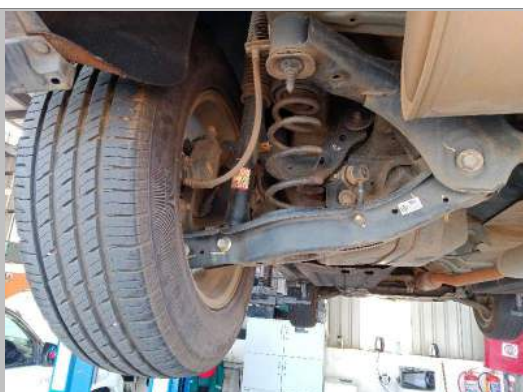

LR TYRE TREAD

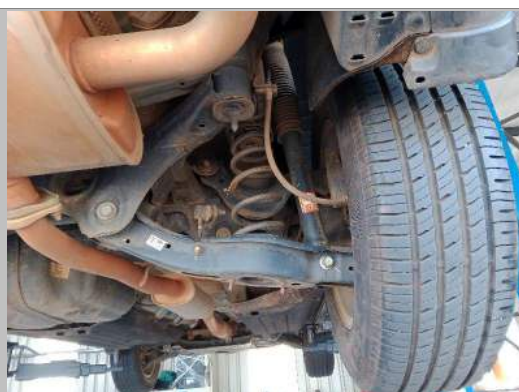

RR TYRE TREAD

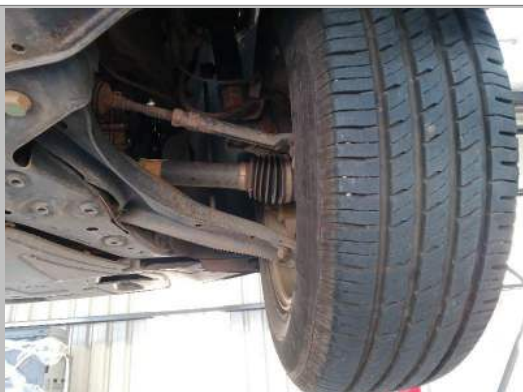

RF TYRE TREAD



Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJB81DMPU184703



CONDITION REPORT



Report No:
2017302457
DATE
23/09/2026




LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

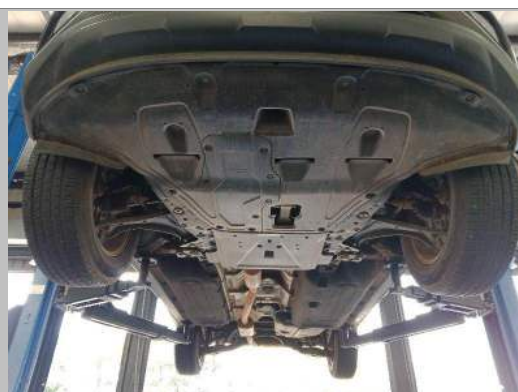

Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJB81DMPU184703




CONDITION REPORT



Report No:
2017302457
DATE
23/09/2026



Center Console / Cubbyhole + Lid

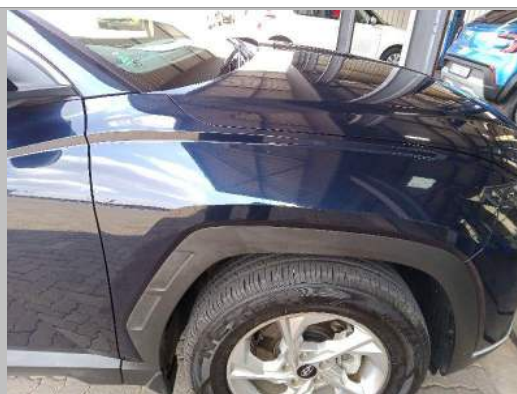

Front Fender Right



Door Front Right



Door Front Right



Door Rear Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: KMHJB81DMPU184703



CONDITION REPORT



Report No:
2017302457
DATE
23/09/2026

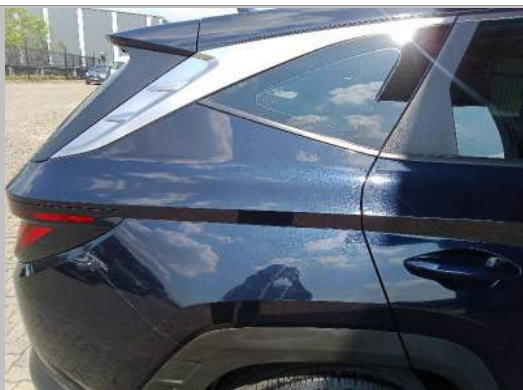

Rear Fender Right



Rear Fender Right



Rear bumper



Door Rear Left



Door Rear Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJB81DMPU184703



CONDITION REPORT



Report No:
2017302457
DATE
23/09/2026



Door Front Left



Bonnet



Bonnet



Windscreen



Water level



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJB81DMPU184703



CONDITION REPORT



Report No:
2017302457
DATE
23/09/2026



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHJB81DMPU184703