



CONDITION REPORT



Report No:
2017306415
DATE
02/10/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	02/10/2026		M57 Pretoria Road - 1619
Inspection Date	02/10/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	KIA	Registration Number	KL29MGGP
Model	PICANTO	Register Number	
VIN	KNAB2511LNT880633	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	131,198 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LNT880633



CONDITION REPORT



Report No:

2017306415

DATE

02/10/2026

Damage

Repair Way

Engine Oil Leak	Repair
Side Mirror Left Paintwork • Flaking	Repair
Side Mirror Right Paintwork • Flaking	Repair
Front Bumper Damaged	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Right Damaged	Repair
Roof Dented	Repair
Windscreen Chipped	Replace
Tyre Front Right Excessive Wear & Tear	Replace
Tyre Rear Right Excessive Wear & Tear	Replace
Spare Tyre Smooth	Replace
Gearbox Oil Leak	Repair
Engine Noise Excessive	Repair
Hail damage on body panels	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.4	2.21	-	
Rear	1.41	1.59	-	
Emergency / Parking	1.18	1.35	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	155/80R13	79T	Dunlop	Sport	V	1820	1 mm
Front Right	155/80R13	79T	Sumitomo	BC10	V	1820	1 mm
Rear Left	155/80R13	79T	General	Altimax	V	0816	4 mm
Rear Right	155/80R13	79T	Sailun	Polaris	V	2221	0 mm
Spare	T115/70D15	90M	Maxxis	Temporary	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: KNAB2511LNT880633



CONDITION REPORT



Report No:
2017306415
DATE
02/10/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1102:01	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE EXTERIOR, INTERIOR, ELECTRICAL, AND MECHANICAL PARTS. SIGNS OF SPRAY WORK DONE ON BODY PANELS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LNT880633



CONDITION REPORT



Report No:

2017306415

DATE

02/10/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LNT880633



CONDITION REPORT



Report No:

2017306415

DATE

02/10/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



MANUAL GEAR LEVER



LF TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LNT880633



CONDITION REPORT




Report No:

2017306415

DATE

02/10/2026

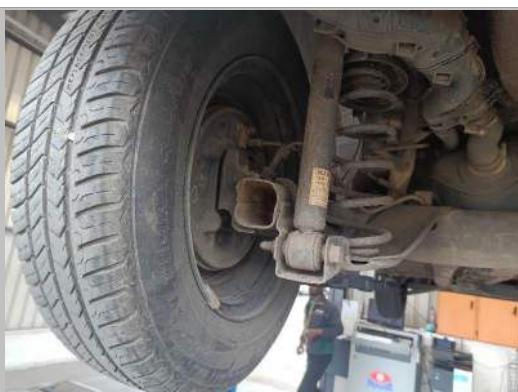

LR TYRE TREAD



RR TYRE TREAD



ENGINE 1



ENGINE 2



CHASSIS



CHASSIS 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LNT880633



CONDITION REPORT



Report No:
2017306415
DATE
02/10/2026



OIL CAP AND DIPSTICK



COOLANT RESERVOIR




SPARE WHEEL



LICENSE DISC



VIN PLATE OR STICKER

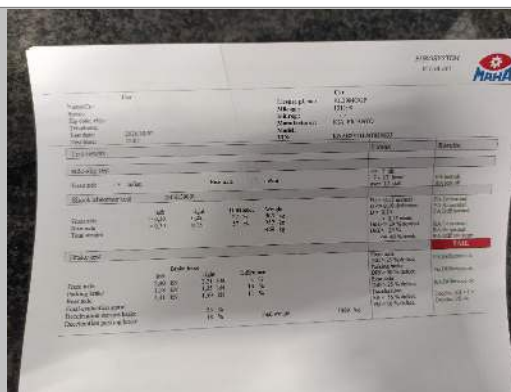

SHOCK AND BRAKE TEST REPORT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LNT880633



CONDITION REPORT




Report No:


2017306415

DATE


02/10/2026

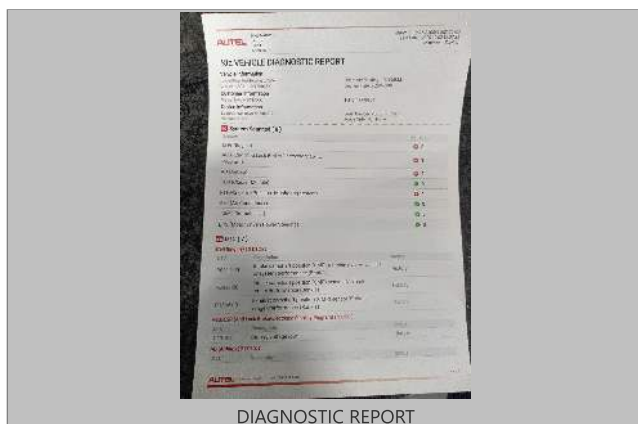

DIAGNOSTIC REPORT

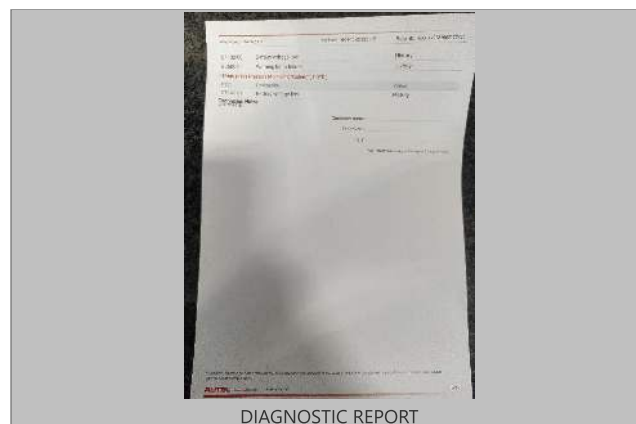

DIAGNOSTIC REPORT

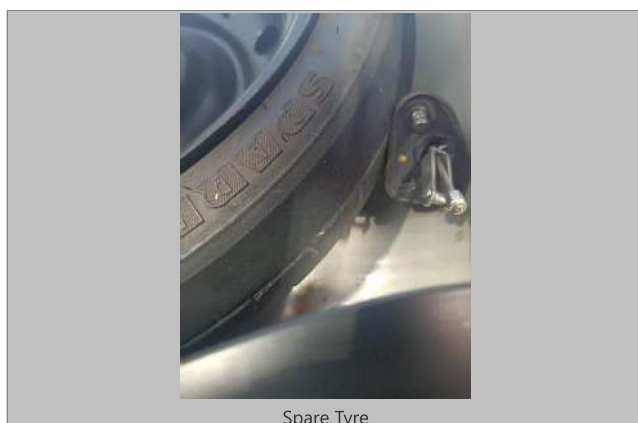


Spare Tyre



Side Mirror Right



Side Mirror Left

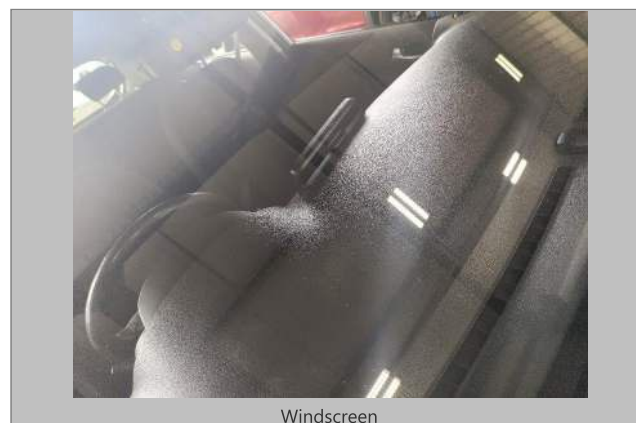

Windscreen

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LNT880633



CONDITION REPORT



Report No:
2017306415
DATE
02/10/2026



Roof



Roof



Front Bumper



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LNT880633



CONDITION REPORT



Report No:

2017306415

DATE

02/10/2026




Door Rear Left



Rear bumper




Rear bumper

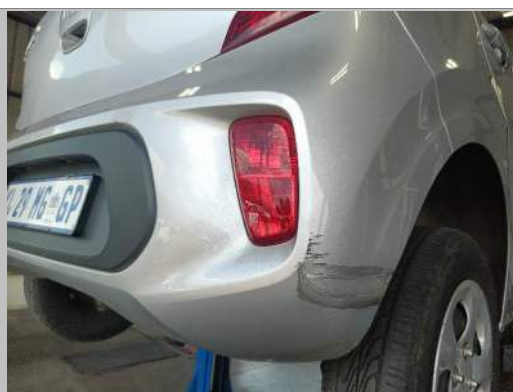

Rear bumper



Rear bumper

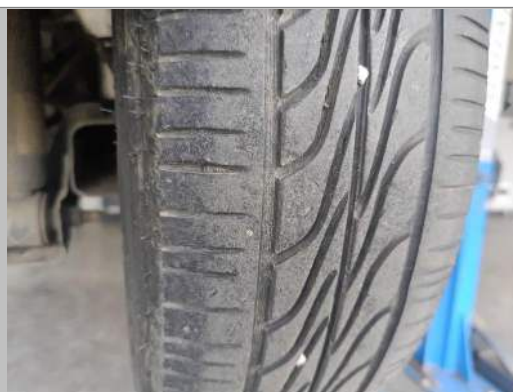

Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LNT880633



CONDITION REPORT



Report No:
2017306415
DATE
02/10/2026



Door Rear Right



Sill Panel Right



Tyre Front Right



Gearbox



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNAB2511LNT880633