



MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	26/07/2025		M57 Pretoria Road - 1619
Inspection Date	26/07/2025		Kempton Park - GT


Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	GWM	Registration Number	JB67XYGP
Model	STEED 5	Register Number	
VIN	LGWCA2176JB625680	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	171,305 KM	Fuel	PETROL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

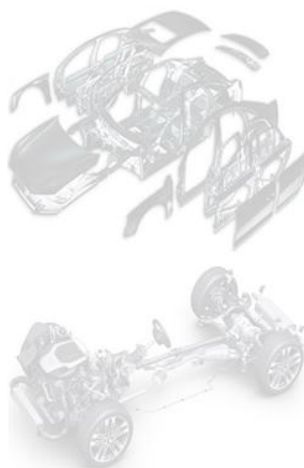

Damage	Repair Way
Engine Oil Leak	Repair
Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Tailgate Damaged	Repair
Windscreen Damaged	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace
Gearbox Oil Leak	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.6	3.46	-	
Rear	2.88	3.03	-	
Emergency / Parking	1.58	1.75	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/75R15	100S	Giti	Radial	V	1818	2 mm
Front Right	195R15C	104S	Dunlop	Sp	V	0620	0 mm
Rear Left	195R15C	104S	Dunlop	Sp	V	0620	0 mm
Rear Right	205/70R15C	104S	Continental	Worldcontact	V	3722	1 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher


This document was created electronically and is valid without signature.

General Remarks:


The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Oil cap and dipstick.

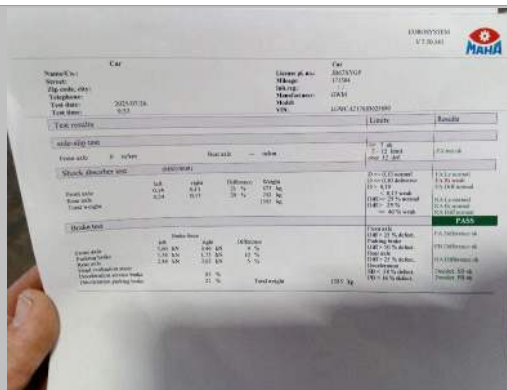

Brake test.

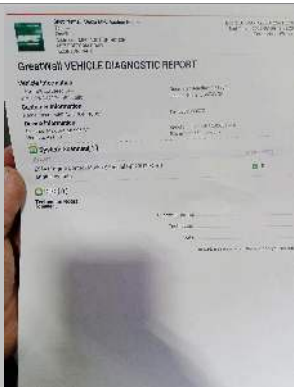

Diagnostic.



Undercarriage front.



Undercarriage rear.



Manual.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Water level



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Tailgate



Rear Fender Right



Front Fender Right



Door Front Right



Door Rear Right



Windscreen



Tyre Rear Left



Tyre Front Right



Engine



Gearbox



Seat Front Right