



CONDITION REPORT



Report No:
2017301933
DATE
22/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/09/2026		M57 Pretoria Road - 1619
Inspection Date	22/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	GWM	Registration Number	HKT162L
Model	P-SERIES 2.0TD CV DLX DSL D-CAB PU 8-SP AT [2020-2025]	Register Number	
		Date Of First Licensing	
VIN	LGWCBF198NJ631076	Last COR	
Engine Number		License Expiry Date	
Doors	4	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2023	Fuel	DIESEL
Km Reading	113,033 KM	Transmission	AUTOMATIC
Cab / Body Type	SINGLE CAB		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWCBF198NJ631076



CONDITION REPORT



Report No:

2017301933

DATE

22/09/2026

Damage

Repair Way

Front Fender Left Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Tailgate Residual Traces of Repair	Repair
Windscreen Chipped	Repair
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Rim Rear Right Scratched	Repair
Chassis Residual Traces of Repair	Repair
Triangle Missing	Replace
Deceleration parking brake defective	Repair
Front right shock absorber weak	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.44	4.31	-	
Rear	3.4	3.44	-	
Emergency / Parking	2.13	1.37	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	255/65 R17	110H	Dunlop	Grandtrek	V	1325	5 mm
Front Right	255/65 R17	110H	Dunlop	Grandtrek	V	1325	4 mm
Rear Left	255/65 R17	110H	Dunlop	Grandtrek	V	1325	5 mm
Rear Right	255/65 R17	110H	Dunlop	Grandtrek	V	1325	5 mm
Spare	245/70 R17	110T	Chaoyang	SU318	V	0000	7 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWCBF198NJ631076



CONDITION REPORT



Report No:
2017301933
DATE
22/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	A/T(AUTOMATIC TRANSMISSION)	U016487	LOST COMMUNICATION WITH A/C	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Electrical Components and Instruments: Interior fan blower blocked.
Body • Exterior: Tailgate handle faulty. Poor residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWCBF198NJ631076



CONDITION REPORT



Report No:
2017301933
DATE
22/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWCBF198NJ631076



CONDITION REPORT



Report No:
2017301933
DATE
22/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Automatic Transmission



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWCBF198NJ631076



CONDITION REPORT



Report No:
2017301933
DATE
22/09/2026



RR TYRE TREAD



RF TYRE TREAD



Spare Wheel



Front chassis



Rear chassis



Spare Wheel Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWCBF198NJ631076



CONDITION REPORT



Report No:
2017301933
DATE
22/09/2026



Oil cap and dipstick




ENGINE 1



VIN PLATE OR STICKER



LICENSE DISC

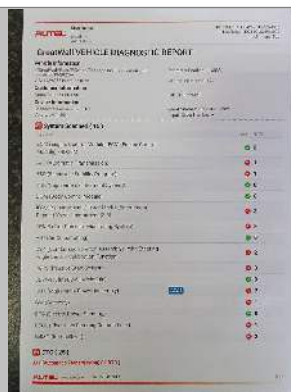

DIAGNOSTIC REPORT PAGE 1



DIAGNOSTIC REPORT PAGE 2

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za


VIN: LGWCBF198NJ631076



CONDITION REPORT



Report No:
2017301933
DATE
22/09/2026

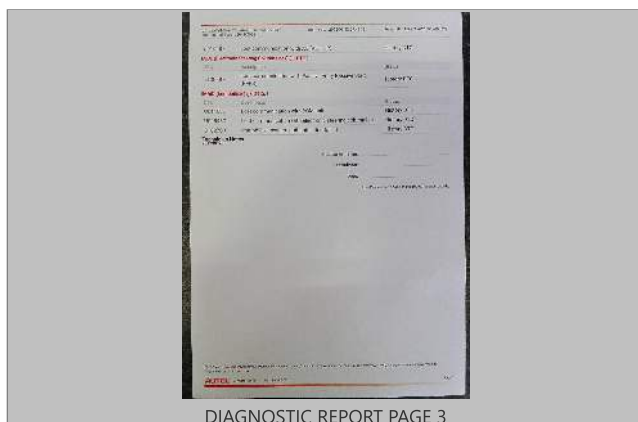


DIAGNOSTIC REPORT PAGE 3

[illegible]


Brake and shock absorber repor



Tailgate

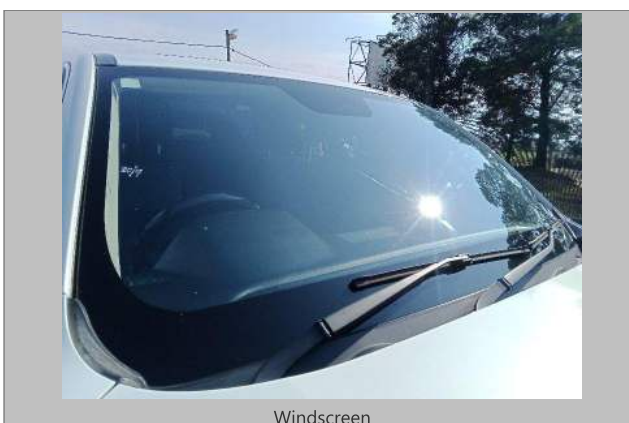

Windscreen

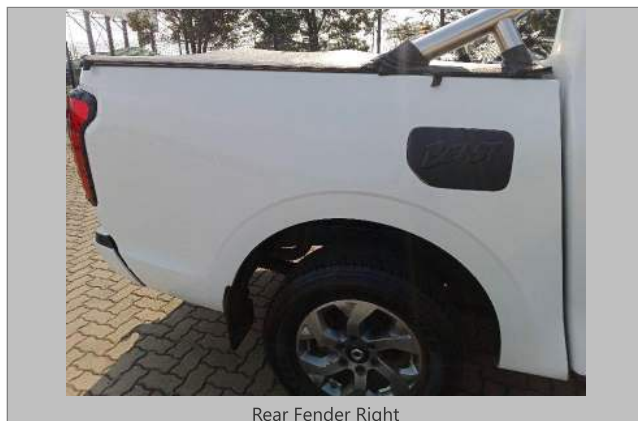

Rear Fender Right



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWCBF198NJ631076



CONDITION REPORT



Report No:
2017301933
DATE
22/09/2026



Rim Front Right



Rim Front Left



Rim Rear Right



Chassis



Rear Fender Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWCBF198NJ631076



CONDITION REPORT



Report No:
2017301933
DATE
22/09/2026



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWCBF198NJ631076