



CONDITION REPORT



Report No:
2017305344
DATE
30/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/09/2026		M57 Pretoria Road - 1619
Inspection Date	30/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HAVAL	Registration Number	HL74LDGP
Model	H2	Register Number	
VIN	LGWEE4A40JH902335	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	93,730 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A40JH902335



CONDITION REPORT



Report No:

2017305344


DATE

30/09/2026

Damage

Repair Way

Water level Insufficient	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Tyre Front Left Smooth	Replace
No license disc	Replace
Signs of over heating	Repair

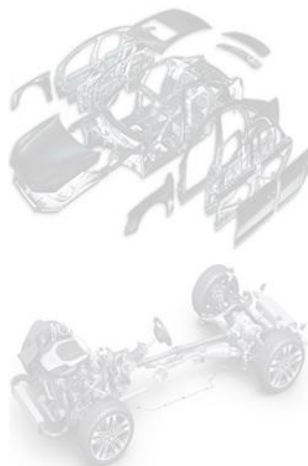

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.3	2.9	-	
Rear	2.4	2.4	-	
Emergency / Parking	1.7	2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/55R18	104H	Royal black	Royal Sport	V	4221	0 mm
Front Right	235/55R18	104H	Royal black	Royal sport	V	4321	1 mm
Rear Left	235/55R18	104H	Royal black	Royal sport	V	4221	3 mm
Rear Right	235/55R18	104H	Royal black	Royal sport	V	4221	3 mm
Spare	T155/85R18	115M	Chao yang	Temporary	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A40JH902335



CONDITION REPORT



Report No:
2017305344
DATE
30/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	HISTORY DTC	U000700	CAN BUS VOLTAGE TOO LOW	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A40JH902335



CONDITION REPORT



Report No:
2017305344
DATE
30/09/2026

Vehicle Data		Engine Data	
Make/Model	Renault	Engine No.	481211437
Year	2014	Engine Type	1.6L 16V
Registration	20040070	Transmission	Manual (5G)
Test Date	24-09	Test Mileage	101944 km
Test Results		Test Results	
Accelerate test		Brake test	
From idle - 0 - 100 km/h	12.1 s	From 100 km/h - 0 - 100 km/h	3.8 s
Shock absorber test		Steering test	
Left	Right	Left	Right
0.00	0.00	0.00	0.00
0.00	0.00	0.00	0.00
Brake test		Steering test	
From 100 km/h - 0 - 100 km/h	3.8 s	From 100 km/h - 0 - 100 km/h	3.8 s
From 100 km/h - 0 - 100 km/h	3.8 s	From 100 km/h - 0 - 100 km/h	3.8 s

Shock and brake report

Vehicle Data		Engine Data	
Make/Model	Renault	Engine No.	481211437
Year	2014	Engine Type	1.6L 16V
Registration	20040070	Transmission	Manual (5G)
Test Date	24-09	Test Mileage	101944 km
Test Results		Test Results	
Accelerate test		Brake test	
From idle - 0 - 100 km/h	12.1 s	From 100 km/h - 0 - 100 km/h	3.8 s
Shock absorber test		Steering test	
Left	Right	Left	Right
0.00	0.00	0.00	0.00
0.00	0.00	0.00	0.00
Brake test		Steering test	
From 100 km/h - 0 - 100 km/h	3.8 s	From 100 km/h - 0 - 100 km/h	3.8 s
From 100 km/h - 0 - 100 km/h	3.8 s	From 100 km/h - 0 - 100 km/h	3.8 s

Diagnostic report

Vehicle Data		Engine Data	
Make/Model	Renault	Engine No.	481211437
Year	2014	Engine Type	1.6L 16V
Registration	20040070	Transmission	Manual (5G)
Test Date	24-09	Test Mileage	101944 km
Test Results		Test Results	
Accelerate test		Brake test	
From idle - 0 - 100 km/h	12.1 s	From 100 km/h - 0 - 100 km/h	3.8 s
Shock absorber test		Steering test	
Left	Right	Left	Right
0.00	0.00	0.00	0.00
0.00	0.00	0.00	0.00
Brake test		Steering test	
From 100 km/h - 0 - 100 km/h	3.8 s	From 100 km/h - 0 - 100 km/h	3.8 s
From 100 km/h - 0 - 100 km/h	3.8 s	From 100 km/h - 0 - 100 km/h	3.8 s


Diagnostic report

Vehicle Data		Engine Data	
Make/Model	Renault	Engine No.	481211437
Year	2014	Engine Type	1.6L 16V
Registration	20040070	Transmission	Manual (5G)
Test Date	24-09	Test Mileage	101944 km
Test Results		Test Results	
Accelerate test		Brake test	
From idle - 0 - 100 km/h	12.1 s	From 100 km/h - 0 - 100 km/h	3.8 s
Shock absorber test		Steering test	
Left	Right	Left	Right
0.00	0.00	0.00	0.00
0.00	0.00	0.00	0.00
Brake test		Steering test	
From 100 km/h - 0 - 100 km/h	3.8 s	From 100 km/h - 0 - 100 km/h	3.8 s
From 100 km/h - 0 - 100 km/h	3.8 s	From 100 km/h - 0 - 100 km/h	3.8 s

Diagnostic report



FRONT RIGHT CORNER

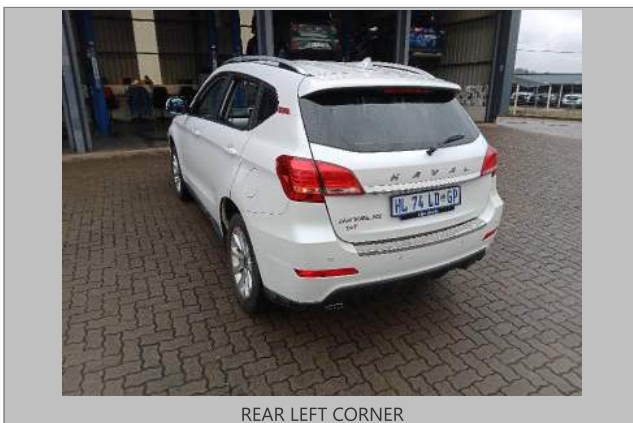

REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A40JH902335



CONDITION REPORT



Report No:
2017305344
DATE
30/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A40JH902335



CONDITION REPORT



Report No:
2017305344
DATE
30/09/2026



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A40JH902335



CONDITION REPORT



Report No:
2017305344
DATE
30/09/2026



Spare wheel



No license disc



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A40JH902335



CONDITION REPORT



Report No:
2017305344
DATE
30/09/2026



Coolant bottle



Oil cap and dipstick



Signs of over heating



Water level



Rear Fender Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A40JH902335



CONDITION REPORT



Report No:

2017305344

DATE

30/09/2026




Front Fender Right



Front Bumper



Front Bumper

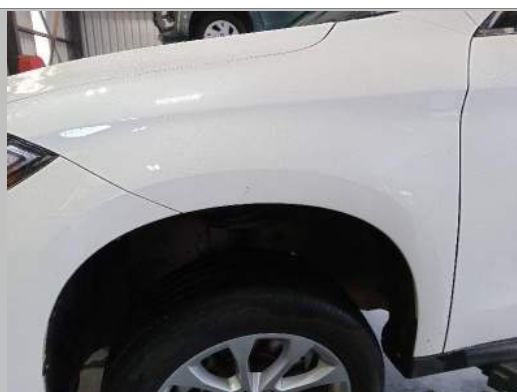

Front Fender Left



Door Rear Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A40JH902335



CONDITION REPORT



Report No:
2017305344
DATE
30/09/2026



Rear bumper



Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A40JH902335