



CONDITION REPORT

Report No: 2016843958

DATE  
15/04/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/04/2025		M57 Pretoria Road - 1619
Inspection Date	15/04/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HAVAL	Registration Number	JYF050MP
Model	H2 1.5 CITY [2017-2020]	Register Number	
VIN	LGWEE4A40KH914356	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2024
Color	WHITE	Power / Displacement	
Year Model	2019	Paint Finish	TWO COAT UNI
Km Reading	99,744 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Battery clamps Corrosion	Repair
Fog Light Front Right Damaged	Replace
Headlight Left Damaged	Replace
Side Mirror Right Damaged	Replace
Front Bumper Damaged	Repair
Grill Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: LGWEE4A40KH914356



## CONDITION REPORT

Report No: 2016843958

DATE  
15/04/2025

### Brakes

#### Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
Front	2.89	3.08	-	
Rear	2.31	2.42	-	
Emergency / Parking	2.01	1.96	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/55R18	100V	Goodyear	Efficient	V	2321	2 mm
Front Right	235/55R18	100V	Goodyear	Efficient	V	2321	2 mm
Rear Left	235/55R18	100V	Goodyear	Efficient	V	2321	3 mm
Rear Right	235/55R18	100V	Goodyear	Efficient	V	2321	2 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	SRS	B103414	CRASH OUTPUT OF CONTROLLER SHORT TO GND	

### Inspection Conditions

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 20 DTC'S AT TIME OF TESTING SEE DTC REPORT.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: LGWEE4A40KH914356




## CONDITION REPORT


Report No: 2016843958

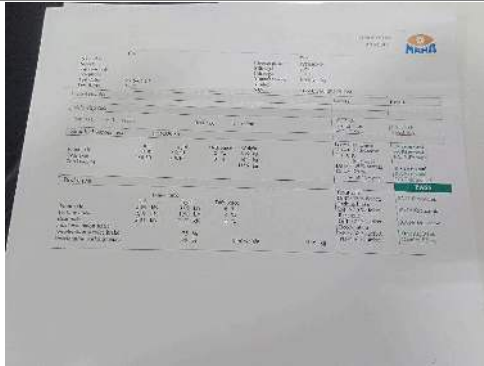DATE  
15/04/2025

Brake test

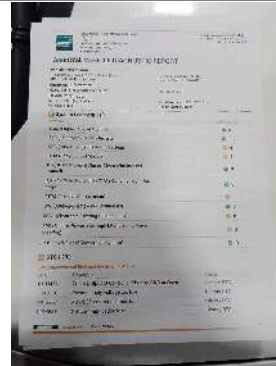

Diagnostics

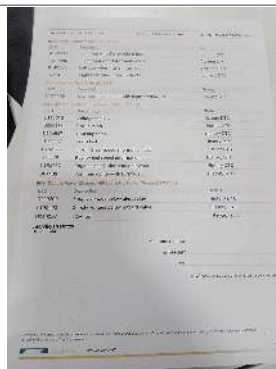

Diagnostics



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: LGWEE4A40KH914356



## CONDITION REPORT

Report No: 2016843958

DATE  
15/04/2025

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: LGWEE4A40KH914356





## CONDITION REPORT

Report No: 2016843958

DATE  
15/04/2025

90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

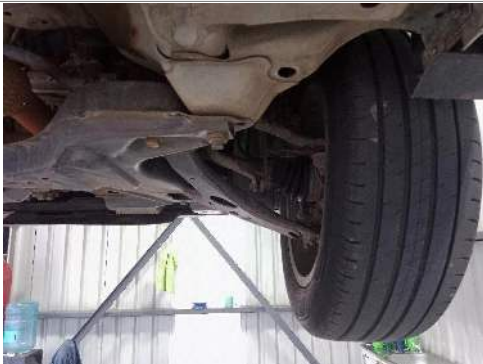

RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: LGWEE4A40KH914356



## CONDITION REPORT

Report No: 2016843958

DATE  
15/04/2025

VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: LGWEE4A40KH914356





## CONDITION REPORT

Report No: 2016843958

DATE  
15/04/2025

Battery clamps



Front Bumper



Front Bumper



Grill



Front Fender Right



Door Rear Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: LGWEE4A40KH914356



## CONDITION REPORT

Report No: 2016843958

DATE  
15/04/2025

Door Front Left



Rear bumper



Rear bumper



Rear Fender Right



Front Fender Left



Door Rear Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: LGWEE4A40KH914356





## CONDITION REPORT

Report No: 2016843958

DATE  
15/04/2025

Door Front Right



Headlight Left



Fog Light Front Right



Side Mirror Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: LGWEE4A40KH914356