



CONDITION REPORT



Report No:
2016917745
DATE
19/06/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	19/06/2025		M57 Pretoria Road - 1619
Inspection Date	19/06/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HAVAL	Registration Number	HT86LTGP
Model	H2	Register Number	
VIN	LGWEE4A48JH904978	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2021
Color	RED	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	175,678 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: LGWEE4A48JH904978



CONDITION REPORT



Report No:
2016917745
DATE
19/06/2025

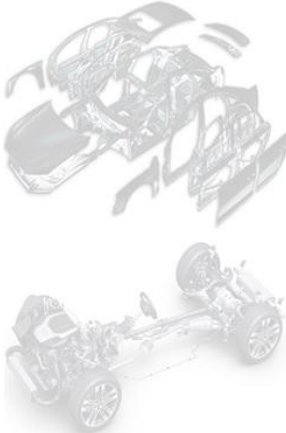	Damage	Repair Way
	Water level Insufficient Fog Light Front Left Malfunction Seat Front Right Torn / Cut Gear Lever Dust Boot Defective Front Bumper Paintwork • Scratched Bonnet Paintwork • Chipmarks Front Fender Left Paintwork • Scratched Front Fender Right Paintwork • Scratched Rear Fender Right Dented Door Front Left Paintwork • Scratched Door Front Right Paintwork • Scratched Door Rear Left Dented Door Rear Right Paintwork • Scratched Rear bumper Damaged Windscreen Chipped Shock Absorber Rear Left Leak Shock Absorber Rear Right Leak Battery loose All four tires deferred name brand	Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Repair Replace Replace Repair Repair

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.2	2.9	-	
Rear	1.8	1.8	-	
Emergency / Parking	1.9	1.9	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/55R18	104V	Desert hawk	Atr sport	V	4817	4 mm
Front Right	235/55R18	100H	Kumho	Solus	V	3920	3 mm
Rear Left	235/55R18	100H	Hankook	Optimo	V	2413	4 mm
Rear Right	235/55R18	103H	Wanli	Flash Asc28	V	5114	4 mm
Spare	T155/85R18	115M	Chao yang	Rp03	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A48JH904978



CONDITION REPORT



Report No:
2016917745
DATE
19/06/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	HISTORY DTC	U110116	UNDERVOLTAGE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: LGWEE4A48JH904978



CONDITION REPORT



Report No:
2016917745
DATE
19/06/2025

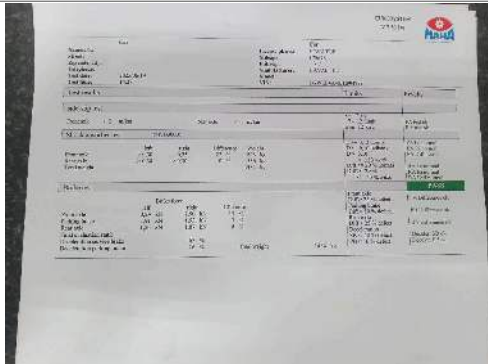

Shock and brake report



Diagnostic report



Diagnostic report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A48JH904978



CONDITION REPORT



Report No:
2016917745
DATE
19/06/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A48JH904978



CONDITION REPORT



Report No:
2016917745
DATE
19/06/2025



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A48JH904978



CONDITION REPORT



Report No:
2016917745
DATE
19/06/2025



Spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



CHASSIS



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A48JH904978



CONDITION REPORT



Report No:
2016917745
DATE
19/06/2025



Battery loose



Oil cap and dipstick



Coolant bottle



Seat Front Right



Water level



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A48JH904978



CONDITION REPORT



Report No:
2016917745
DATE
19/06/2025




Windscreen




Gear Lever Dust Boot



Fog Light Front Left

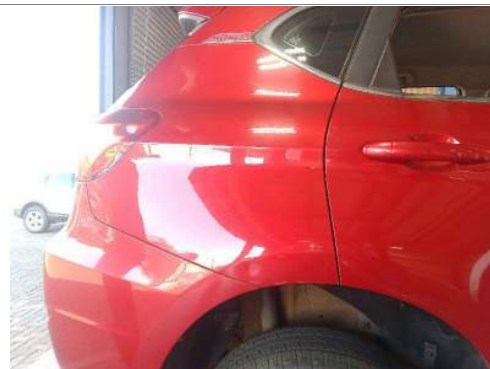

Rear Fender Right

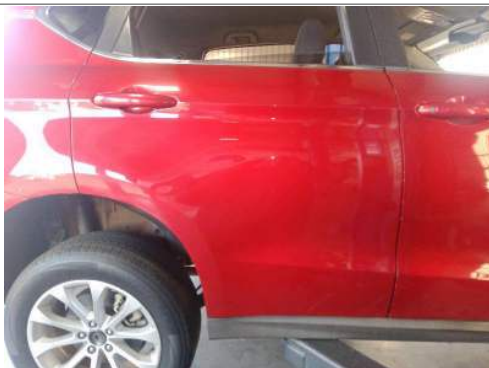

Door Rear Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A48JH904978



CONDITION REPORT



Report No:
2016917745
DATE
19/06/2025



Front Fender Right



Front Bumper



Front Bumper



Front Fender Left



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A48JH904978



CONDITION REPORT



Report No:
2016917745
DATE
19/06/2025



Rear bumper



Rear bumper



Shock Absorber Rear Right



Shock Absorber Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A48JH904978