



CONDITION REPORT



Report No:
2017302459
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HAVAL	Registration Number	LM92YFGP
Model	JOLION 1.5T CITY [2021-2024]	Register Number	
VIN	LGWEE4A50PK618272	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2026
Color	GREEN	Power / Displacement	
Year Model	2023	Paint Finish	TWO COAT METALLIC
Km Reading	80,331 KM	Fuel	PETROL
Cab / Body Type	SUV	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A50PK618272



CONDITION REPORT



Report No:

2017302459


DATE

23/09/2026

Damage

Repair Way

Battery clamps Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Door Front Left Damaged	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace

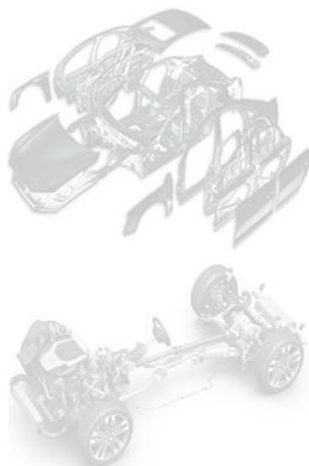

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.58	3.3	-	
Rear	2.07	2.13	-	
Emergency / Parking	0.77	0.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R17	96H	Kumho	Radial	V	4622	0 mm
Front Right	215/60R17	96H	Kumho	Radial	V	4522	0 mm
Rear Left	215/60R17	96H	Kumho	Radial	V	4622	2 mm
Rear Right	215/60R17	96H	Kumho	Radial	V	4622	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A50PK618272



CONDITION REPORT



Report No:
2017302459
DATE
23/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ESP	U016387	NAVIGATION HOST SYSTEM NODE MESSAGE LOST	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 32 DTC'S AT TIME OF TESTING SEE DTC REPORT.Body • Exterior: Minor dents and scratches and stone chips to body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A50PK618272



CONDITION REPORT




Report No:


2017302459

DATE


23/09/2026

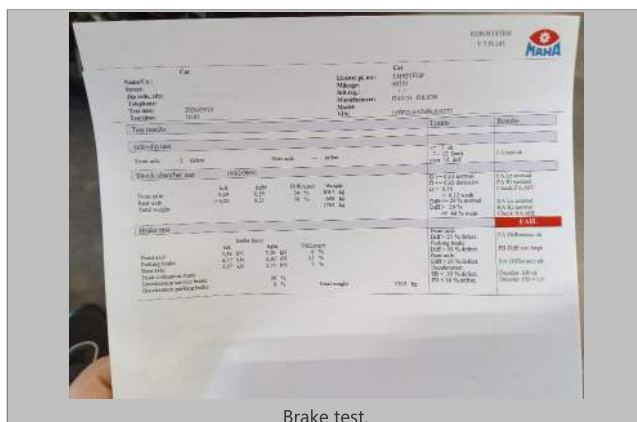


Brake test.

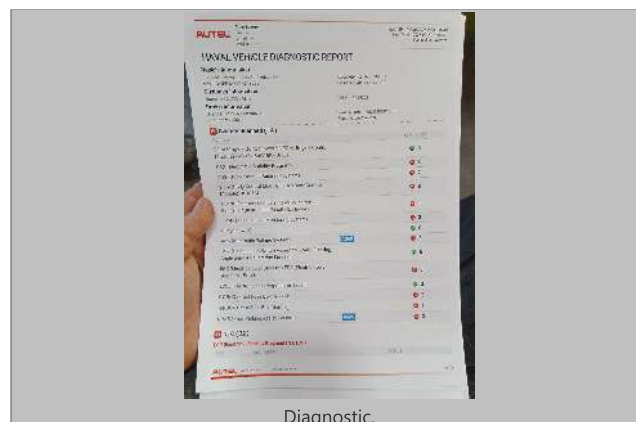

Diagnostic.

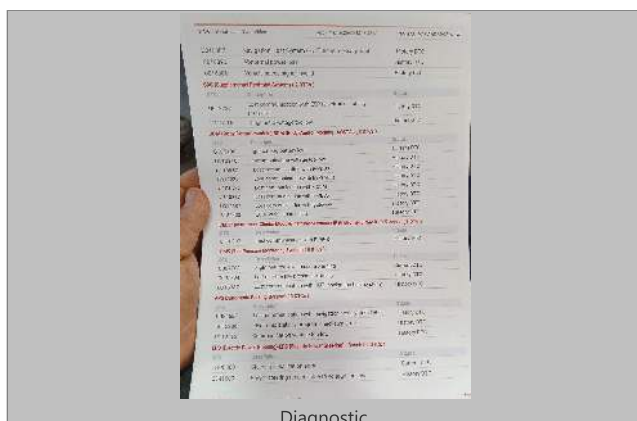

Diagnostic.

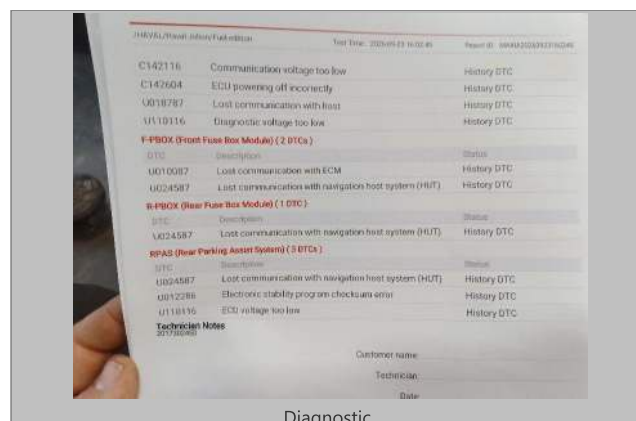

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A50PK618272



CONDITION REPORT



Report No:
2017302459
DATE
23/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A50PK618272



CONDITION REPORT




Report No:
2017302459
DATE
23/09/2026




90 DEGREE REAR



90 DEGREE LEFT

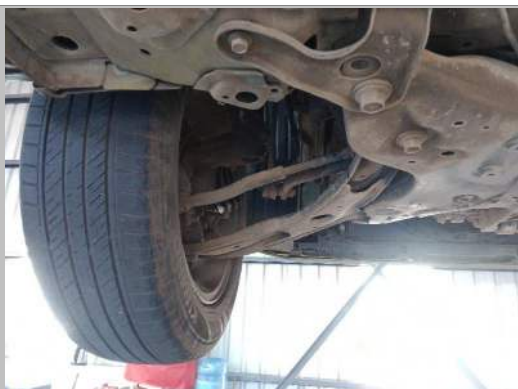

LF TYRE TREAD

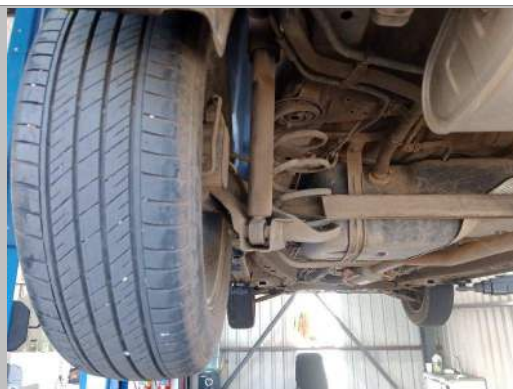

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A50PK618272



CONDITION REPORT



Report No:

2017302459

DATE

23/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A50PK618272



CONDITION REPORT



Report No:
2017302459
DATE
23/09/2026



Water level



Battery clamps




Front Bumper



Front Bumper



Bonnet

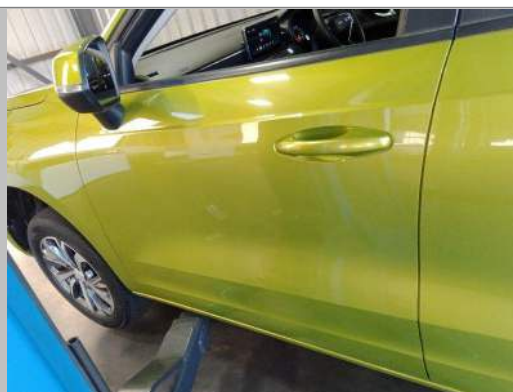

Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A50PK618272



CONDITION REPORT



Report No:
2017302459
DATE
23/09/2026



Tyre Front Right



Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWEE4A50PK618272