



CONDITION REPORT



Report No:
2017298420
DATE
14/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/09/2026		M57 Pretoria Road - 1619
Inspection Date	14/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HAVAL	Registration Number	LC22CCGP
Model	H6 2.0T GT SUPER LUXURY AWD DCT [2022-2025]	Register Number	
		Date Of First Licensing	
VIN	LGWFF6A56PH928159	Last COR	
Engine Number		License Expiry Date	30/04/2027
Doors	5	Power / Displacement	
Color	GREY	Paint Finish	M - METALLIC
Year Model	2023	Fuel	PETROL
Km Reading	86,333 KM	Transmission	AUTOMATIC
Cab / Body Type	STATION WAGON		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWFF6A56PH928159



CONDITION REPORT



Report No:

2017298420

DATE

14/09/2026

Damage

Repair Way

Front Bumper Paintwork • Chipmarks	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Paintwork • Chipmarks	Repair
Front Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Chipmarks	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Brakes	No brake test done vehicle is 4wd
Front and rear tires deferred name brand	Repair



Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/55R19	105Y	Dunlop	Sp sport	V	1022	3 mm
Front Right	235/55R19	105Y	Dunlop	Sp sport	V	1022	3 mm
Rear Left	235/55R19	105W	Bridgestone	Turanza	V	0826	4 mm
Rear Right	235/55R19	105W	Bridgestone	Turanza	V	0826	4 mm
Spare	T135/90R17	104M	Ling long	Temporary	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWFF6A56PH928159



CONDITION REPORT



Report No:
2017298420
DATE
14/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CURRENT DTC	B185100	KEY BATTERY LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: LGWFF6A56PH928159




CONDITION REPORT




Report No:
2017298420
DATE
14/09/2026

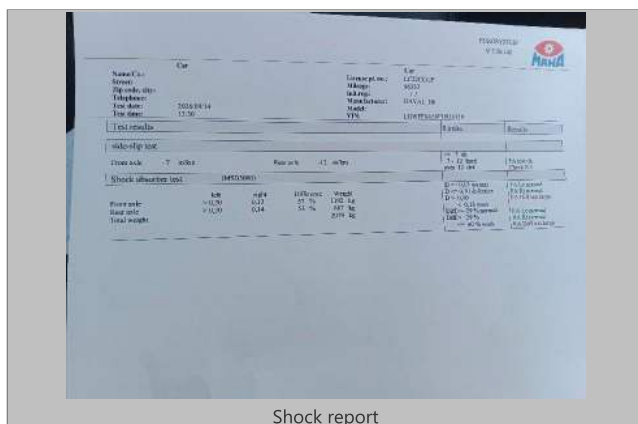


Shock report

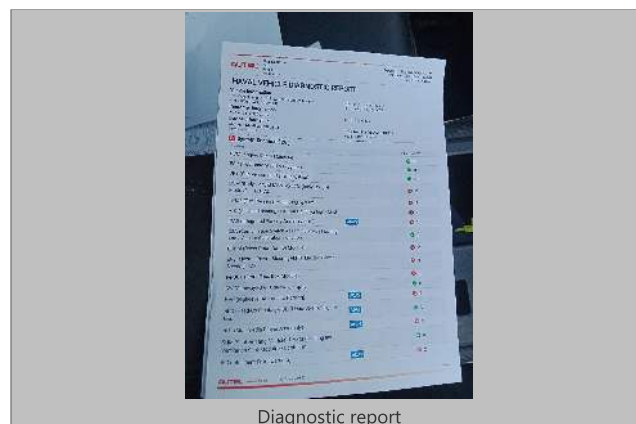


Diagnostic report

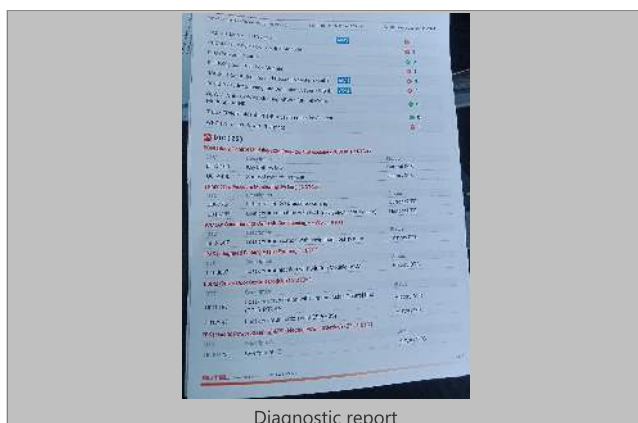


Diagnostic report

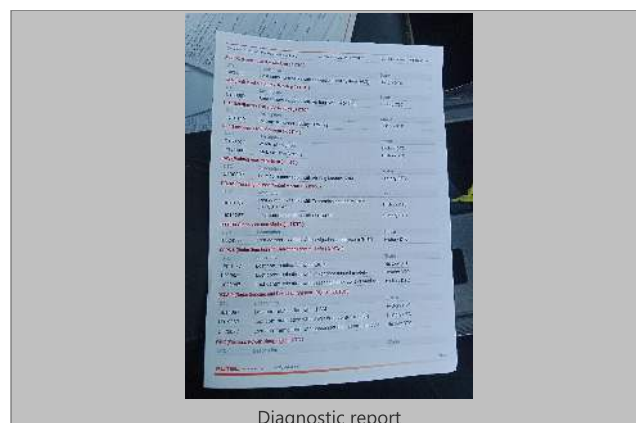

Diagnostic report

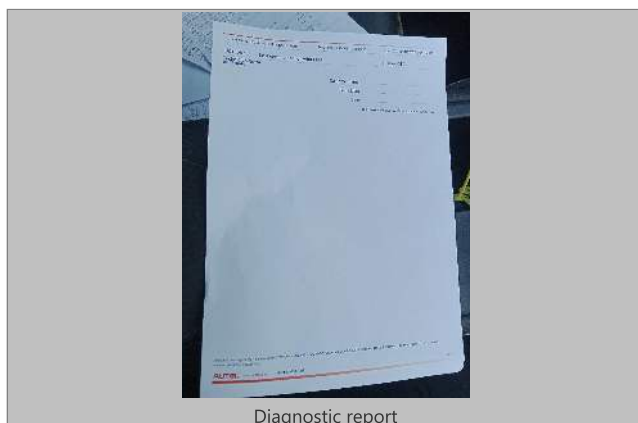

Diagnostic report

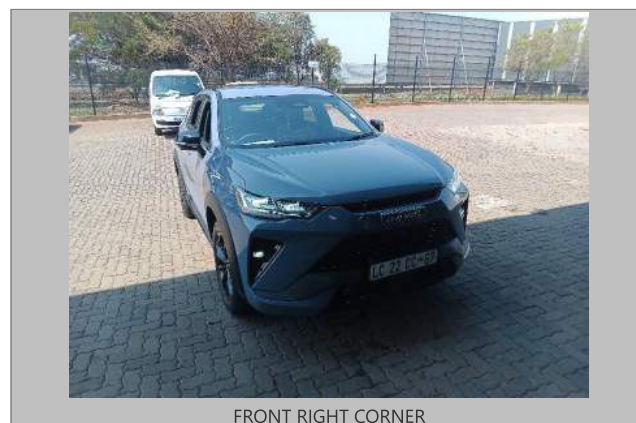

FRONT RIGHT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWFF6A56PH928159



CONDITION REPORT



Report No:

2017298420

DATE

14/09/2026



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWFF6A56PH928159



CONDITION REPORT



Report No:
2017298420
DATE
14/09/2026



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWFF6A56PH928159



CONDITION REPORT




Report No:

2017298420

DATE

14/09/2026

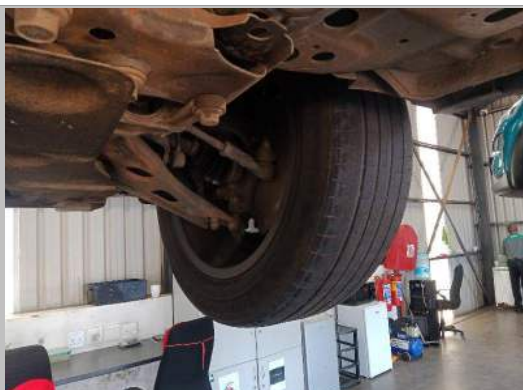


RF TYRE TREAD



Spare wheel



LICENSE DISC

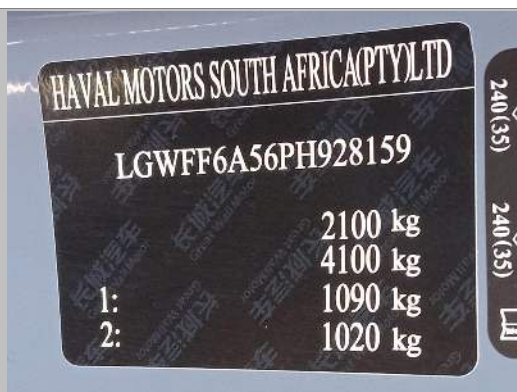

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWFF6A56PH928159



CONDITION REPORT



Report No:
2017298420
DATE
14/09/2026



CHASSIS



Expansion bottle



Oil cap and dipstick



Water level



Windscreen



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWFF6A56PH928159



CONDITION REPORT



Report No:
2017298420
DATE
14/09/2026



Front Bumper



Front Bumper



Front Fender Left



Door Front Left



Door Rear Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWFF6A56PH928159



CONDITION REPORT



Report No:
2017298420
DATE
14/09/2026




Rear bumper



Door Rear Right



Door Front Right

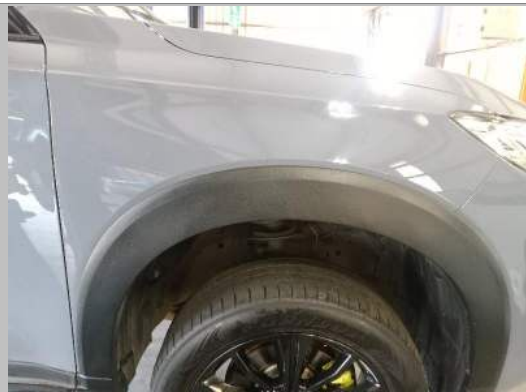

Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LGWFF6A56PH928159