



CONDITION REPORT



Report No:
2017298716
DATE
14/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/09/2026		M57 Pretoria Road - 1619
Inspection Date	14/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	JAC	Registration Number	KF56LVGP
Model	T8	Register Number	
VIN	LJ11PABD6MC020193	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	28/02/2027
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	132,219 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABD6MC020193



CONDITION REPORT



Report No:

2017298716

DATE

14/09/2026

Damage

Repair Way

Switch Electrical Window Winder rear right Malfunction	Repair
Side Mirror Left Paintwork • Discoloured	Repair
Side Mirror Right Paintwork • Discoloured	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Tailgate Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Gearbox Oil Sweat	Repair
L/F tire deferred name brand	Repair



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.2	3.8	-	
Rear	3.4	3.0	-	
Emergency / Parking	2.1	0.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/60R18	110T	Chao yang	Su318	V	1721	3 mm
Front Right	265/60R18	110H	Dunlop	Grandtrek	V	1824	3 mm
Rear Left	265/60R18	110H	Dunlop	Grandtrek	V	2123	4 mm
Rear Right	265/60R18	110H	Dunlop	Grandtrek	V	1025	4 mm
Spare	265/60R18	110T	Chao yang	Su318	V	0921	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABD6MC020193

**CONDITION REPORT**

Report No:

2017298716

DATE

14/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABD6MC020193



CONDITION REPORT



Report No:

2017298716

DATE _____

14/09/2026

[illegible]

Shock and brake report

[illegible]

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABD6MC020193



CONDITION REPORT



Report No:
2017298716
DATE
14/09/2026



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABD6MC020193



CONDITION REPORT



Report No:

2017298716

DATE

14/09/2026




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

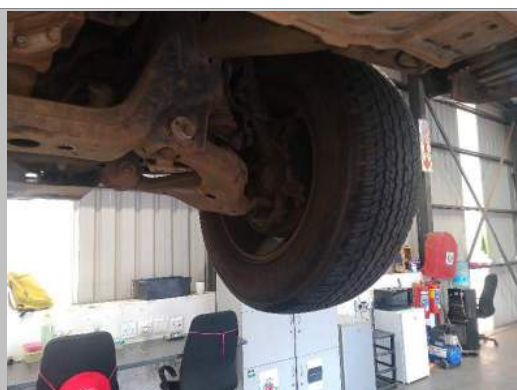

RF TYRE TREAD



Spare wheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABD6MC020193



CONDITION REPORT



Report No:

2017298716

DATE


14/09/2026

Anhui Jianghuai Automobile Group Corp., Ltd.
 VIN NO.: LJ11PABD6MC020193
 Engine Model: D19TCID7 Model: T8
 GVW: 2755 kg V: 2755 kg P/D: 100 kw
 GCM: 4720 kg D/T: 4720 kg T: 1855 kg
 GA1: 1265 kg A1: 1265 kg
 GA2: 1950 kg A2: 1950 kg

VIN PLATE OR STICKER



ENGINE 1

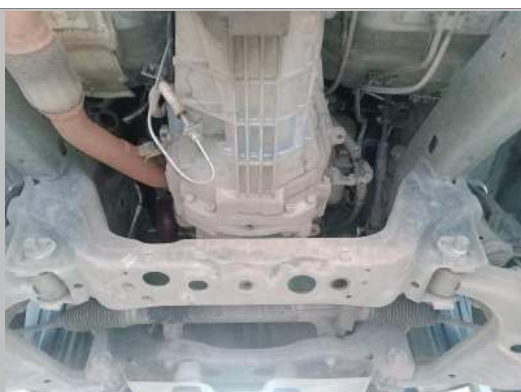

ENGINE 2



CHASSIS



Oil cap and dipstick



Coolant bottle

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABD6MC020193



CONDITION REPORT



Report No:

2017298716

DATE _____

14/09/2026

[illegible]

Parking Brake Performance



Water level



Switch Electrical Window Winder rear right



Switch Electrical Window Winder rear right



Windscreen



Side Mirror Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABD6MC020193



CONDITION REPORT



Report No:

2017298716

DATE

14/09/2026



Bonnet



Front Bumper



Side Mirror Left



Door Front Left



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABD6MC020193



CONDITION REPORT



Report No:
2017298716
DATE
14/09/2026



Tailgate



Rear bumper



Rear bumper



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABD6MC020193