



CONDITION REPORT



Report No:
2017296814
DATE
10/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/09/2026		M57 Pretoria Road - 1619
Inspection Date	10/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	JAC	Registration Number	HGY189L
Model	T9	Register Number	
VIN	LJ11PABE4RC084250	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/11/2026
Color	GREY	Power / Displacement	
Year Model		Paint Finish	PEARL EFFECT
Km Reading	56,394 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABE4RC084250



CONDITION REPORT



Report No:
2017296814
DATE
10/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Tail Light Left Damaged	Replace
Windscreen Chipped	Repair
Parking Brake Performance Insufficient	Repair
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Catalytic converter Missing	Replace
Gearbox Oil Leak	Repair
Warning light illuminated on dashboard	Repair
Front right shock absorber weak	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	5.08	5.07	-	
Rear	3.04	3.11	-	
Emergency / Parking	0	0	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/60 R18	110H	Citi	Citi4x4	V	4123	0 mm
Front Right	265/60 R18	110H	Citi	Citi4x4	V	4123	0 mm
Rear Left	265/60 R18	110H	Citi	Citi4x4	V	4223	3 mm
Rear Right	265/60 R18	110H	Citi	Citi4x4	V	4223	2 mm
Spare	265/60 R18	110H	Citi	Citi4x4	V	4223	7 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABE4RC084250



CONDITION REPORT



Report No:
2017296814
DATE
10/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	EMS(ENGINE SYSTEM)- EMS(ENGINE MANAGEMENT SYSTEM)	P229964	ACCELERATOR PEDAL AND BRAKE PEDAL SIGNAL IMPLAUSIB	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches on body panels.
Undercarriage: Bottom of engine covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za





VIN: LJ11PABE4RC084250



CONDITION REPORT



Report No:
2017296814
DATE
10/09/2026

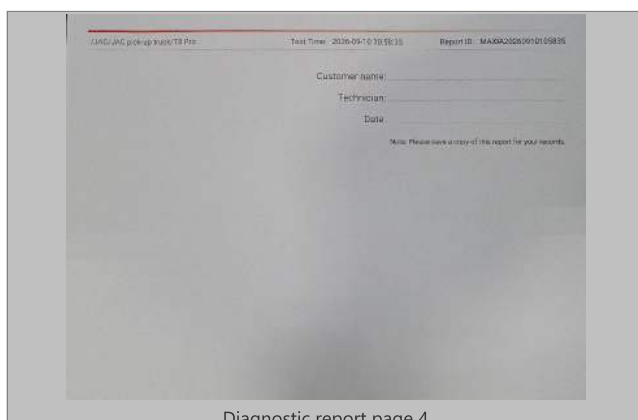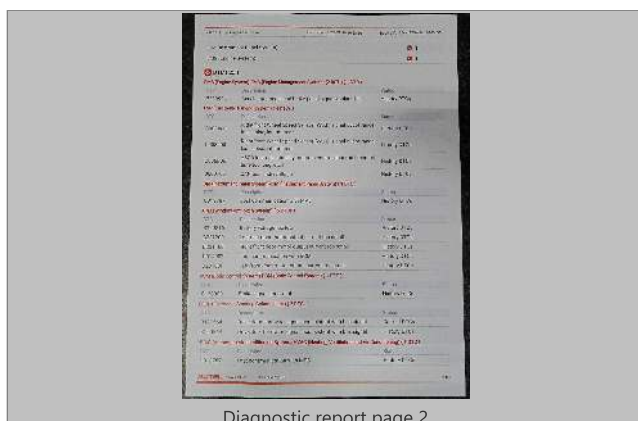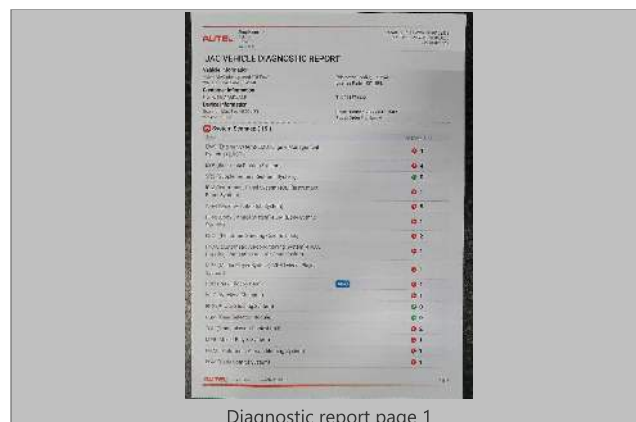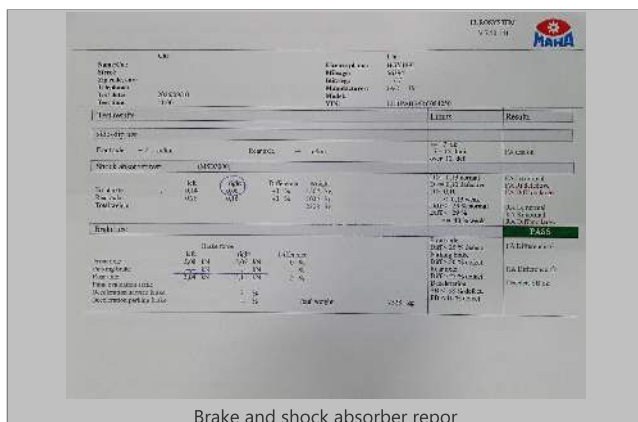

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABE4RC084250



CONDITION REPORT



Report No:

2017296814

DATE

10/09/2026



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABE4RC084250



CONDITION REPORT



Report No:
2017296814
DATE
10/09/2026



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABE4RC084250



CONDITION REPORT



Report No:
2017296814
DATE
10/09/2026



RF TYRE TREAD



Spare Wheel



Spare Wheel Accessories



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABE4RC084250



CONDITION REPORT



Report No:
2017296814
DATE
10/09/2026



Rear chassis




Front chassis



Oil cap and dipstick



Tail Light Left

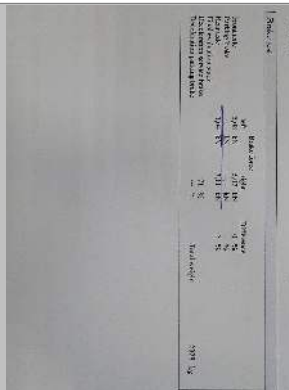

Parking Brake Performance



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABE4RC084250



CONDITION REPORT



Report No:
2017296814
DATE
10/09/2026



Water level



Tyre Front Right



Tyre Front Left



Gearbox



Engine



Catalytic converter

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABE4RC084250



CONDITION REPORT



Report No:
2017296814
DATE
10/09/2026



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LJ11PABE4RC084250