



CONDITION REPORT



Report No:

2017303177

DATE

25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	CHERY	Registration Number	ML74GPGP
Model	TIGGO 4 PRO 1.5 LIT [2023-ON]	Register Number	
VIN	LVVDB11B8SC119715	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	GREY	Power / Displacement	
Year Model	2025	Paint Finish	M - METALLIC
Km Reading	25,466 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB11B8SC119715



CONDITION REPORT



Report No:

2017303177

DATE


25/09/2026

Damage

Repair Way

Side Mirror Right Damaged
 Door Front Left Paintwork • Scratched
 Windscreen Chipped
 Body exterior
 Body exterior
 Warning lights illuminated

Repair
 Repair
 Replace
 Signs of spray work done on body panels
 Minor dents scratches stone chips on body panels
 Repair

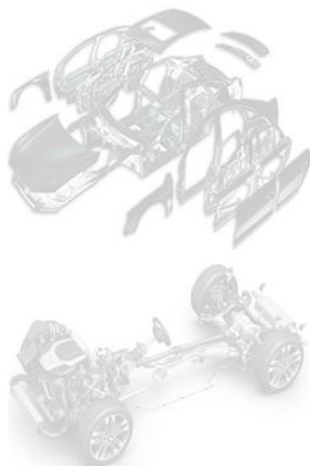

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.2	3.2	-	
Rear	2.7	2.8	-	
Emergency / Parking	2.9	2.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/65R16	98H	Chaoyang	SU	V	0125	6 mm
Front Right	215/65R16	98H	Chaoyang	SU	V	0125	6 mm
Rear Left	215/65R16	98H	Chaoyang	SU	V	0125	6 mm
Rear Right	215/65R16	98H	Chaoyang	SU	V	0125	6 mm
Spare	125/80R17	99M	Ling long	Temporary	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB11B8SC119715



CONDITION REPORT



Report No:
2017303177
DATE
25/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	TIRE PRESSURE	B103813	PLEASE REFER TO VEHICLE SERVICE MANUAL	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB11B8SC119715



CONDITION REPORT




Report No:
2017303177
DATE
25/09/2026




Manual transmission




Tyre pressure warning lights i

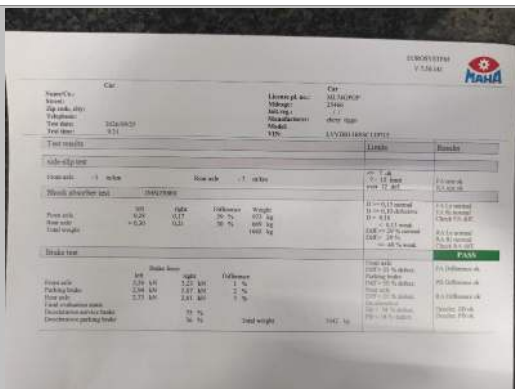

Shock and brake report

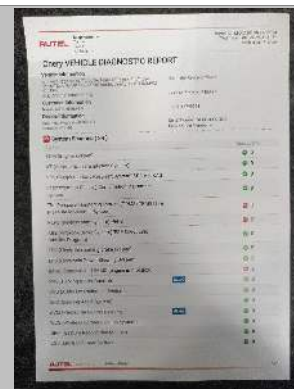

Diagnostics report

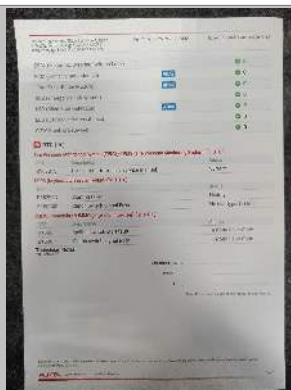

Diagnostics report



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB11B8SC119715



CONDITION REPORT




Report No:


2017303177

DATE

25/09/2026

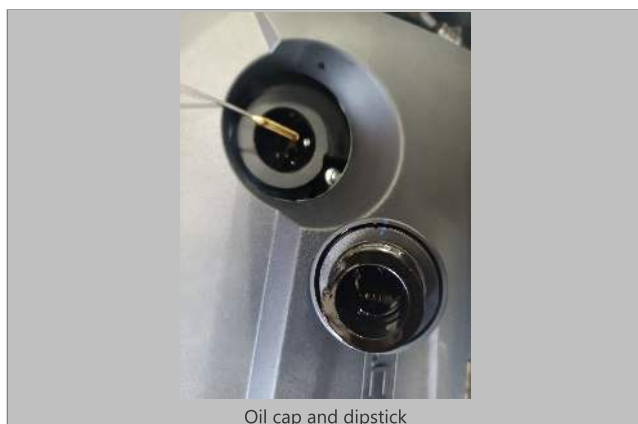

Oil cap and dipstick

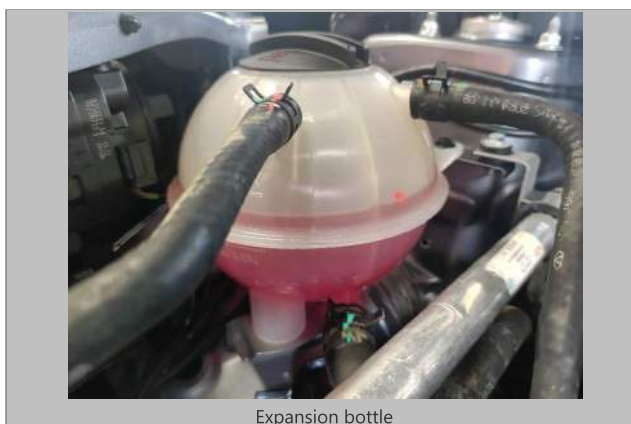

Expansion bottle



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB11B8SC119715



CONDITION REPORT



Report No:
2017303177
DATE
25/09/2026



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB11B8SC119715




CONDITION REPORT



Report No:
2017303177
DATE
25/09/2026



LR TYRE TREAD

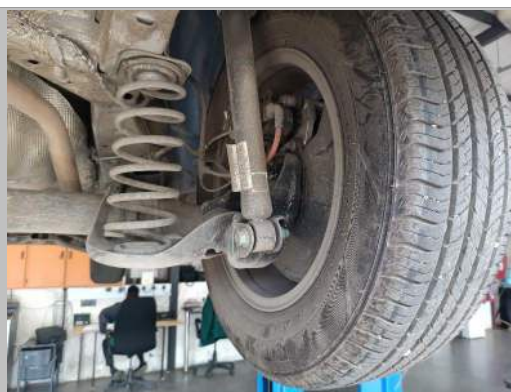

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB11B8SC119715



CONDITION REPORT



Report No:
2017303177
DATE
25/09/2026



ENGINE 1



CHASSIS



ENGINE 2



Door Front Left



Windscreen



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB11B8SC119715



CONDITION REPORT



Report No:
2017303177
DATE
25/09/2026



Side Mirror Right



Side Mirror Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB11B8SC119715