



CONDITION REPORT

Report No: 2016878657

DATE
15/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/05/2025		M57 Pretoria Road - 1619
Inspection Date	15/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	JAECOO	Registration Number	HFG690L
Model	J7 1.6T VORTEX 7-SP DCT [2024-ON]	Register Number	
VIN	LVVDB21B5RC019636	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2025
Color	WHITE	Power / Displacement	
Year Model	2024	Paint Finish	TWO COAT UNI
Km Reading	19,741 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Bonnet Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Chassis Damaged	Repair
Cross Member Front Left Dented	Repair
Sub Frame Dented	Repair
Belly plates Damaged	Repair
Fuel filter loose	Repair



DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5RC019636



CONDITION REPORT

Report No: 2016878657

 DATE
15/05/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.81	3.81	-	
Rear	2.57	2.57	-	
Emergency / Parking	2.68	2.77	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/55 R18	100V	Cooper	Evolution	V	0124	5 mm
Front Right	235/55 R18	100V	Cooper	Evolution	V	0124	5 mm
Rear Left	235/55 R18	100V	Cooper	Evolution	V	0124	6 mm
Rear Right	235/55 R18	100V	Cooper	Evolution	V	0124	6 mm
Spare	235/55 R18	100V	Cooper	Evolution	V	5323	7 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DHT(DEDICATED TRANSMISSION FOR HYBRID POWERTRAIN)	U042381	CAN COMMUNICATION ERROR-RECEIVED INVALID DATA LINK CONNECTOR (DLC) FROM INSTRUMENT CLUSTER (IPC)	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches on some body panels.
Undercarriage: Bottom of engine and gearbox fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Sibusiso Mokase

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: LVVDB21B5RC019636

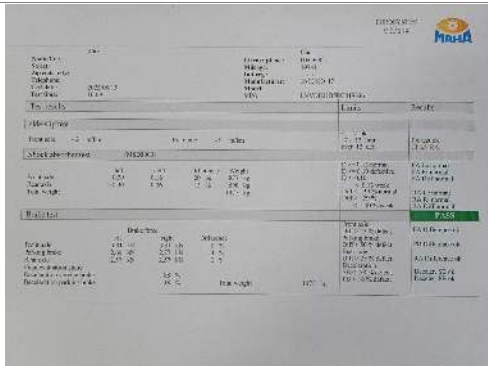


Brake and shock absorber report

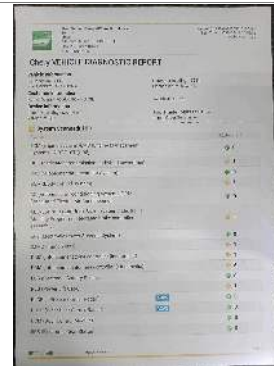

Diagnostic report page 1

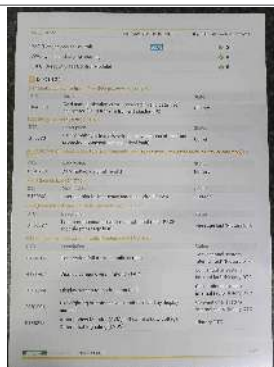

Diagnostic report page 2

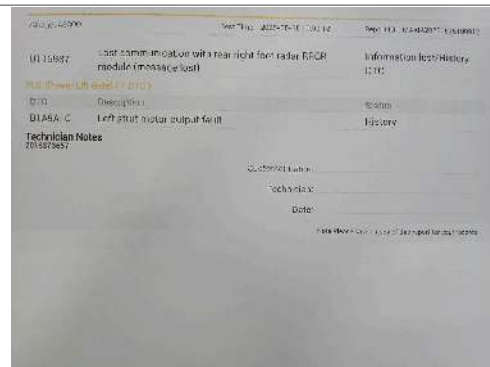

Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5RC019636



CONDITION REPORT

Report No: 2016878657

DATE
15/05/2025

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5RC019636



CONDITION REPORT

Report No: 2016878657

DATE
15/05/2025

90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5RC019636



CONDITION REPORT

Report No: 2016878657

DATE
15/05/2025

Spare wheel and Accessories



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5RC019636



CONDITION REPORT

Report No: 2016878657

DATE
15/05/2025

Oil cap and dipstick



Fuel filter



Door Front Right



Door Rear Right



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5RC019636



CONDITION REPORT

Report No: 2016878657

DATE
15/05/2025

Door Front Left



Bonnet



Water level



Belly plates



Sub Frame



Cross Member Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5RC019636

**CONDITION REPORT**

Report No: 2016878657

DATE
15/05/2025

Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5RC019636