



CONDITION REPORT



Report No:
2017302453
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	CHERY	Registration Number	MF51CHGP
Model	OMEDA	Register Number	
VIN	LVVDB21B5SD053835	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	BLACK	Power / Displacement	
Year Model	2023	Paint Finish	M - METALLIC
Km Reading	46,236 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: LVVDB21B5SD053835



CONDITION REPORT



Report No:
2017302453
DATE
25/09/2026

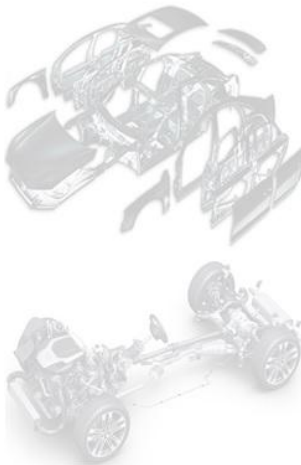

Damage	Repair Way
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Windscreen Chipped	Replace
Warning lights illuminated	Repair
Body exterior	Signs of spray work done on body panels

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.9	2.9	-	
Rear	2.7	2.7	-	
Emergency / Parking	1.5	0.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R17	96H	Giti	Comfort	V	4824	3 mm
Front Right	215/60R17	96H	Giti	Giti comfort	V	4824	3 mm
Rear Left	215/60R17	96H	Giti	Comfort	V	4824	5 mm
Rear Right	215/60R17	96H	Giti	Giti comfort	V	4824	5 mm
Spare	T125/80R17	99M	Ling long	Temporary	V	///////	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5SD053835



CONDITION REPORT



Report No:
2017302453
DATE
25/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	TIRE PRESSURE	B103186	RIGHT REAR WINDOW MOTOR POSITION SIGNAL ERROR	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: BOTTOM OF ENGINE IS FULLY COVERED. ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5SD053835



CONDITION REPORT



Report No:

2017302453

DATE

25/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5SD053835




CONDITION REPORT



Report No:
2017302453
DATE
25/09/2026



ODOMETER

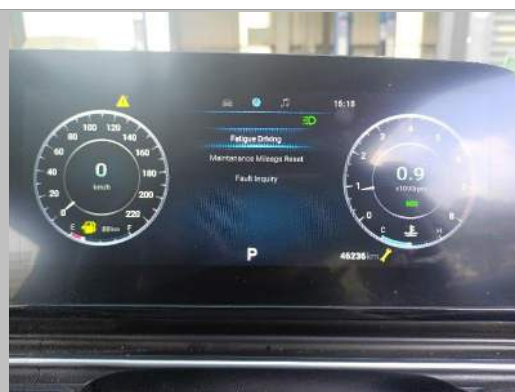

DASHBOARD (W/ ENGINE RUNNING)




Warning lights illuminated



Automatic transmission



INTERIOR (FRONT DRIVER DOOR)

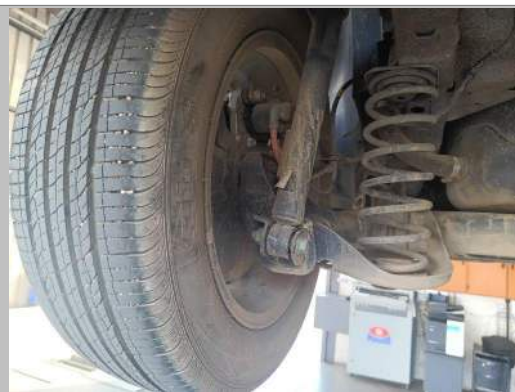

LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5SD053835



CONDITION REPORT




Report No:
2017302453
DATE
25/09/2026



RR TYRE TREAD



RF TYRE TREAD

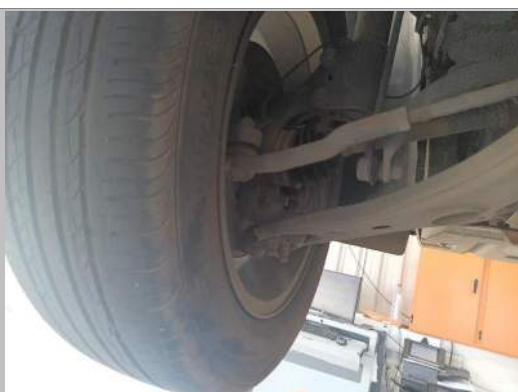

LF TYRE TREAD



Sparewheel



Expansion bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5SD053835



CONDITION REPORT



Report No:
2017302453
DATE
25/09/2026



REAR



ENGINE 1



ENGINE 2



CHASSIS



VIN PLATE OR STICKER



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: LVVDB21B5SD053835




CONDITION REPORT




Report No:
2017302453
DATE
25/09/2026

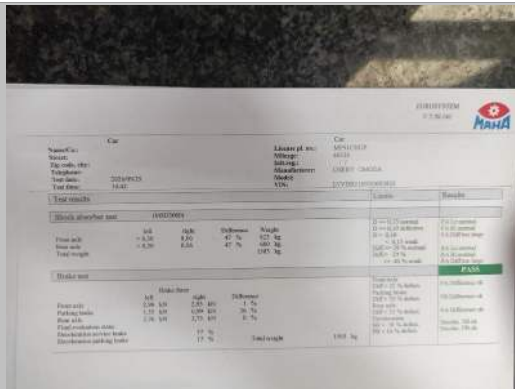

Shock and brake report

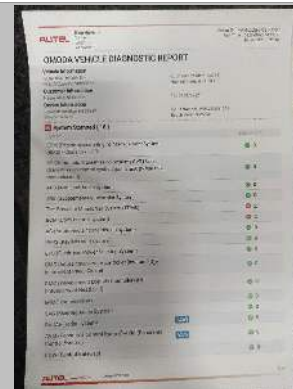


DIAGNOSTIC REPORT PAGE 1

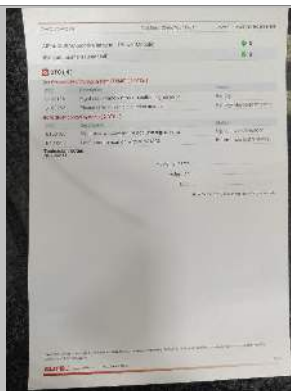

DIAGNOSTIC REPORT PAGE 2



Windscreen

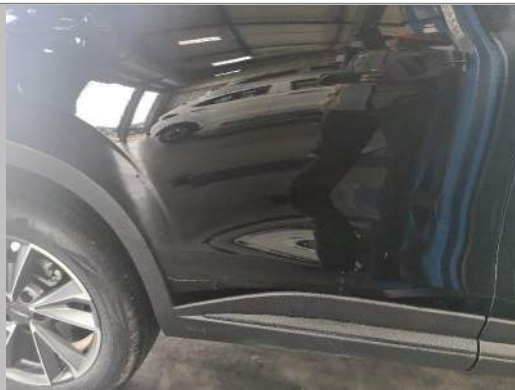

Door Rear Right



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5SD053835



CONDITION REPORT



Report No:
2017302453
DATE
25/09/2026



Front Fender Left



Front Bumper



Front Bumper



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B5SD053835