



CONDITION REPORT



Report No:
2017305134
DATE
30/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/09/2026		M57 Pretoria Road - 1619
Inspection Date	30/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	CHERY	Registration Number	LN50VYGP
Model	TIGGO 4 PRO 1.5T ELITE CVT [2021-2026]	Register Number	
VIN	LVVDB21B7PD992637	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2024
Color	WHITE	Power / Displacement	
Year Model	2024	Paint Finish	M - METALLIC
Km Reading	16,870 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B7PD992637



CONDITION REPORT




Report No:
2017305134
DATE
30/09/2026

Damage

Repair Way

Rear bumper Paintwork • Scratched

Repair

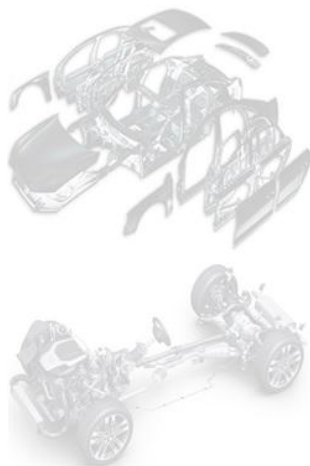

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	2.6	-	
Rear	2.7	2.8	-	
Emergency / Parking	0.5	0.4	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R17	96H	Giti	Comfort	V	2523	3 mm
Front Right	215/60R17	96H	Giti	Comfort	V	2523	5 mm
Rear Left	215/60R17	96H	Giti	Comfort	V	2523	5 mm
Rear Right	215/60R17	96H	Giti	Comfort	V	2523	6 mm
Spare	T125/80R17	99M	Westlake	Temporary	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B7PD992637



CONDITION REPORT



Report No:
2017305134
DATE
30/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	IMMOBILIZER	B152F	BATTERY VOLTAGE TOO LOW	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B7PD992637



CONDITION REPORT



Report No:

2017305134

DATE

30/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B7PD992637



CONDITION REPORT



Report No:
2017305134
DATE
30/09/2026



INTERIOR (FRONT DRIVER DOOR)



Automatic transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B7PD992637



CONDITION REPORT



Report No:
2017305134
DATE
30/09/2026



ENGINE 1



ENGINE 2



CHASSIS



REAR



Expansion bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B7PD992637



CONDITION REPORT



Report No:

Report No.
2017305134

DATE _____


30/09/2026



LF TYRE TREAD



RF TYRE TREAD

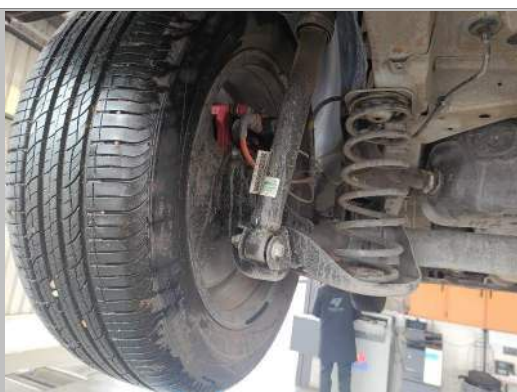


LR TYRE TREAD



RR TYRE TREAD



Sparewheel

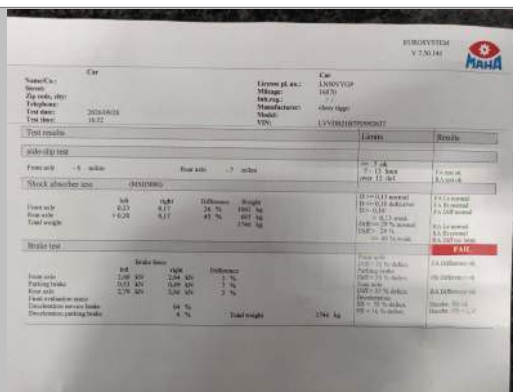

Shock and brake report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: LVVDB21B7PD992637



CONDITION REPORT




Report No:


2017305134

DATE


30/09/2026

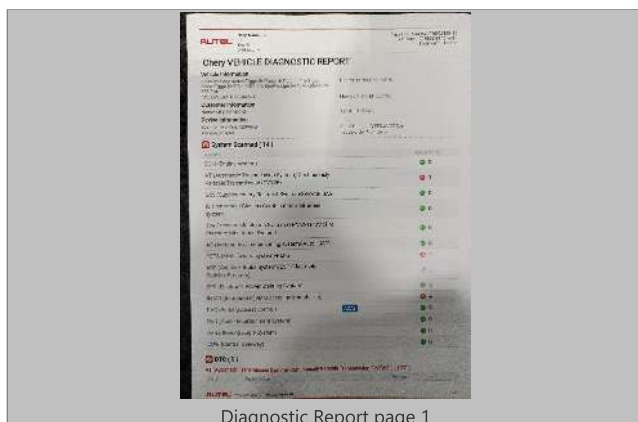

Diagnostic Report page 1

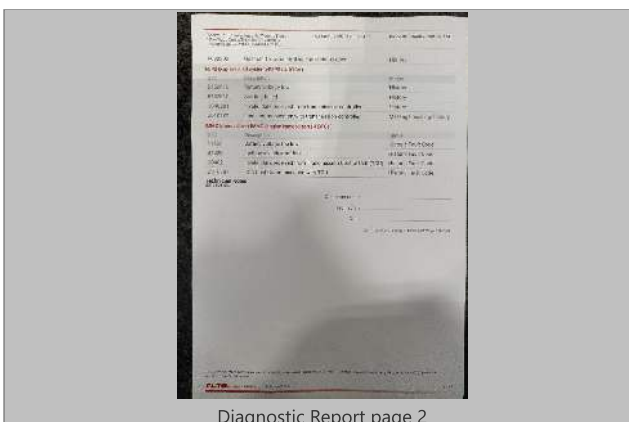

Diagnostic Report page 2

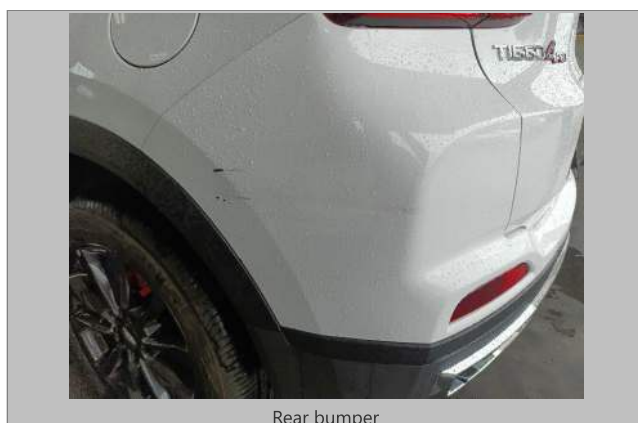

Rear bumper



Water level

DEKRA Automotive (PTY) Ltd.

97 Willem Cruywagen Ave

Klerksoord, Pretoria, 0200

Phone: 012 542 4867

www.dekraauto.co.za

VIN: LVVDB21B7PD992637