



CONDITION REPORT



Report No:
2017303402
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	SUZUKI	Registration Number	LB91DVGP
Model	ERTIGA 1.5 GA MPV [2022-2025]	Register Number	
VIN	MA3BNC22S00582791	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2023	Paint Finish	M - METALLIC
Km Reading	245,007 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MA3BNC22S00582791



CONDITION REPORT



Report No:
2017303402
DATE
25/09/2026

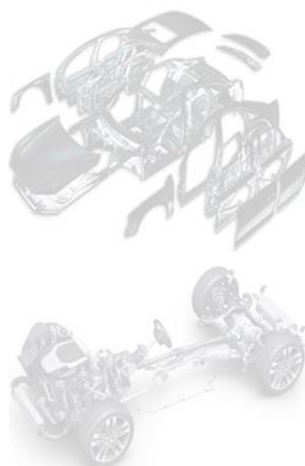

Damage

Repair Way

Center Console / Cubbyhole + Lid Damaged	Repair
Tail Light Right Damaged	Replace
Headlight Left Damaged	Replace
Seat Rear (2. Row) Torn / Cut	Repair
Gear Lever Dust Boot Torn / Cut	Replace
Front Bumper Paintwork • Scratched	Repair
Bonnet Damaged	Repair
Front Fender Left Paintwork • Scratched	Repair
Rear Fender Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Residual Traces of Repair	Repair
Tyre Front Right Smooth	Replace
Spare Tyre Excessive Wear & Tear	Replace
Rim Front Right Deformed	Repair
Main Beam Left Welded	Repair
Main Beam Right Welded	Repair
Body exterior	Signs of spray work done on body panels
Body exterior	Residual traces of poor repair on body panels

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.8	2.5	-	
Rear	1.9	1.7	-	
Emergency / Parking	0.9	0.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	92H	Radar	Dimax	V	1026	3 mm
Front Right	185/65R15	88H	Bridgestone	Ecopia	V	5122	0 mm
Rear Left	205/60R15	91V	Cachland	CH	V	1420	2 mm
Rear Right	205/60R15	91V	Cachland	CH	V	1420	3 mm
Spare	185/65R15	88H	Bridgestone	Ecopia	V	///////	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00582791



CONDITION REPORT



Report No:
2017303402
DATE
25/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1057	POWER SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00582791



CONDITION REPORT



Report No:

2017303402

DATE

25/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00582791



CONDITION REPORT



Report No:
2017303402
DATE
25/09/2026



ODOMETER




DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual transmission

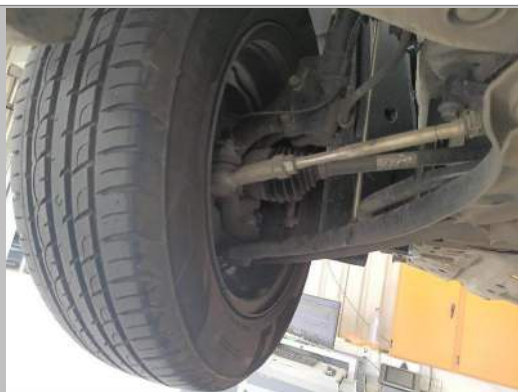

LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00582791



CONDITION REPORT



Report No:

2017303402

DATE

25/09/2026



RR TYRE TREAD



RF TYRE TREAD



Coolant reservoir



Oil cap and dipstick



Sparewheel well dent.



REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00582791



CONDITION REPORT



Report No:

Report No.
2017303402

DATE _____

25/09/2026



ENGINE 1



CHASSIS




ENGINE 2



VIN PLATE OR STICKER



LICENSE DISC

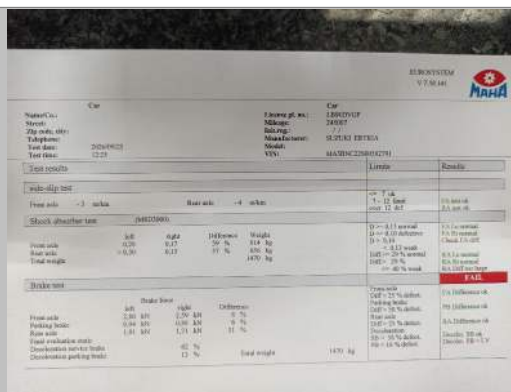

SHOCK AND BRAKE REPORT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00582791



CONDITION REPORT



Report No:

2017303402

DATE

25/09/2026



DIAGNOSTIC REPORT



Center Console / Cubbyhole + Lid



Seat Rear (2. Row)



Door Front Right



Tail Light Right



Tail Light Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00582791



CONDITION REPORT



Report No:
2017303402
DATE
25/09/2026



Boot Lid / Hatch door



Boot Lid / Hatch door



Rear Fender Left



Door Rear Left



Front Fender Left



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00582791



CONDITION REPORT



Report No:
2017303402
DATE
25/09/2026



Headlight Left



Rim Front Right



Tyre Front Right



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00582791



CONDITION REPORT



Report No:

2017303402

DATE

25/09/2026




Front Bumper



Front Bumper



Front Bumper

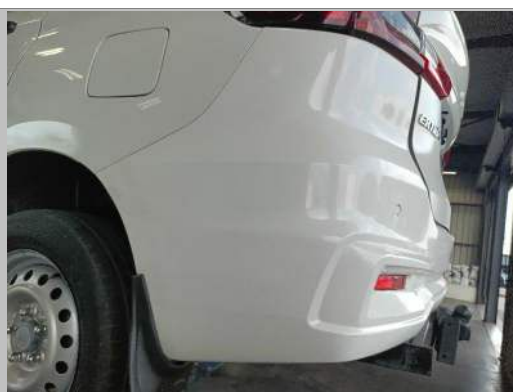

Rear bumper



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00582791



CONDITION REPORT



Report No:
2017303402
DATE
25/09/2026



Rear bumper



Rear bumper



Spare Tyre



Main Beam Left



Main Beam Left



Main Beam Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00582791



CONDITION REPORT



Report No:
2017303402
DATE
25/09/2026



Main Beam Right



Gear Lever Dust Boot

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00582791