



CONDITION REPORT



Report No:
2017303984
DATE
28/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/09/2026		M57 Pretoria Road - 1619
Inspection Date	28/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	SUZUKI	Registration Number	MZ34SVGP
Model	ERTIGA 1.5 GA MPV [2025-ON]	Register Number	
VIN	MA3BNC22S00C07076	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2027
Color	SILVER	Power / Displacement	
Year Model	2026	Paint Finish	TWO COAT UNI
Km Reading	12,007 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00C07076



CONDITION REPORT



Report No:

2017303984

DATE

28/09/2026

Damage

Repair Way

Engine Oil Sweat	Repair
Radio/CD/USB Missing	Replace
Front Bumper Damaged	Repair
Front Fender Left Dented	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Main Beam Right Dented	Repair
Wheel Spanner Missing	Replace
Triangle Missing	Replace
Deceleration parking brake defective	Repair
Front bumper stiffener damaged	Repair
Rear left and right storage lids missing.	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.48	2.53	-	
Rear	1.81	1.92	-	
Emergency / Parking	0.86	0.98	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65 R15	88H	Bridgestone	Ecopia	V	4925	5 mm
Front Right	185/65 R15	88H	Bridgestone	Ecopia	V	4925	5 mm
Rear Left	185/65 R15	88H	Bridgestone	Ecopia	V	4925	5 mm
Rear Right	185/65 R15	88H	Bridgestone	Ecopia	V	4925	5 mm
Spare	185/65 R15	88H	Bridgestone	Ecopia	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00C07076



CONDITION REPORT



Report No:
2017303984
DATE
28/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS/ESP(ANTI-LOCK BRAKING SYSTEM/ELECTRONIC STABIL	C1037	STEERING ANGLE SENSOR POWER SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00C07076



CONDITION REPORT



Report No:

2017303984

DATE

28/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00C07076



CONDITION REPORT



Report No:
2017303984
DATE
28/09/2026



INTERIOR (FRONT DRIVER DOOR)



Manual Transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



VIN PLATE OR STICKER



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00C07076



CONDITION REPORT



Report No:
2017303984
DATE
28/09/2026



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick



LF TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00C07076



CONDITION REPORT



Report No:

2017303984

DATE _____

28/09/2026



LR TYRE TREAD




RR TYRE TREAD



Spare Wheel

[illegible]

Brake and shock absorber repor

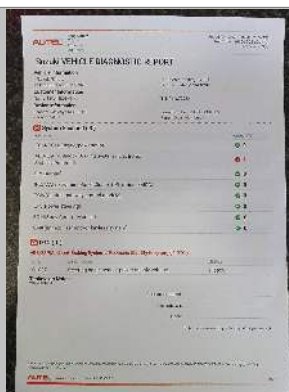

Diagnostic report



Front bumper stiffener

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00C07076



CONDITION REPORT



Report No:

2017303984

DATE

28/09/2026



Jack



Radio/CD/USB



Rear bumper



Rear bumper



Rear bumper



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00C07076



CONDITION REPORT



Report No:
2017303984
DATE
28/09/2026



Front Fender Left



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00C07076



CONDITION REPORT



Report No:
2017303984
DATE
28/09/2026



Water level



Main Beam Right



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3BNC22S00C07076