



CONDITION REPORT



Report No:
2017302446
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	SUZUKI	Registration Number	KNG279NW
Model	BALENO 1.4 GLX 5-DR AT [2016-2017]	Register Number	
VIN	MA3EWB52S00430752	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	SILVER	Power / Displacement	
Year Model	2018	Paint Finish	TWO COAT METALLIC
Km Reading	157,108 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3EWB52S00430752



CONDITION REPORT



Report No:

2017302446

DATE

23/09/2026

Damage

Repair Way

Parcel Tray Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Rear Fender Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Repair
Shock Absorber Rear Left Worn	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.68	2.52	-	
Rear	1.81	1.83	-	
Emergency / Parking	1.08	0.96	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/55R16	83H	Roadx	Radial	V	4223	2 mm
Front Right	185/55R16	83H	Roadx	Radial	V	4223	2 mm
Rear Left	185/55R16	83H	Roadx	Radial	V	4223	2 mm
Rear Right	185/55R16	83H	Roadx	Radial	V	4223	3 mm
Spare	T135/70R15	99M	JKTyre	Radial	V	0618	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3EWB52S00430752



CONDITION REPORT



Report No:
2017302446
DATE
23/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS/ESP	C1036	LEFT REAR WHEEL SPEED SENSOR	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: 4 DTC'S AT TIME OF TESTING SEE DTC REPORT. ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Foreign substance on oil filler cap.

Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3EWB52S00430752



CONDITION REPORT



Report No:

2017302446

DATE

23/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3EWB52S00430752



CONDITION REPORT



Report No:

2017302446

DATE

23/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Automatic.



LR TYRE TREAD



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3EWB52S00430752



CONDITION REPORT



Report No:

2017302446

DATE

23/09/2026



RF TYRE TREAD



RR TYRE TREAD



Undercarriage rear.



Oil cap and dipstick.



Undercarriage front.



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3EWB52S00430752




CONDITION REPORT




Report No:
2017302446
DATE
23/09/2026




LICENSE DISC

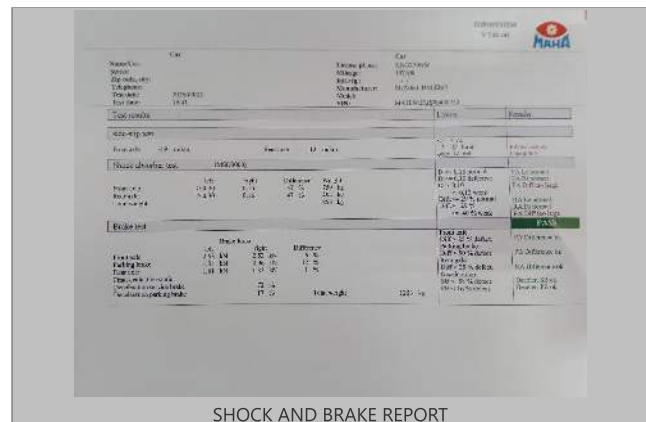


SHOCK AND BRAKE REPORT

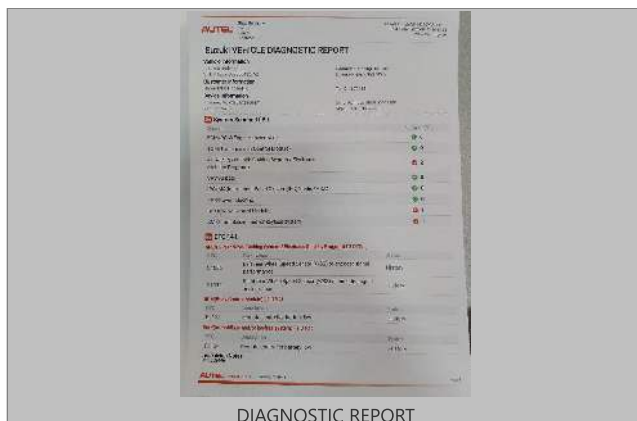


DIAGNOSTIC REPORT

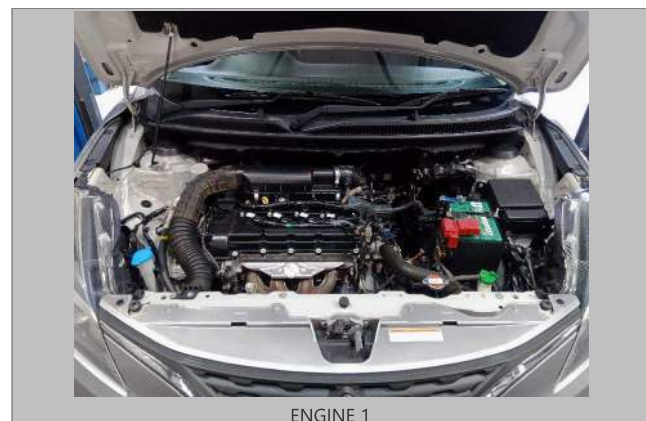

ENGINE 1

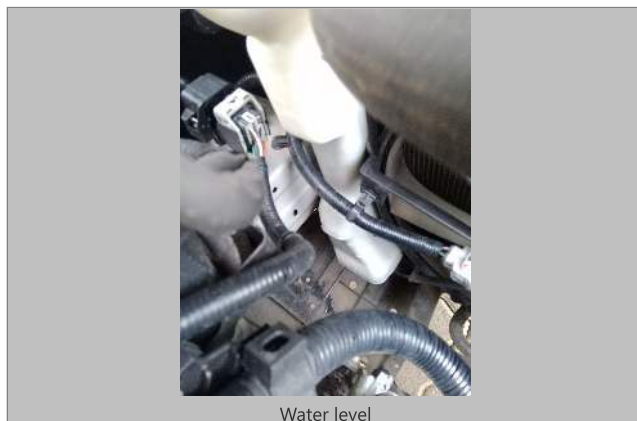

Water level

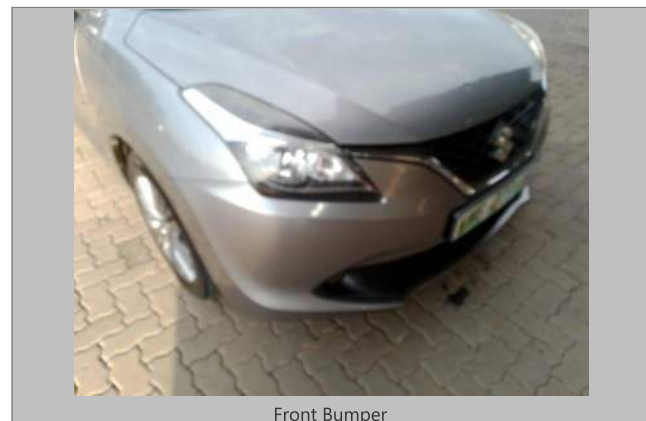

Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3EWB52S00430752



CONDITION REPORT



Report No:

2017302446

DATE

23/09/2026



Front Bumper



Bonnet



Door Rear Left



Rear Fender Left



Front Fender Left



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3EWB52S00430752



CONDITION REPORT



Report No:

2017302446

DATE

23/09/2026



Rear bumper



Door Rear Right



Door Front Right



Windscreen



Parcel Tray



Shock Absorber Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3EWB52S00430752