



CONDITION REPORT



Report No:
2017305156
DATE
30/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/09/2026		M57 Pretoria Road - 1619
Inspection Date	30/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	SUZUKI	Registration Number	KH11LHGP
Model	VITARA BREZZA 1.5 GLX AT [2021-2024]	Register Number	
VIN	MA3NYFJ1S00837648	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2027
Color	GREY	Power / Displacement	
Year Model	2021	Paint Finish	M - METALLIC
Km Reading	115,903 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3NYFJ1S00837648




CONDITION REPORT



Report No:
2017305156
DATE
30/09/2026

Damage

Repair Way

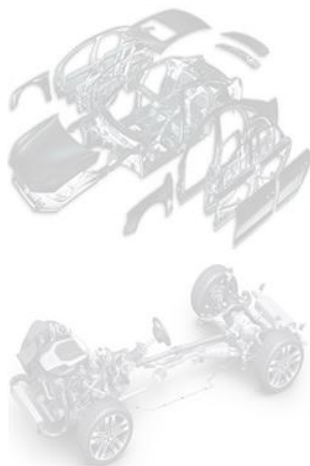

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.8	3.0	-	
Rear	1.8	1.5	-	
Emergency / Parking	2	2.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R16	95H	Apollo	Alnac	V	3221	2 mm
Front Right	215/60R16	95H	Apollo	Almac	V	3221	4 mm
Rear Left	215/60R16	95H	Apollo	Alnac	V	3221	2 mm
Rear Right	215/60R16	95H	Apollo	Alnac	V	3221	2 mm
Spare	215/60R16	95H	Apollo	Alnac	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3NYFJ1S00837648



CONDITION REPORT



Report No:
2017305156
DATE
30/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIR CONDITIONING	B1504	SOLAR SENSOR AND/ OR ITS CIRCUIT FAULT	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. BODY EXTERIOR - SIGNS OF SPRAY WORK DONE ON BODY PANELS

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3NYFJ1S00837648



CONDITION REPORT



Report No:

2017305156

DATE

30/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3NYFJ1S00837648



CONDITION REPORT



Report No:
2017305156
DATE
30/09/2026



INTERIOR (FRONT DRIVER DOOR)



Automatic



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3NYFJ1S00837648



CONDITION REPORT




Report No:

2017305156

DATE

30/09/2026

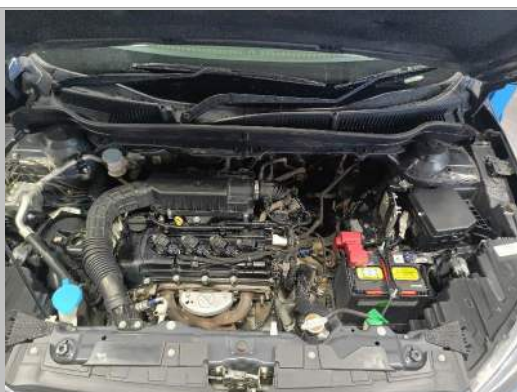

ENGINE 1



ENGINE 2



CHASSIS



REAR



Oil cap and dipstick



Coolant reservoir

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3NYFJ1S00837648



CONDITION REPORT




Report No:


2017305156

DATE _____


30/09/2026

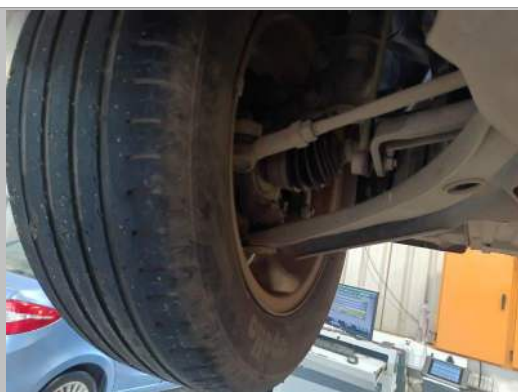

LF TYRE TREAD

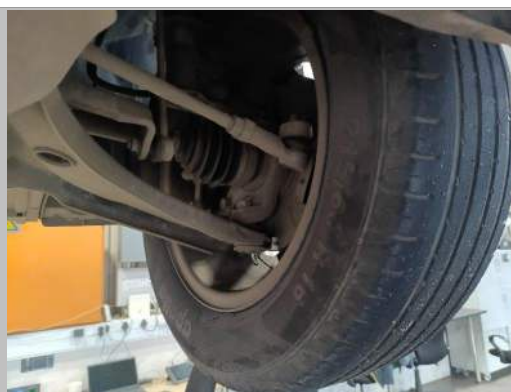

RF TYRE TREAD

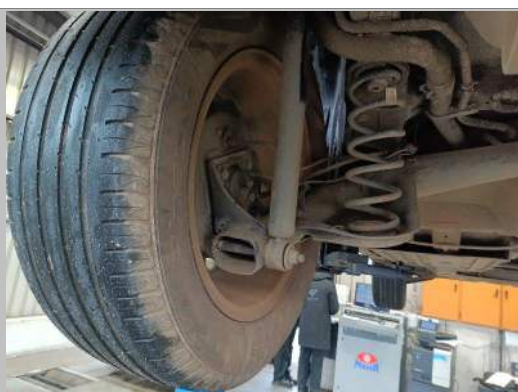

LR TYRE TREAD



RR TYRE TREAD



Sparewheel

[illegible]

Shock and brake report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MA3NYFJ1S00837648




CONDITION REPORT



Report No:
2017305156
DATE
30/09/2026

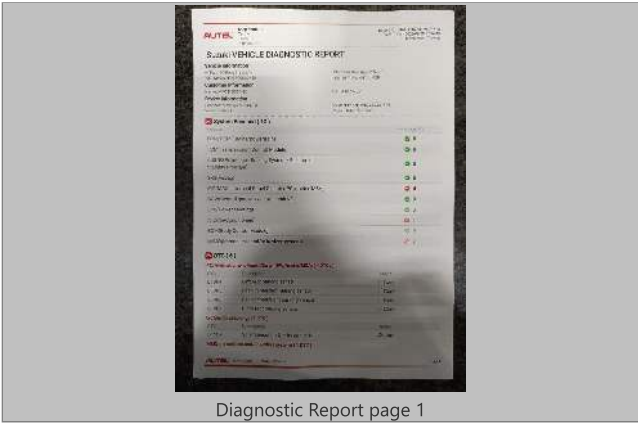

Diagnostic Report page 1

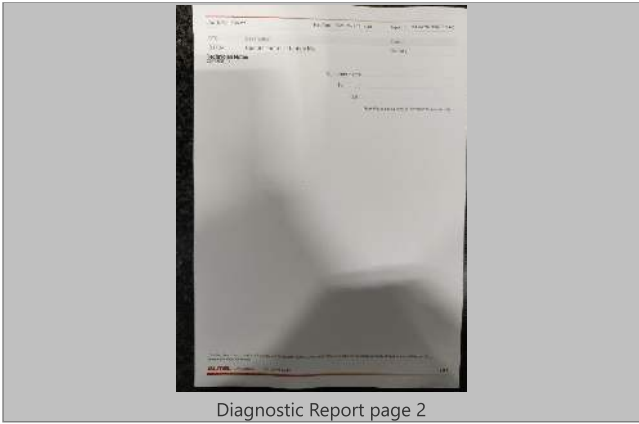

Diagnostic Report page 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3NYFJ1S00837648