



**CONDITION REPORT**

Report No: 2016367649

DATE  
06/05/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	06/05/2024		M57 Pretoria Road - 1619
Inspection Date	06/05/2024		Kempton Park - GT

**Vehicle Data**


Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	SUZUKI	Registration Number	JM76ZFGP
Model	S-PRESSO	Register Number	
VIN	MA3RFL41S00141182	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2023
Color	ORANGE	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	60,891 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

**Vehicle Options & Accessories**

**Items**

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Front Bumper Residual Traces of Repair	Repair
Rear bumper Residual Traces of Repair	Repair
Body exterior	Signs of spray work done on some body panels
Body exterior	Minor dents scratches and stone chips on some body

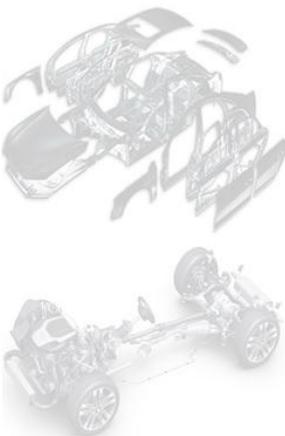

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MA3RFL41S00141182



## CONDITION REPORT

Report No: 2016367649

DATE  
06/05/2024

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	1.9	2.1	-	
Rear	1.0	0.9	-	
Emergency / Parking	0.7	0.6	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81S	MRF	ZVTV	V	4919	4 mm
Front Right	165/70R14	81S	MRF	ZVTV	V	4919	3 mm
Rear Left	165/70R14	81S	MRF	ZVTV	V	4919	5 mm
Rear Right	165/70R14	81S	MRF	ZVTV	V	4919	5 mm
Spare	165/70R14	81S	MRF	ZVTV	V	0000	5 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

### Inspection Conditions

No Test Drive  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. RESIDUAL TRACES OF REPAIR WORK DONE ON SOME BODY PANELS.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

Report No: 209036769


2 / 8

DATE

06/05/2024

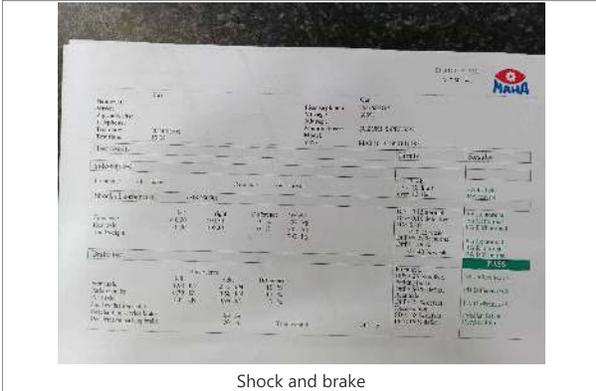

Shock and brake

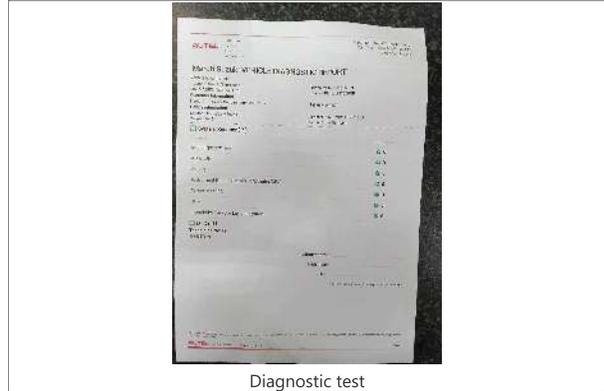

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016367649**

VIN: MA3RFL41S00141182

**DATE**

**06/05/2024**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016367649

DATE 06/05/2024  
VIN: MA3RFL460052024  
4/8



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016367649**

**DATE**  
**06/05/2024**

VIN: MA3RFL41S00141182

5 / 8

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016367649

DATE  
06/05/2024

VIN: MA3RFL41S00141182

6 / 8



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016367649**

**DATE**  
**06/05/2024**

VIN: MA3RFL41S00141182

7 / 8

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016367649

DATE  
06/05/2024



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016367649

DATE  
06/05/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016367649

DATE  
06/05/2024



Coolant reservoir



Front Bumper



Front Bumper



Front Bumper



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016367649

DATE  
06/05/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

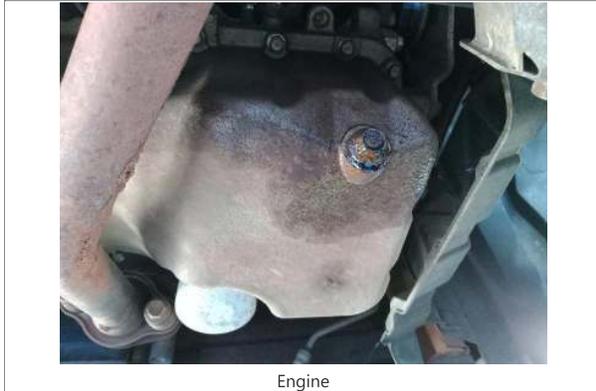



**CONDITION REPORT**

**Report No: 2016367649**

**DATE**  
**06/05/2024**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za